

City of Alexandria Storm Sewer Capacity Analysis (CASSCA)

Four Mile Run Condition Assessment

PREPARED FOR: City of Alexandria, CH2M Hill
PREPARED BY: Baker
DATE: January 4, 2013 (Revised May 26, 2015)

Introduction

As part of the City of Alexandria CASSCA project, a visual inspection of the storm sewer structures within Four Mile Run was completed. The inspected storm sewer structures included 455 manholes, 189 inlets, 6 catch basins, 2 culvert points, 2 control devices, 1 node, and 44 I/O structures. In addition, 1,414 storm sewer pipe segments were inspected. This Technical Memorandum describes the results of the field investigations in the Four Mile Run watershed.

The inspections were performed by Video Pipe Services (VPS) using the "Lamping" technique. Lamping involves the use of a pole-mounted optical zoom camera to visually assess the condition of the buried infrastructure. The lamping method is an unconfined space inspection procedure that does not require entry into a manhole. The use of an optical zoom camera allows field crews to remain at ground level of a storm structure and screen the structure and its connecting pipes for defects. The lamping technique is a preliminary inspection tool to assess the condition of buried infrastructure and determine if further investigation or repair is warranted. In addition to visually inspecting the stormwater structures and pipes, field crews from VPS obtained the size and invert measurements of storm pipes.

Closed-Circuit Television (CCTV) pipe inspections were also conducted in Four Mile Run for the corrugated metal pipe (CMP) segments. The number of CMP segments represents a small fraction (less than 1%) of the total storm infrastructure length in Four Mile Run. The results of the condition assessment of the CMP inspections will be provided in a separate memorandum.

The storm sewer structures and pipes were inspected utilizing the Pipeline Assessment and Certification Program (PACP©) coding standards developed by the National Association of Sewer Service Companies, and were assessed further using the Sewer Condition Risk Evaluation Algorithm Model (SCREAM™). In addition to visually inspecting the storm structures and pipes, field crews from VPS also obtained the size and invert measurements of storm pipes. The data collected from the field work was logged into a database using the *SCREAM Manhole and Lamping Inspection Field Tool*, revised August 2011 (Revision 6) and included as Appendix B in the *CASSCA Field Investigation Manual* delivered to the City of Alexandria in August 2011.

SCREAM is a system of assessment algorithms and tables that synthesizes data produced from asset inspection methods such as CCTV, zoom camera lamping, smoke & dye testing, sonar, laser profiling, manhole and catch basin visual inspections. Each structure or pipe segment was assigned a score according to the visual inspection results. The SCREAM scoring system produces scores for the overall asset condition, and also for the categories of Structural, Maintenance and I/I group defects for each asset. A scoring scale of 1 to 100 for each defect is automatically assigned when the operator enters the defect code. A score of 1 represents a very minor defect and a score of 100 represents the most severe defect. To represent the overall condition of a pipe or MH, an overall score is derived from the scores of the individual defects utilizing the SCREAM program.

The following defect categories as shown in Table 1 have been established in SCREAM for different conditions of sewer facilities along with corresponding ranges for each defect category. Note that the examples provided are meant to show a typical defect found in an asset that would result in the condition category rating.

Table 1 - SCREAM Defect Categories

Defect Category	Score Range	Example
None	0	n/a
Few	1-20	Infiltration weeper
Minimum	21-40	Manhole cracks less than 1/8"
Moderate	41-60	Spalling of chamber wall, large infiltration flow
Major	61-80	Large cracks in cover or frame
Extreme	81-100	Collapsed Pipe

Structure Inspections

Figure 1 is a summary of the inspection results by severity of structure condition score. Figure 2 is provided to show the location of each structure within the Four Mile Run watershed, color coded to the defect categories listed above. The average condition score of 699 storm structures inspected within the Four Mile Run watershed was 45 (Moderate). Approximately 27% had scores 61 or higher, placing them in the major and extreme categories. About 18% of the structures showed few to no defects, while the remaining 55% of structures ranked in the medium to moderate defect categories.

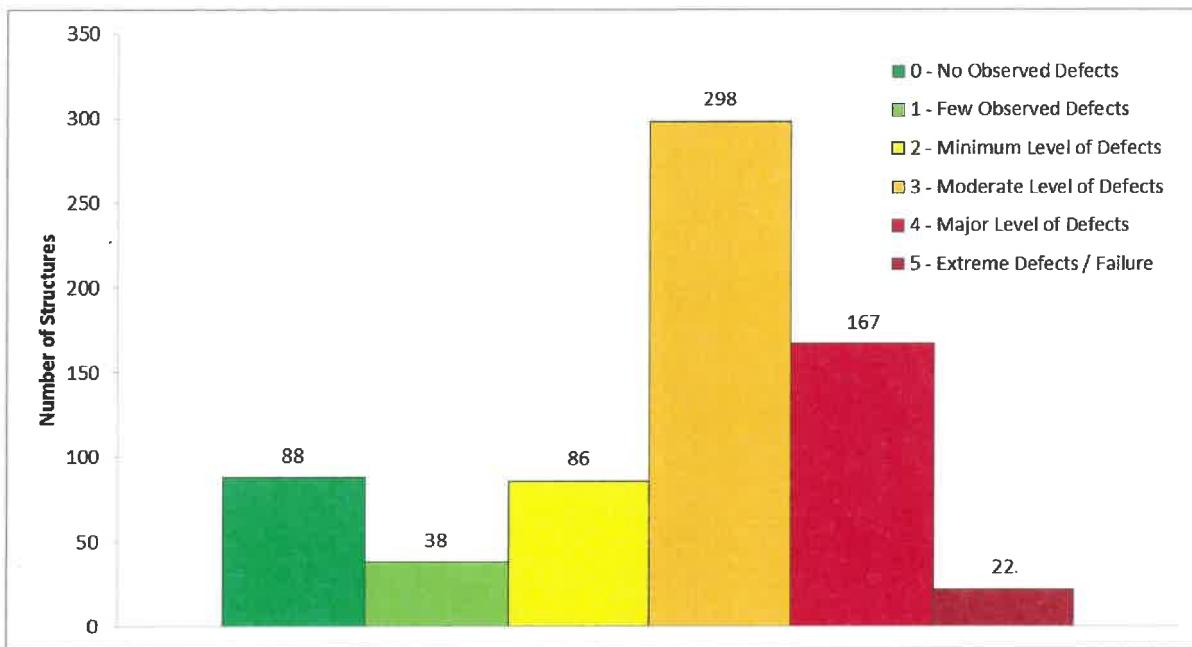


Figure 1. Structure Inspection Summary.

Figure 2. Overall Condition of Storm Structures (Color coded by Severity of Defects).

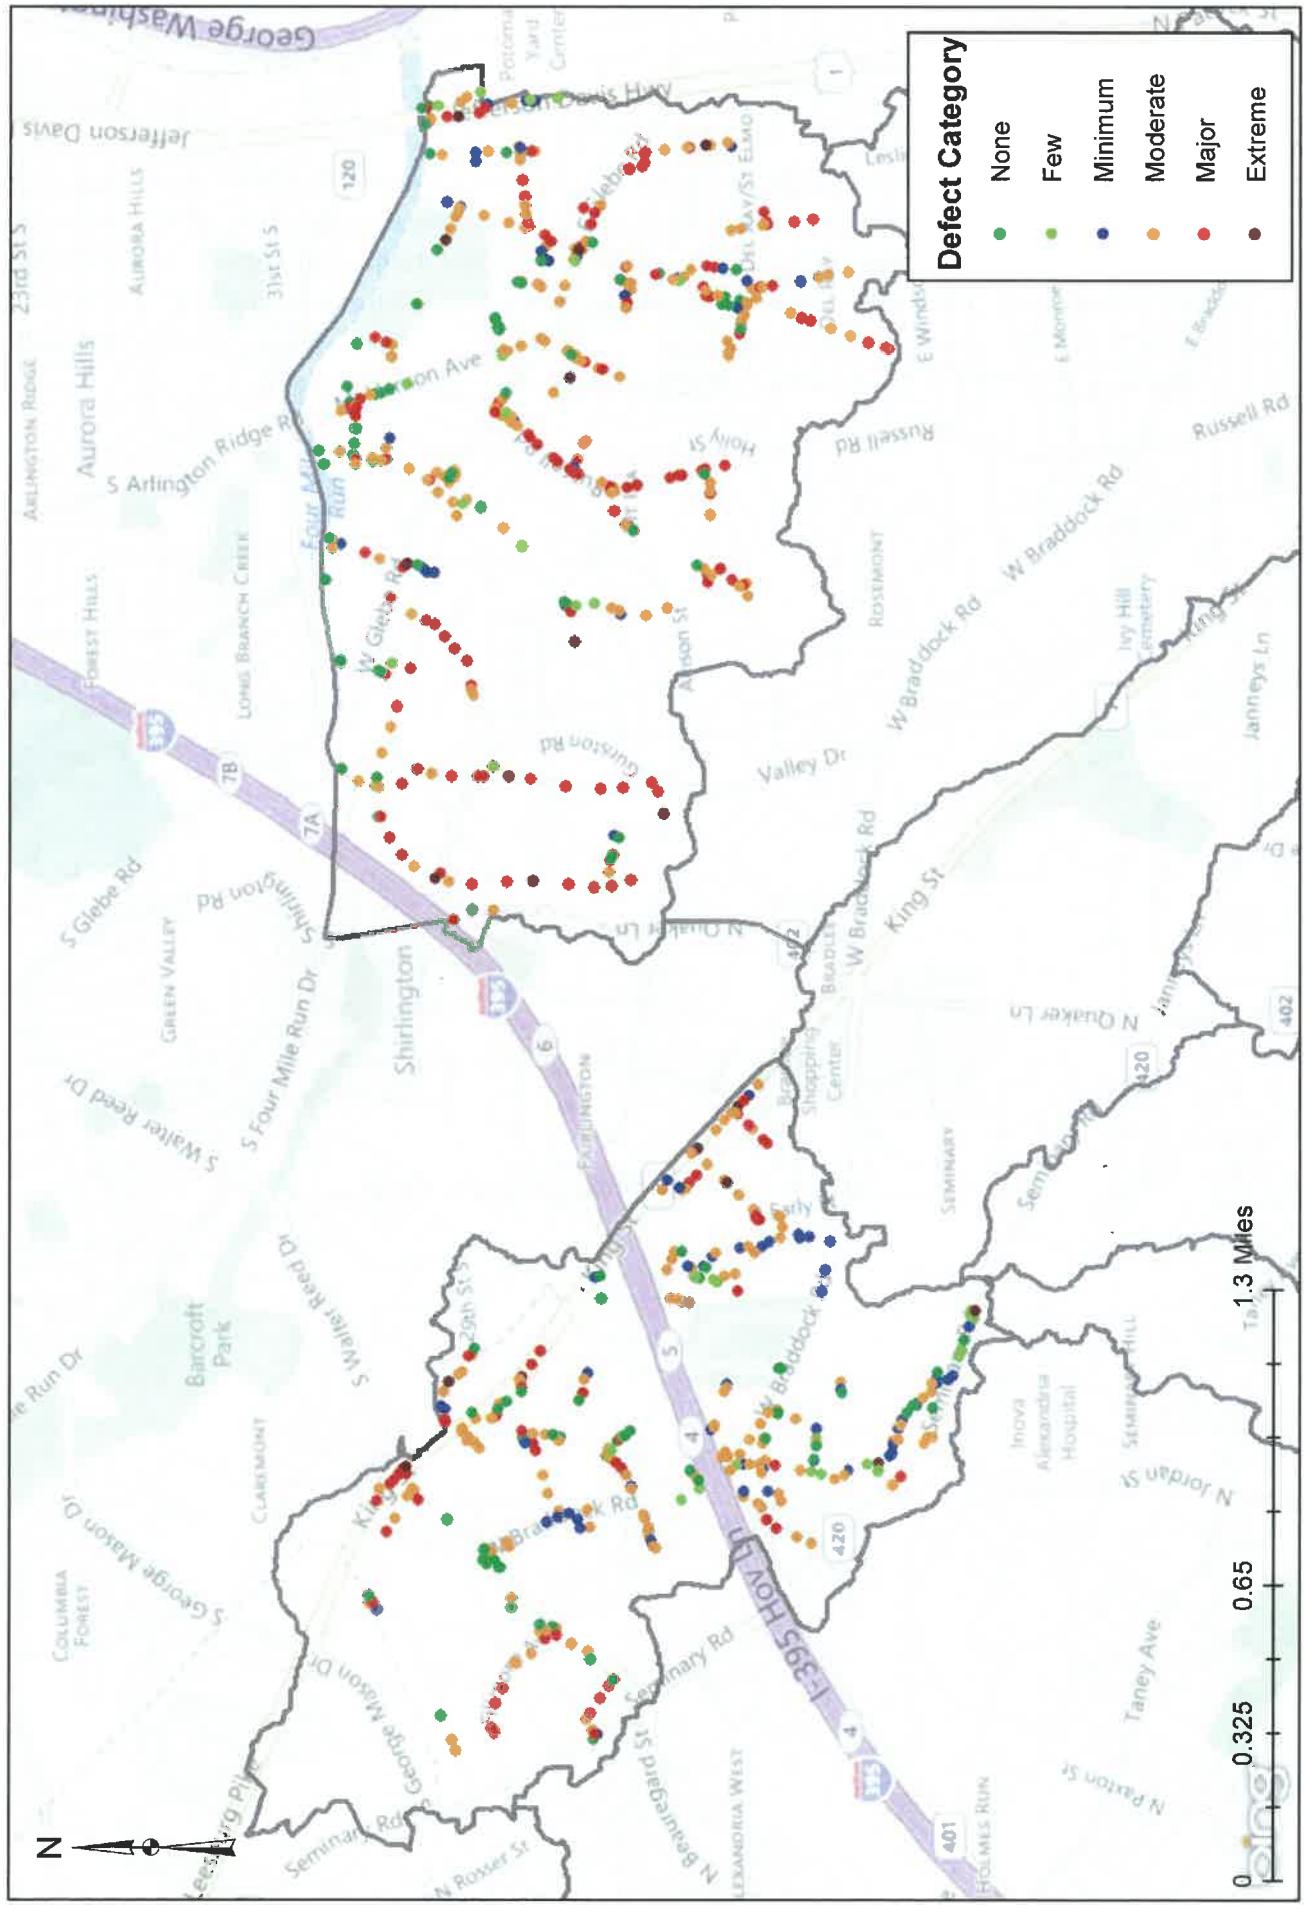



Figure 3 displays the location of the structures classified with major and extreme damage only. In the east side of the Four Mile Run watershed, the corridors of Martha Custis Drive, Valley Drive, Russell Road, and Commonwealth Avenue seem to have clusters of structures with high defect scores. The western side of the watershed seems to have fewer patterns, though there are some clusters along King Street and at the intersection with Beauregard Street. Appendix A: Structure Inspection Summary provides a breakdown of the observed defects and the SCREAM defect score of each storm structure.

The inspections of the structures were broken down by structure component for further detailed condition assessment. Table 2 lists the number of observed defects, by component and severity, tallied from all of the inspections. Please note that this is a count of the number of defects found in each component and their respective severity, not the number of inspections performed. Multiple defects may be found in a single component of a structure.

Table 2 - Count of Structure Inspection Observations by MH Component and Severity.

Structure Component	Min	Mod	Maj	Extreme
Cover	26	8	11	11
Frame	113	39	11	2
Frame Base Seal	624	138	21	2
Grade Ring	40	22	9	3
Chimney/Shaf	753	145	24	3
Chamber	1249	196	22	3
Bench	16	7	1	2
Steps	3	2	1	
Channel	40	37	13	6
Pipe Connection	31	50	8	5

Figure 3. Location of Storm Structures in the "Major" and "Extreme" Categories (Color coded by Severity of Defects).

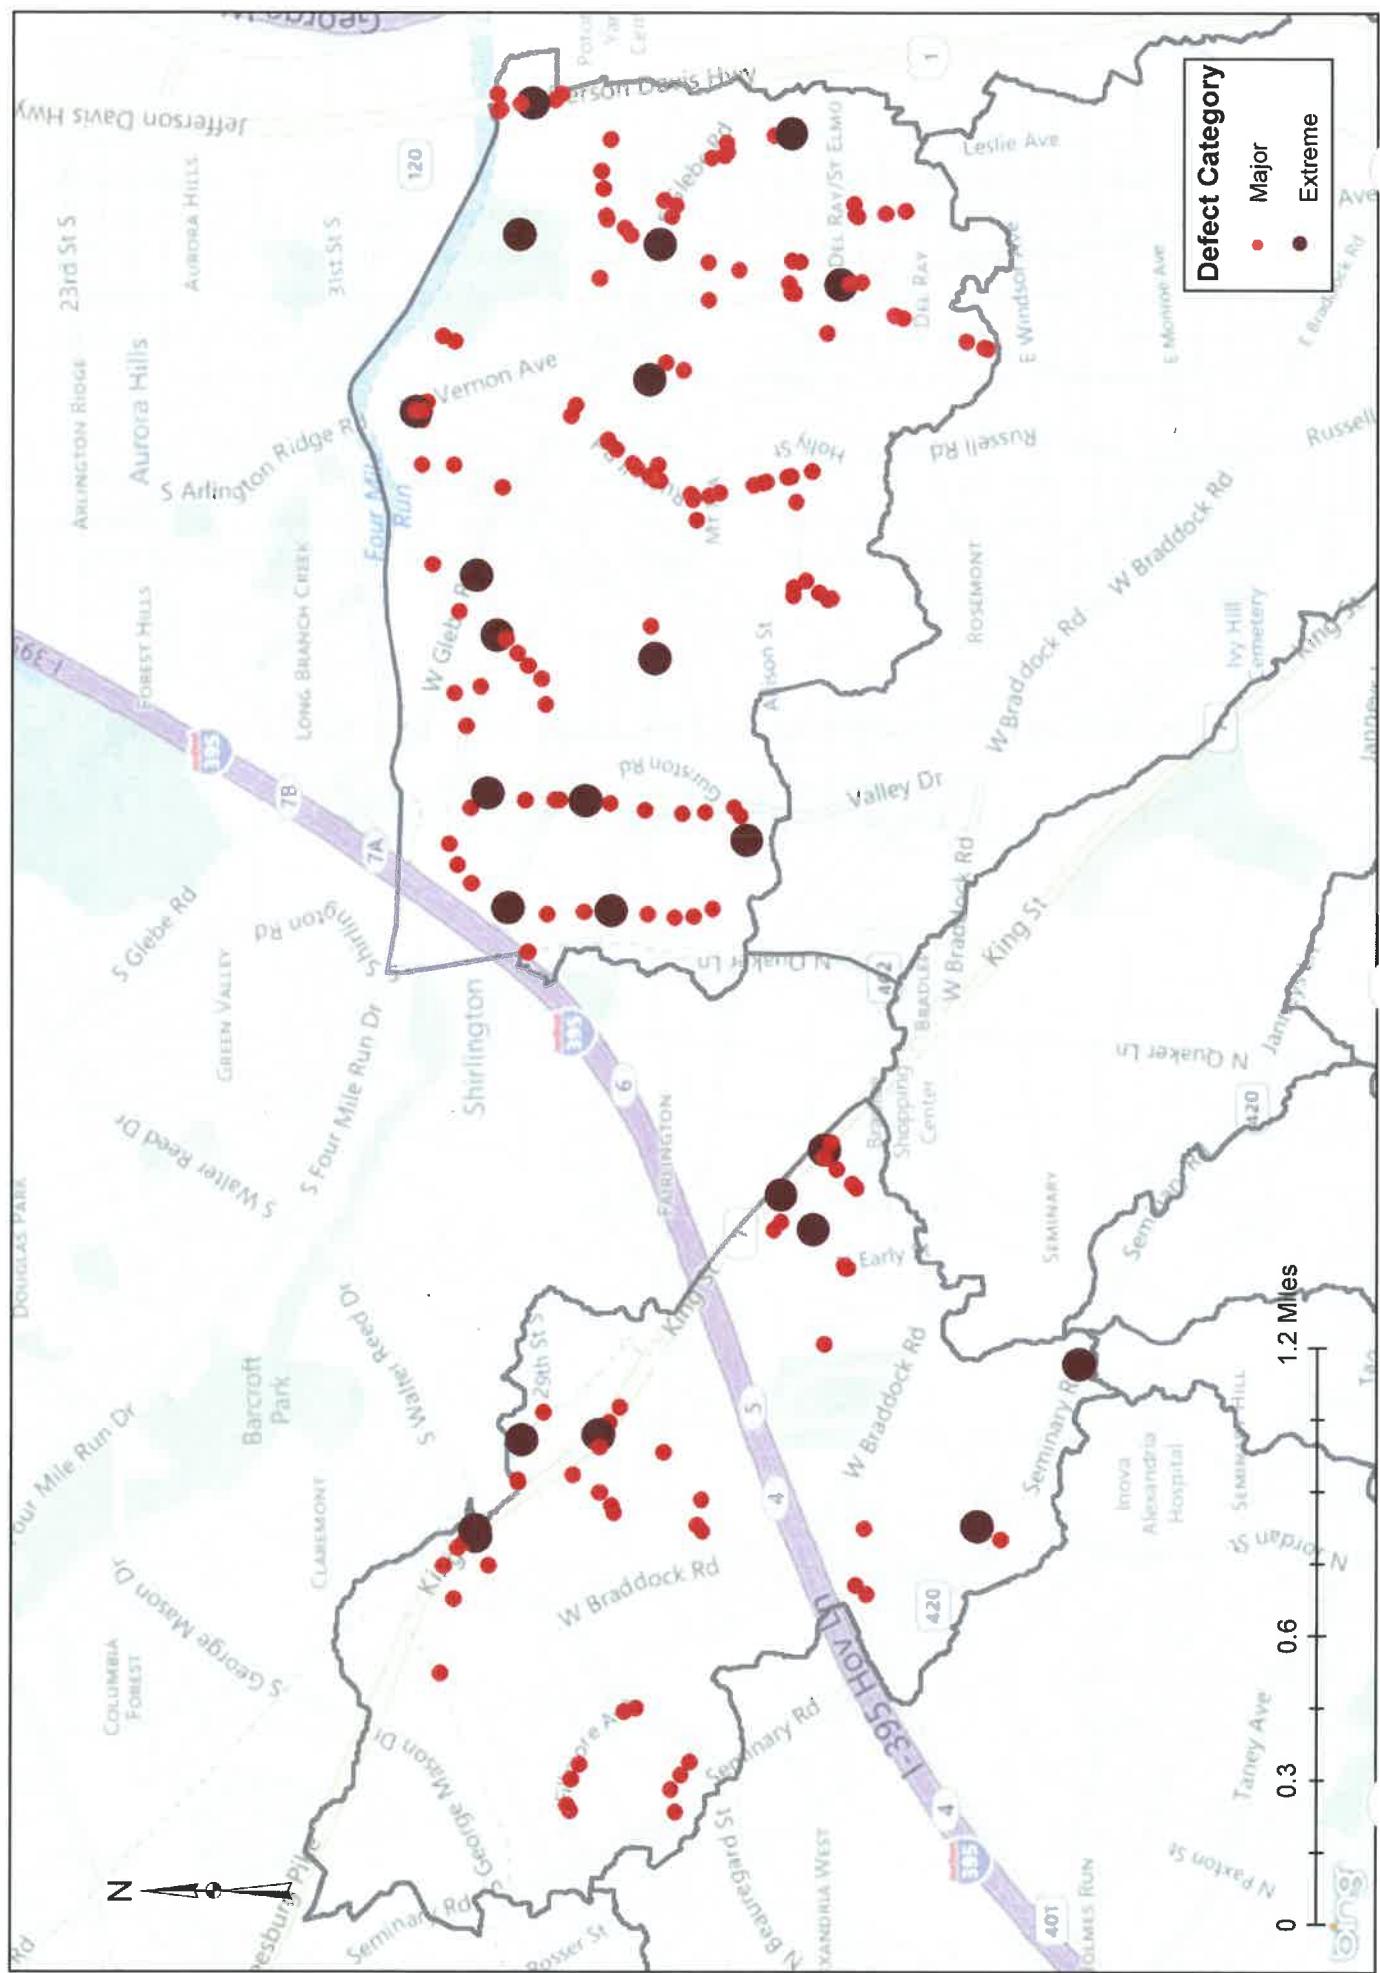

Observed defects were frequently associated with the chamber, chimney, and frame base seal components. Of the defects classified as major and extreme, most of them were still associated with the chamber, chimney, and frame base seal areas. Major damage to the chamber, for example, would be 25-50% material loss due to corrosion or pitting, a crack up to $\frac{1}{4}$ " wide, or active infiltration streaming through the wall. The manhole cover was also a common component with many major or extreme defects. Figure 4 shows an example of a badly deteriorated cover.



**Figure 4. Cover Deterioration on Structure 000104SMH
(Overall SCREAM Score = 88).**

There were 41 structures for which inspections were partially conducted at the surface only (manhole lid is locked, bolted, or jammed) or not conducted at all (structure could not be found in the field). Appendix C: Summary of Structures Not Inspected provides a breakdown of the reasons why these manholes were not inspected.

Pipeline Inspections

Figure 5 is a summary of the inspection results by severity of the pipe defect, and Figure 6 shows the location of each inspected pipeline, color coded by defect severity. The average condition score of 1,414 storm pipe segments inspected within the Four Mile Run watershed area was 2.5 (Few). Inspection results in Four Mile Run showed that the pipe segments were generally in excellent condition, with 93% of the pipes exhibiting no defects. Twenty-three (23) segments fell within the “few” defect category, 59 segments in the minimum category, and 11 in the moderate defect category. These kinds of defects include circumferential or longitudinal cracks, infiltration evidence, minor joint separation, and small root intrusions. Five (5) pipes with more severe defects (scores 61 and up) suffered problems such as multiple cracks, significant infiltration, open or offset joints, or broken pipes. Two (2) pipes had extreme damage (score of 100): one pipe was filled with debris, and the other was collapsed. Figures 7 and 8 are images from the inspections.

Appendix D: Summary of Observed Pipe Defects, lists each inspected pipe with a defect, the nature of the problem(s), and the SCREAM total score.

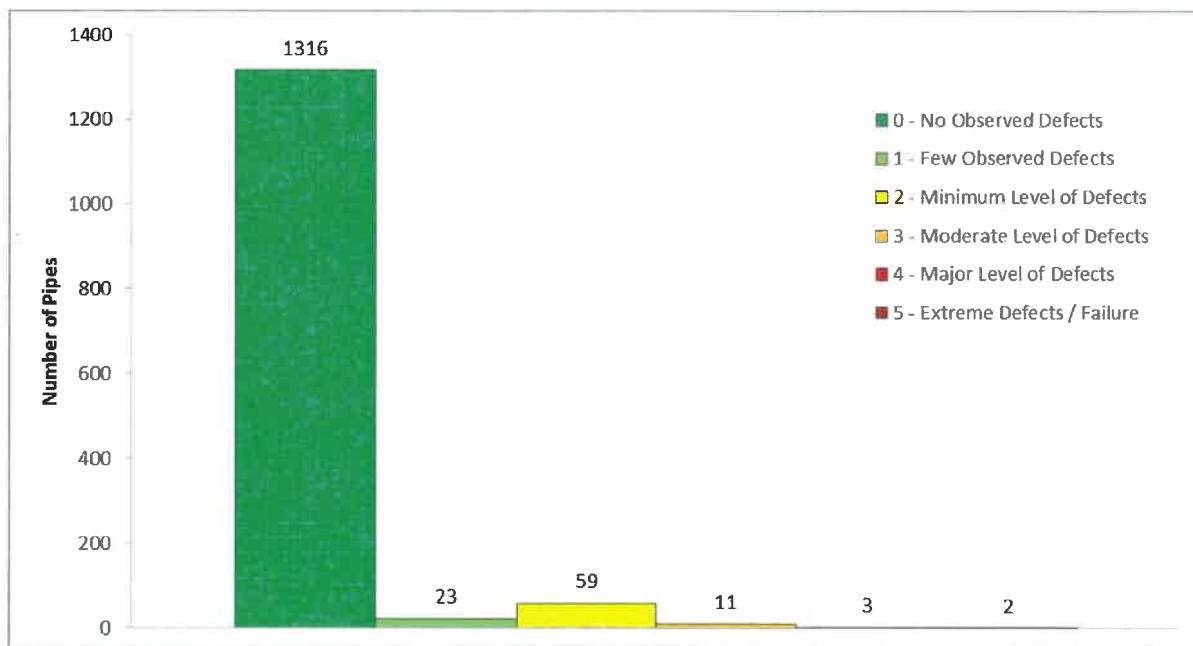
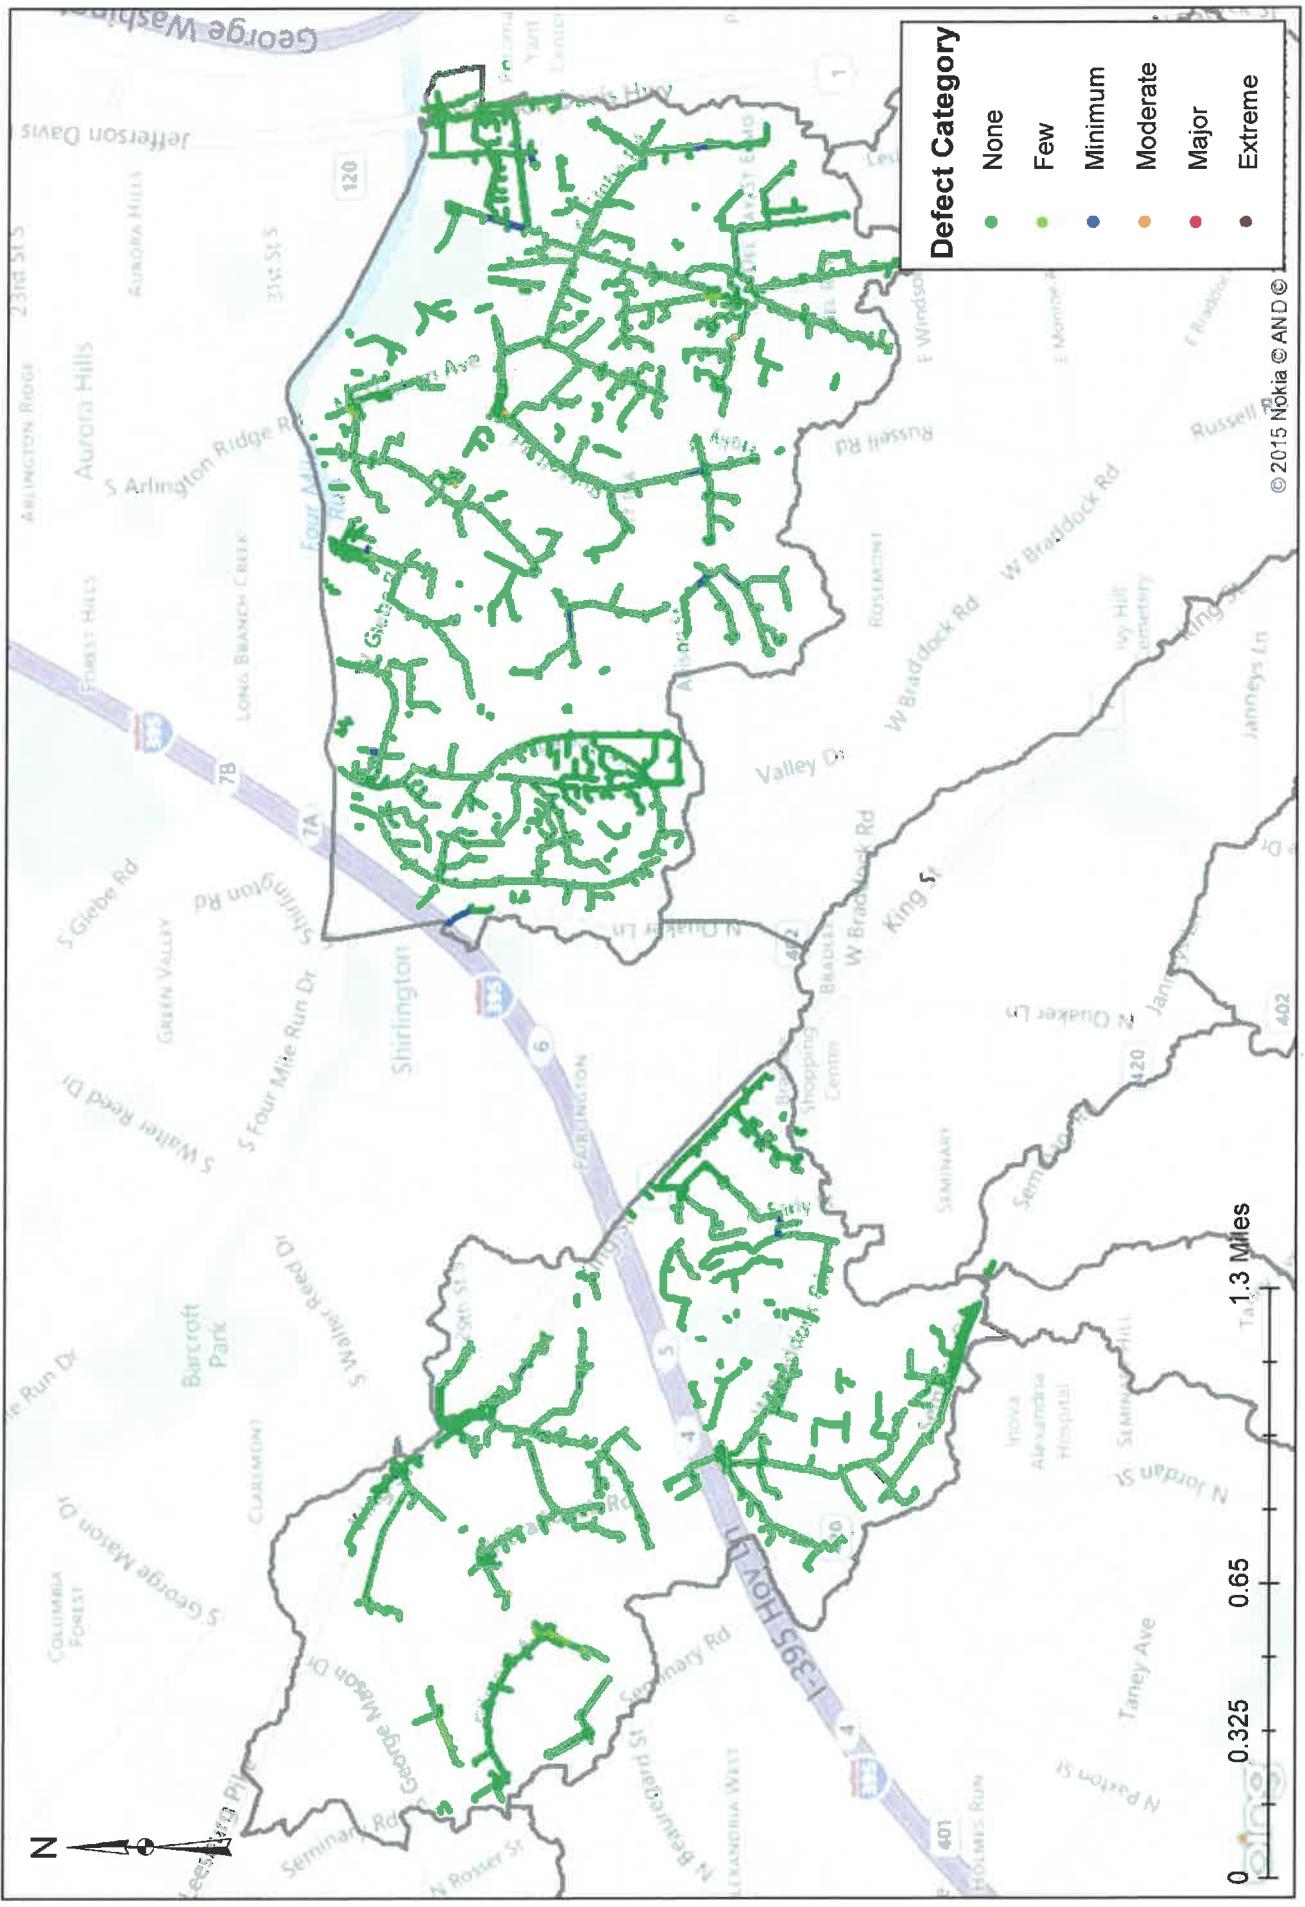


Figure 5. Pipe Lamping Inspection Summary.

Figure 6. Overall Condition of Storm Pipelines (Color coded by Severity of Defects).





**Figure 7. Debris in 36-in Storm Pipe between Structures 000071ND and 000180SMH
(Overall SCREAM Score = 100).**



**Figure 8. Broken 24-in Storm Pipe between Structures 001481SMH and 001496SMH
(Overall SCREAM Score = 100).**

Summary

In total, 699 storm sewer structures and 1,414 associated pipelines were visually inspected for defects and damage using the lamping technique of condition assessment. Overall, the storm sewer infrastructure within the Four Mile Run shed is in good condition. The average condition score for storm structures was 45 (Moderate) and the average condition score for pipe segments was 2.5 (Few). About 27 percent of the structures were in the major or extreme defect categories; fewer than one percent of the storm pipes inspected had were in the major or extreme categories.

Appendix A - Structure Inspection Summary

(Sorted by Defect Score)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Total MH Score

Alexandria - Four Mile Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Ill score	MH Maint Score	MH Field Flow (gpm)	Pot II Connecting Pipes
FOUR MILE RUN	001787SMH	X	3750	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	99	99	0	0	4
FOUR MILE RUN	002237SMH	X	710	CHALFONTE DR	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	99	99	0	0	3
FOUR MILE RUN	002271SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	99	99	0	0	2
FOUR MILE RUN	002749SMH	X	1	W GLEBE RD	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	99	99	0	0	5
FOUR MILE RUN	002816SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	99	99	0	0	3
FOUR MILE RUN	003712IN	X	4135	SEMINARY RD	Yard-Side	02/03/2012	Truck 1	Complete Inspection	99	99	15	0	1
FOUR MILE RUN	004658IN	X	1616	STONEBRIDGE RD	Easement	02/02/2012	Truck 1	Complete Inspection	99	99	0	0	2
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV	Driveway	03/01/2012	Truck 1	Complete Inspection	99	99	15	0	2
FOUR MILE RUN	001958SMH	X	2802	MT VERNON AV	Sidewalk	02/27/2012	Truck 1	Complete Inspection	97	97	0	0	2
FOUR MILE RUN	000147SMH	X	2425	MENOKIN DR	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	95	95	0	0	4
FOUR MILE RUN	002184SMH	X	216	TENNESSEE AV	Curb/Gutter	02/22/2012	Truck 1	Complete Inspection	95	95	0	0	3
FOUR MILE RUN	002283SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	95	95	0	0	3
FOUR MILE RUN	002338SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	95	95	0	0	2
FOUR MILE RUN	002834SMH	X	720	A W GLEBE RD	Light Highway Rural Streets	02/20/2012	Truck 1	Complete Inspection	95	95	0	0	2
FOUR MILE RUN	000175SMH	X	3846	KING ST	Easement	01/31/2012	Truck 1	Not Inspected - Sealed Lid	94	94	0	0	0
FOUR MILE RUN	000111SMH	X	4903	28TH ST	Light Highway Rural Streets	04/13/2012	Truck 1	Complete Inspection	89	89	15	0	3
FOUR MILE RUN	000104SMH	X	4903	28TH ST	Easement	01/05/2012	Truck 1	Complete Inspection	88	89	0	0	5
FOUR MILE RUN	001869SMH	X	328	HUME AV	Sidewalk	03/05/2012	Truck 1	Complete Inspection	85	85	0	0	4
FOUR MILE RUN	002842SMH	X	802	TENNESSEE AV	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	86	86	0	0	3
FOUR MILE RUN	000330IN	X	3800	KING ST	Easement	01/31/2012	Truck 1	Not Inspected - No Access	83	84	0	0	2
FOUR MILE RUN	002873SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	83	83	35	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004040SMH	X	4622	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	83	84	0	0	2
FOUR MILE RUN	002079SMH	X	511	FOUR MILE RD	Easement	02/20/2012	Truck 1	Complete Inspection	82	82	30	0	3
FOUR MILE RUN	00368SMH	X	4622	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	81	82	0	0	2
FOUR MILE RUN	002080SMH	X	511	FOUR MILE RD	Sidewalk	02/20/2012	Truck 1	Complete Inspection	80	80	0	0	3
FOUR MILE RUN	002197SMH	X	3513	WILSON AV	Alley	03/23/2012	Truck 1	Complete Inspection	80	80	0	0	2
FOUR MILE RUN	002146SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	79	80	0	0	2
FOUR MILE RUN	002748SMH	X	3637	RUSSELL RD	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	79	80	0	0	3
FOUR MILE RUN	002759SMH	X	3125	MT VERNON AV	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	79	80	0	0	4
FOUR MILE RUN	002833SMH	X	3800	FLORENCE DR	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	79	72	50	0	1
FOUR MILE RUN	002064SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	78	79	0	0	2
FOUR MILE RUN	002843SMH	X	3850	CAMERON MILLS RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	78	79	0	0	4
FOUR MILE RUN	000566SMH	X	5200	FILLMORE AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	77	77	0	0	3
FOUR MILE RUN	006806IN	X	110	HUME AV	Alley	02/27/2012	Truck 1	Complete Inspection	77	77	0	0	2
FOUR MILE RUN	001960SMH	X	2700	MT VERNON AV	Sidewalk	02/27/2012	Truck 1	Complete Inspection	76	77	0	0	3
FOUR MILE RUN	002858SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	76	77	0	0	3
FOUR MILE RUN	000558SMH	X	2618	FOSTER AV	Yard-Front	12/19/2011	Truck 1	Complete Inspection	75	76	0	0	2
FOUR MILE RUN	002085SMH	X	3700	COMMONWEALTH AV	Easement	02/20/2012	Truck 1	Complete Inspection	75	75	0	0	2
FOUR MILE RUN	002209SMH	X	3801	RUSSELL RD	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	75	57	50	0	3
FOUR MILE RUN	000189SMH	X	3800	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	74	74	0	0	3
FOUR MILE RUN	001989SMH	X	1	E DEL RAY AV	Light Highway Rural Streets	07/20/2012	Truck 1	Complete Inspection	74	75	15	0	2
FOUR MILE RUN	002060SMH	X	2936	MT VERNON AV	Sidewalk	03/23/2012	Truck 1	Complete Inspection	74	75	0	0	3
FOUR MILE RUN	002235SMH	X	3214	OLD DOMINION BY	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	74	75	0	0	4
FOUR MILE RUN	000134SMH	X	3800	KING ST	Light Highway Rural Streets	03/29/2012	Truck 1	Complete Inspection	73	74	0	0	4
FOUR MILE RUN	001789SMH	X	3399	COMMONWEALTH AV	Sidewalk	03/05/2012	Truck 1	Complete Inspection	72	72	0	0	2
FOUR MILE RUN	001806SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	Truck 1	Complete Inspection	72	70	34	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Il score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002160SMH	X	2	E GLEBE RD	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	72	71	35	0	3
FOUR MILE RUN	0022825SMH	X	2800	SHIRLINGTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	72	73	0	0	2
FOUR MILE RUN	0022935SMH	X	3900	JEFFERSON DAVIS HY Easement		03/29/2012	Truck 1	Complete Inspection	72	73	0	0	2
FOUR MILE RUN	0023175SMH	X	3850	CAMERON MILLS RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	72	73	0	0	3
FOUR MILE RUN	0026835SMH	X	2819	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	72	73	0	0	3
FOUR MILE RUN	0028185SMH	X	3380	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	72	73	0	0	3
FOUR MILE RUN	004192IN	X	4550	KENMORE AV	Sidewalk	03/28/2012	Truck 1	Complete Inspection	72	64	50	0	3
FOUR MILE RUN	0019175SMH	X	2600	MT VERNON AV	Sidewalk	03/06/2012	Truck 1	Complete Inspection	71	72	0	0	3
FOUR MILE RUN	0019505SMH	X	3005	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	71	72	0	0	3
FOUR MILE RUN	0020695SMH	X	3889	COURTLAND CL	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	71	72	0	0	2
FOUR MILE RUN	0020845SMH	X	3809	A MT VERNON AV	Easement	02/20/2012	Truck 1	Complete Inspection	71	72	0	0	3
FOUR MILE RUN	0026845SMH	X	2901	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	71	72	0	0	4
FOUR MILE RUN	0027145SMH	X	66	A KENNEDY ST	Easement	02/22/2012	Truck 1	Complete Inspection	71	72	0	0	2
FOUR MILE RUN	0027765SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	71	72	0	0	2
FOUR MILE RUN	008815IN	X	3360	C GUNSTON RD	Easement	04/17/2012	Truck 1	Complete Inspection	71	57	72	0	2
FOUR MILE RUN	0001015SMH	X	4903	28TH ST	Light Highway Rural Streets	12/28/2011	Truck 1	Complete Inspection	70	71	0	0	2
FOUR MILE RUN	0001105SMH	X	2998	S COLUMBUS ST	Light Highway Rural Streets	04/13/2012	Truck 1	Complete Inspection	70	71	0	0	4
FOUR MILE RUN	0001265SMH	X	3800	KING ST	Light Highway Rural Streets	01/31/2012	Truck 1	Complete Inspection	70	69	10	0	4
FOUR MILE RUN	0018285SMH	X	335	A ASHBY ST	Sidewalk	03/05/2012	Truck 1	Complete Inspection	70	71	0	0	2
FOUR MILE RUN	0018535SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	Truck 1	Complete Inspection	70	70	15	0	3
FOUR MILE RUN	0019485SMH	X	2909	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	70	71	0	0	3
FOUR MILE RUN	0019495SMH	X	3001	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	70	71	0	0	3
FOUR MILE RUN	0021135SMH	X	504	MONTICELLO BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	70	70	0	0	3
FOUR MILE RUN	0021935SMH	X	3508	WILSON AV	Light Highway Rural Streets	03/23/2012	Truck 1	Complete Inspection	70	71	0	0	4
FOUR MILE RUN	0021955SMH	X	3501	WILSON AV	Light Highway Rural Streets	03/23/2012	Truck 1	Complete Inspection	70	71	0	0	5

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002755SMH	X	1	HERBERT ST	Sidewalk	03/16/2012	Truck 1	Complete Inspection	70	54	50	0	3
FOUR MILE RUN	000568SMH	X	5184	DAWES AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	69	69	0	0	4
FOUR MILE RUN	001918SMH	X	1	W M TIDA AV	Easement	03/06/2012	Truck 1	Complete Inspection	69	70	0	0	3
FOUR MILE RUN	002129SMH	X	2908	A RICHMOND LA	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	69	70	0	0	4
FOUR MILE RUN	002299SMH	X	3750	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	69	69	0	0	5
FOUR MILE RUN	002681SMH	X	209	PINE ST	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	69	70	0	0	4
FOUR MILE RUN	002736SMH	X	3401	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	69	70	0	0	3
FOUR MILE RUN	002792SMH	X	3200	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	69	70	0	0	3
FOUR MILE RUN	000371SMH	X	4651	KING ST	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	68	69	0	0	4
FOUR MILE RUN	002034SMH	X	2600	MT VERNON AV	Yard-Side	02/27/2012	Truck 1	Complete Inspection	68	68	0	0	3
FOUR MILE RUN	002318SMH	X	3802	CAMERON MILLS RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	68	69	0	0	3
FOUR MILE RUN	002754SMH	X	3400	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	68	69	0	0	3
FOUR MILE RUN	006441IN	X	329	ASHBY ST	Sidewalk	03/05/2012	Truck 1	Complete Inspection	68	69	0	0	2
FOUR MILE RUN	000115SMH	X	4368	KING ST	Driveway	04/13/2012	Truck 1	Complete Inspection	67	57	35	0	2
FOUR MILE RUN	000153SMH	X	2300	N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	67	68	0	0	2
FOUR MILE RUN	001785SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	67	67	2	0	3
FOUR MILE RUN	001953SMH	X	3111	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	67	68	0	0	3
FOUR MILE RUN	002009SMH	X	1	E DEL RAY AV	Light Highway Rural Streets	03/16/2012	Truck 1	Complete Inspection	67	68	0	0	3
FOUR MILE RUN	002181SMH	X	3301	LANDOVER ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	67	68	0	0	4
FOUR MILE RUN	002269SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	67	68	0	0	2
FOUR MILE RUN	002270SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	67	68	0	0	2
FOUR MILE RUN	002708SMH	X	3000	FULTON ST	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	67	67	0	0	3
FOUR MILE RUN	002737SMH	X	3205	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	67	67	0	0	3
FOUR MILE RUN	002742SMH	X	3509	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	67	68	0	0	3
FOUR MILE RUN	002791SMH	X	3201	RUSSELL RD	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	67	68	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Ill score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000144SMH	X	3900	KING ST	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	66	67	0	0	2
FOUR MILE RUN	000328SMH	X	4700	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	66	67	0	0	4
FOUR MILE RUN	000341SMH	X	2600	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	N BEAUREGARD ST	Light Highway Rural Streets	12/21/2011	Truck 1	Complete Inspection	66	67	0	0	3
FOUR MILE RUN	000365SMH	X	4700	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	66	68	0	0	4
FOUR MILE RUN	001406SMH	X	4550	KENMORE AV	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	66	61	35	0	3
FOUR MILE RUN	002043SMH	X	2601	DE WITT AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	66	67	0	0	3
FOUR MILE RUN	002045SMH	X	201	RANDOLPH AV	Light Highway Rural Streets	03/14/2012	Truck 1	Complete Inspection	66	67	0	0	3
FOUR MILE RUN	002182SMH	X	3314	LANDCOVER ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	66	67	0	0	4
FOUR MILE RUN	002227SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	66	67	0	0	2
FOUR MILE RUN	002247SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	66	67	0	0	2
FOUR MILE RUN	002274SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	66	67	0	0	3
FOUR MILE RUN	002752SMH	X	3200	RUSSELL RD	Light Highway Rural Streets	03/29/2012	Truck 1	Complete Inspection	66	67	0	0	3
FOUR MILE RUN	002806SMH	X	1151	MARTHA CUSTIS DR	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	66	67	0	0	2
FOUR MILE RUN	007114IN	X	100	DALE ST	Curb/Gutter	02/28/2012	Truck 1	Complete Inspection	66	65	15	0	4
FOUR MILE RUN	000109SMH	X	2998	S COLUMBUS ST	Light Highway Rural Streets	04/13/2012	Truck 1	Complete Inspection	65	66	0	0	4
FOUR MILE RUN	000321SMH	X	5001	ECHOES AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	65	66	0	0	5
FOUR MILE RUN	000324SMH	X	3101	N HAMPTON DR	Yard-Side	03/27/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	000374SMH	X	4622	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	65	66	0	0	5
FOUR MILE RUN	000391SMH	X	3400	N BEAUREGARD ST	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	000553SMH	X	5199	HERITAGE LA	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	65	65	15	0	3
FOUR MILE RUN	000567SMH	X	5184	DAWES AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	65	65	0	0	4
FOUR MILE RUN	001994SMH	X	2509	DE WITT AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	65	66	0	0	4
FOUR MILE RUN	002112SMH	X	505	MONTICELLO BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002144SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002188SMH	X	3125	MT VERNON AV	Sidewalk	03/16/2012	Truck 1	Complete Inspection	65	66	0	0	5
FOUR MILE RUN	002224SMH	X	3507	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	65	66	0	0	3
FOUR MILE RUN	002245SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002275SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	3
FOUR MILE RUN	002286SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002314SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	65	65	0	0	3
FOUR MILE RUN	002734SMH	X	3313	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002741SMH	X	3501	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002815SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002855SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	3
FOUR MILE RUN	002863SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	2
FOUR MILE RUN	002864SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	65	66	0	0	3
FOUR MILE RUN	000122SMH	X	3800	KING ST	Light Highway Rural Streets	01/31/2012	Truck 1	Complete Inspection	64	62	20	0	4
FOUR MILE RUN	000133SMH	X	3800	KING ST	Light Highway Rural Streets	03/29/2012	Truck 1	Complete Inspection	64	65	0	0	4
FOUR MILE RUN	000143SMH	X	2701	N VAN DORN ST	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	64	65	0	0	2
FOUR MILE RUN	000340SMH	X	2600	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	64	65	0	0	3
FOUR MILE RUN	001418SMH	X	4550	W BRADDOCK RD	Parking Lot	04/12/2012	Truck 1	Complete Inspection	64	65	0	0	3
FOUR MILE RUN	002008SMH	X	2313	COMMONWEALTH AV	Light Highway Rural Streets	03/16/2012	Truck 1	Complete Inspection	64	65	0	0	4
FOUR MILE RUN	002061SMH	X	2932	MT VERNON AV	Yard-Front	03/06/2012	Truck 1	Complete Inspection	64	65	0	0	2
FOUR MILE RUN	002102SMH	X	308	MONTECILLO BV	Light Highway Rural Alley	03/19/2012	Truck 1	Complete Inspection	64	65	0	0	5
FOUR MILE RUN	002753SMH	X	3405	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	64	65	0	0	3
FOUR MILE RUN	000364SMH	X	3101	N HAMPTON DR	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	63	64	0	0	3
FOUR MILE RUN	000369SMH	X	4622	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	000372SMH	X	4651	KING ST	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	63	64	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Ill score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000386SMH	X	4799	W BRADDOCK RD	Sidewalk	12/27/2011	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	000394SMH	X	5098	DAWES AV	Light Highway Rural Streets	12/22/2011	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	001489SMH	X	4555	SEMINARY RD	Light Highway Rural Streets	04/02/2012	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	002065SMH	X	3910	OLD DOMINION BV	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	002076SMH	X	511	FOUR MILE RD	Sidewalk	02/20/2012	Truck 1	Complete Inspection	63	63	15	0	3
FOUR MILE RUN	002082SMH	X	3917	ELBERT AV	Light Highway Rural Streets	04/06/2012	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	002162SMH	X	3550	COMMONWEALTH AV	Light Highway Rural Streets	03/22/2012	Truck 1	Complete Inspection	63	63	0	0	2
FOUR MILE RUN	002319SMH	X	3707	CAMERON MILLS RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	002739SMH	X	3313	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	63	64	0	0	2
FOUR MILE RUN	002823SMH	X	3800	MILAN DR	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	63	64	0	0	3
FOUR MILE RUN	004047SMH	X	4700	KING ST	Sidewalk	03/29/2012	Truck 1	Complete Inspection	63	62	15	0	3
FOUR MILE RUN	006451IN	X	106	E REED AV	Sidewalk	03/23/2012	Truck 1	Complete Inspection	63	64	0	0	3
FOUR MILE RUN	000105IN	X	4799	W BRADDOCK RD	Curb/Gutter	12/27/2011	Truck 1	Complete Inspection	62	63	0	0	3
FOUR MILE RUN	000152SMH	X	2249	N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	62	64	0	0	2
FOUR MILE RUN	000556SMH	X	5165	SEMINARY RD	Yard-Front	12/19/2011	Truck 1	Complete Inspection	62	63	0	0	3
FOUR MILE RUN	001786SMH	X	3651	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	62	63	0	0	2
FOUR MILE RUN	001788SMH	X	3399	COMMONWEALTH AV	Sidewalk	03/05/2012	Truck 1	Complete Inspection	62	63	0	0	4
FOUR MILE RUN	001792SMH	X	104	1/2 E REED AV	Light Highway Rural Streets	03/23/2012	Truck 1	Complete Inspection	62	63	0	0	5
FOUR MILE RUN	001851SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	Truck 1	Complete Inspection	62	61	15	0	2
FOUR MILE RUN	002111SMH	X	2800	OLD DOMINION BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	62	63	0	0	2
FOUR MILE RUN	002128SMH	X	2804	OLD DOMINION BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	62	63	0	0	4
FOUR MILE RUN	002285SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	Complete Inspection	62	64	0	0	2
FOUR MILE RUN	002320SMH	X	3602	ORLANDO PL	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	62	63	0	0	3
FOUR MILE RUN	002743SMH	X	3600	1/2 RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	62	64	0	0	3
FOUR MILE RUN	002795SMH	X	309	BEVERLEY DR	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	62	64	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002821SMH	X	3800	MILAN DR	Yard-Back	02/20/2012	Truck 1	Complete Inspection	62	59	10	0	3
FOUR MILE RUN	006892IN	X	3900	JEFFERSON DAVIS HY	Sidewalk	03/26/2012	Truck 1	Complete Inspection	62	60	15	0	2
FOUR MILE RUN	000154SMH	X	2249	N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	61	62	0	0	4
FOUR MILE RUN	000257IN	X	3103	PARK CENTER DR	Sidewalk	03/26/2012	Truck 1	Complete Inspection	61	61	0	0	2
FOUR MILE RUN	000320SMH	X	5100	FILLMORE AV	Light Highway Rural Streets	12/21/2011	Truck 1	Complete Inspection	61	62	0	0	3
FOUR MILE RUN	000354SMH	X	2901	N HAMPTON DR	Easement	01/18/2012	Truck 1	Complete Inspection	61	62	0	0	3
FOUR MILE RUN	000397SMH	X	4903	28TH ST	Easement	01/16/2012	Truck 1	Complete Inspection	61	62	0	0	2
FOUR MILE RUN	000399SMH	X	4903	28TH ST	Easement	01/05/2012	Truck 1	Complete Inspection	61	62	0	0	5
FOUR MILE RUN	000461IN	X	4301	W BRADDOCK RD	Yard-Back	01/23/2012	Truck 1	Complete Inspection	61	61	0	0	2
FOUR MILE RUN	000557SMH	X	2648	FOSTER AV	Yard-Front	12/19/2011	Truck 1	Complete Inspection	61	62	0	0	2
FOUR MILE RUN	001813SMH	X	329	A CLIFFORD AV	Sidewalk	03/05/2012	Truck 1	Complete Inspection	61	61	0	0	3
FOUR MILE RUN	002046SMH	X	201	RANDOLPH AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	61	62	0	0	3
FOUR MILE RUN	002049SMH	X	201	RANDOLPH AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	61	62	0	0	5
FOUR MILE RUN	002072SMH	X	3899	COURTLAND CL	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	61	62	0	0	2
FOUR MILE RUN	002295SMH	X	3951	JEFFERSON DAVIS HY	Easement	03/26/2012	Truck 1	Complete Inspection	61	62	0	0	2
FOUR MILE RUN	002846SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	61	62	0	0	2
FOUR MILE RUN	004032SMH	X	509	MONTECILLO BY	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	61	62	0	0	3
FOUR MILE RUN	004041SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	Truck 1	Complete Inspection	61	58	41	0	3
FOUR MILE RUN	007078IN	X	2	E REED AV	Sidewalk	03/22/2012	Truck 1	Complete Inspection	61	61	0	0	2
FOUR MILE RUN	008418IN	X	4007	MT VERNON AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	61	54	35	0	2
FOUR MILE RUN	000173SMH	X	2500	N VAN DORN ST	Parking Lot	02/01/2012	Truck 1	Complete Inspection	60	60	0	0	3
FOUR MILE RUN	000196SMH	X	3900	KING ST	Light Highway Rural Streets	07/20/2012	Truck 1	Complete Inspection	60	61	0	0	3
FOUR MILE RUN	000389SMH	X	4898	W BRADDOCK RD	Light Highway Rural Streets	12/21/2011	Truck 1	Complete Inspection	60	61	0	0	3
FOUR MILE RUN	001797SMH	X	326	E RAYMOND AV	Light Highway Rural Streets	03/05/2012	Truck 1	Complete Inspection	60	61	0	0	2
FOUR MILE RUN	007092IN	X	3700	COMMONWEALTH AV	Driveway	03/01/2012	Truck 1	Complete Inspection	60	44	35	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	0008813IN	X	3360	C GUNSTON RD	Curb/Gutter	04/17/2012	Truck 1	Complete Inspection	60	45	45	0	2
FOUR MILE RUN	000105SMH	X	4903	28TH ST	Driveway	01/05/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	000131SMH	X	3800	KING ST	Light Highway Rural Streets	03/29/2012	Truck 1	Complete Inspection	59	60	0	0	4
FOUR MILE RUN	000920IN	X	2280	N BEAUREGARD ST	Easement	12/22/2011	Truck 1	Complete Inspection	59	60	0	0	3
FOUR MILE RUN	001481SMH	X	4575	SEMINARY RD	Yard-Front	04/02/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	001852SMH	X	3399	COMMONWEALTH AV	Sidewalk	03/05/2012	Truck 1	Complete Inspection	59	60	0	0	3
FOUR MILE RUN	001867SMH	X	327	HUME AV	Light Highway Rural Streets	03/05/2012	Truck 1	Complete Inspection	59	60	0	0	4
FOUR MILE RUN	002037SMH	X	101	KENNEDY ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	59	60	0	0	3
FOUR MILE RUN	002077SMH	X	3899	COURTLAND CL	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	59	61	0	0	3
FOUR MILE RUN	002096SMH	X	511	FOUR MILE RD	Parking Lot	04/02/2012	Truck 1	Complete Inspection	59	57	15	0	2
FOUR MILE RUN	002110SMH	X	2800	OLD DOMINION BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	59	60	0	0	4
FOUR MILE RUN	002183SMH	X	3315	LANDOVER ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	59	60	0	0	3
FOUR MILE RUN	002212SMH	X	3408	MT VERNON AV	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002217SMH	X	3501	MT VERNON AV	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002218SMH	X	3507	MT VERNON AV	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002220SMH	X	3515	MT VERNON AV	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002284SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002705SMH	X	2924	MT VERNON AV	Yard-Front	03/06/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002728SMH	X	300	ASPEN ST	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	59	61	0	0	3
FOUR MILE RUN	002740SMH	X	3405	RUSSELL RD	Light Highway Rural Streets	03/24/2012	Truck 1	Complete Inspection	59	59	0	0	2
FOUR MILE RUN	002744SMH	X	3601	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	59	60	0	0	2
FOUR MILE RUN	002789SMH	X	3202	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	59	60	0	0	3
FOUR MILE RUN	002809SMH	X	1151	MARTHA CUSTIS DR	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	59	60	0	0	3
FOUR MILE RUN	000125SMH	X	4903	28TH ST	Light Highway Rural Streets	04/13/2012	Truck 1	Complete Inspection	58	59	0	0	4
FOUR MILE RUN	000145SMH	X	2701	N VAN DORN ST	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	58	59	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000151SMH	X	2409	MENOKIN DR	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	58	59	0	0	2
FOUR MILE RUN	000401SMH	X	5401	SEMINARY RD	Sidewalk	12/22/2011	Truck 1	Complete Inspection	58	59	0	0	3
FOUR MILE RUN	001083IN	X	4898	W BRADDOCK RD	Sidewalk	01/16/2012	Truck 1	Complete Inspection	58	58	0	0	2
FOUR MILE RUN	001084IN	X	4899	W BRADDOCK RD	Sidewalk	01/16/2012	Truck 1	Complete Inspection	58	58	0	0	4
FOUR MILE RUN	001998SMH	X	2400	MT VERNON AV	Light Highway Rural Streets	03/06/2012	Truck 1	Complete Inspection	58	59	0	0	4
FOUR MILE RUN	002041SMH	X	81	KENNEDY ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	58	57	10	0	3
FOUR MILE RUN	002050SMH	X	124	E RAYMOND AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	58	59	0	0	3
FOUR MILE RUN	002325SMH	X	3603	OLD DOMINION BV	Light Highway Rural Streets	04/06/2012	Truck 1	Complete Inspection	58	59	0	0	2
FOUR MILE RUN	004043SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	Truck 1	Complete Inspection	58	57	15	0	3
FOUR MILE RUN	000102SMH	X	4903	28TH ST	Yard-Side	12/28/2011	Truck 1	Complete Inspection	57	58	0	0	2
FOUR MILE RUN	0001060IN	X	4799	W BRADDOCK RD	Sidewalk	12/27/2011	Truck 1	Complete Inspection	57	58	0	0	3
FOUR MILE RUN	000165SMH	X	2208	FORT WARD PL	Light Highway Rural Streets	01/23/2012	Truck 1	Complete Inspection	57	58	0	0	3
FOUR MILE RUN	000400SMH	X	5401	SEMINARY RD	Sidewalk	12/22/2011	Truck 1	Complete Inspection	57	57	0	0	4
FOUR MILE RUN	000555SMH	X	5165	SEMINARY RD	Light Highway Rural Streets	12/19/2011	Truck 1	Complete Inspection	57	58	0	0	2
FOUR MILE RUN	001409SMH	X	4550	W BRADDOCK RD	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	57	59	0	0	3
FOUR MILE RUN	001744SMH	X	3360	C GUNSTON RD	Easement	03/13/2012	Truck 1	Complete Inspection	57	55	5	0	1
FOUR MILE RUN	002022SMH	X	2600	MT VERNON AV	Light Highway Rural Streets	03/06/2012	Truck 1	Complete Inspection	57	58	0	0	4
FOUR MILE RUN	002026SMH	X	2	E OXFORD AV	Light Highway Rural Streets	03/16/2012	Truck 1	Complete Inspection	57	58	0	0	3
FOUR MILE RUN	002027SMH	X	2600	MT VERNON AV	Light Highway Rural Streets	03/16/2012	Truck 1	Complete Inspection	57	58	0	0	4
FOUR MILE RUN	002098SMH	X	3899	COURTLAND CL	Light Highway Rural Streets	04/06/2012	Truck 1	Complete Inspection	57	58	0	0	2
FOUR MILE RUN	002150SMH	X	3550	COMMONWEALTH AV	Sidewalk	03/22/2012	Truck 1	Complete Inspection	57	57	0	0	3
FOUR MILE RUN	002179SMH	X	3301	LANDOVER ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	57	59	0	0	4
FOUR MILE RUN	002885SMH	X	308	MONTICELLO BV	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	57	58	0	0	2
FOUR MILE RUN	002886SMH	X	308	MONTICELLO BV	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	57	58	0	0	2
FOUR MILE RUN	002702SMH	X	15	ANCELL ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	57	59	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Il Score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004036SMH	X	3913	OLD DOMINION BV	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	57	58	0	0	4
FOUR MILE RUN	004042SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	Truck 1	Complete Inspection	57	57	15	0	3
FOUR MILE RUN	007086IN	X	3750	JEFFERSON DAVIS HY	Easement	03/01/2012	Truck 1	Complete Inspection	57	57	0	0	3
FOUR MILE RUN	008433IN	X	511	FOUR MILE RD	Sidewalk	02/20/2012	Truck 1	Complete Inspection	57	45	35	0	2
FOUR MILE RUN	000114SMH	X	4368	KING ST	Light Highway Rural Streets	04/13/2012	Truck 1	Complete Inspection	56	57	0	0	2
FOUR MILE RUN	000178SMH	X	2500	N VAN DORN ST	Pavement Concrete	02/01/2012	Truck 1	Complete Inspection	56	56	0	0	2
FOUR MILE RUN	000325SMH	X	4390	KING ST	Yard-Front	03/27/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	000377SMH	X	4474	KING ST	Light Highway Rural Streets	04/13/2012	Truck 1	Complete Inspection	56	57	0	0	4
FOUR MILE RUN	000381SMH	X	4474	KING ST	Sidewalk	03/27/2012	Truck 1	Complete Inspection	56	57	0	0	2
FOUR MILE RUN	000392SMH	X	4700	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	000552SMH	X	5165	SEMINARY RD	Sidewalk	12/19/2011	Truck 1	Complete Inspection	56	57	0	0	4
FOUR MILE RUN	000948IN	X	5100	FILLMORE AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	56	56	0	0	3
FOUR MILE RUN	001417SMH	X	4550	KENMORE AV	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	001814SMH	X	335	A ASHBY ST	Light Highway Rural Streets	03/05/2012	Truck 1	Complete Inspection	56	57	0	0	2
FOUR MILE RUN	001855SMH	X	3750	JEFFERSON DAVIS HY	Parking Lot	07/20/2012	Truck 1	Complete Inspection	56	57	0	0	4
FOUR MILE RUN	001877SMH	X	335	LAVERNE AV	Light Highway Rural Streets	03/05/2012	Truck 1	Complete Inspection	56	57	0	0	4
FOUR MILE RUN	001956SMH	X	1	GROVES AV	Light Highway Rural Streets	03/16/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	002028SMH	X	2600	MT VERNON AV	Yard-Front	02/27/2012	Truck 1	Complete Inspection	56	57	0	0	2
FOUR MILE RUN	002086SMH	X	3911	BRUCE ST	Sidewalk	02/20/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	002107SMH	X	404	MONTCELLO BV	Light Highway Rural Streets	03/19/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	002149SMH	X	3700	JEFFERSON DAVIS HY	Sidewalk	03/01/2012	Truck 1	Complete Inspection	56	54	15	0	3
FOUR MILE RUN	002167SMH	X	107	W REED AV	Light Highway Rural Streets	03/22/2012	Truck 1	Complete Inspection	56	57	0	0	6
FOUR MILE RUN	002202SMH	X	3110	MT VERNON AV	Light Highway Rural Streets	03/16/2012	Truck 1	Complete Inspection	56	57	0	0	3
FOUR MILE RUN	002225SMH	X	3637	RUSSELL RD	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	56	57	0	0	2
FOUR MILE RUN	002294SMH	X	3900	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	56	57	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002652SMH	X		3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/02/2012	Truck 1	Complete Inspection	56	55	10	0
FOUR MILE RUN	002697SMH	X		1	ANCELL ST	Yard-Front	03/06/2012	Truck 1	Complete Inspection	56	57	0	0
FOUR MILE RUN	002738SMH	X		3303	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	56	56	0	0
FOUR MILE RUN	002805SMH	X		1151	MARTHA CUSTIS DR	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	56	57	0	0
FOUR MILE RUN	004111IN	X		4550	W BRADDOCK RD	Curb/Gutter	02/02/2012	Truck 1	Complete Inspection	56	56	0	3
FOUR MILE RUN	000326SMH	X		3101	N HAMPTON DR	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	55	55	0	0
FOUR MILE RUN	002095SMH	X		3899	COURTLAND CL	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	55	56	0	4
FOUR MILE RUN	002819SMH	X		3800	FLORENCE DR	Parking Lot	02/16/2012	Truck 1	Complete Inspection	55	50	20	0
FOUR MILE RUN	007082IN	X		3700	JEFFERSON DAVIS HY	Easement	03/01/2012	Truck 1	Complete Inspection	55	56	0	3
FOUR MILE RUN	000103SMH	X		4903	28TH ST	Light Highway Rural Streets	12/28/2011	Truck 1	Complete Inspection	54	55	0	4
FOUR MILE RUN	000136SMH	X		3800	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	000185SMH	X		3800	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	000246IN	X		3101	PARK CENTER DR	Sidewalk	03/26/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	000323SMH	X		5100	FILLMORE AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	54	55	0	4
FOUR MILE RUN	000335IN	X		3800	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	54	55	0	4
FOUR MILE RUN	000827IN	X		2280	N BEAUREGARD ST	Sidewalk	12/21/2011	Truck 1	Complete Inspection	54	55	0	4
FOUR MILE RUN	000931IN	X		5100	FILLMORE AV	Easement	12/21/2011	Truck 1	Complete Inspection	54	55	0	2
FOUR MILE RUN	001401SMH	X		4501	W BRADDOCK RD	Easement	02/07/2012	Truck 1	Complete Inspection	54	55	0	4
FOUR MILE RUN	001407SMH	X		4550	W BRADDOCK RD	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	001490SMH	X		1601	STONEBRIDGE RD	Light Highway Rural Streets	04/02/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	001799SMH	X		124	E RAYMOND AV	Sidewalk	02/27/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	002001SMH	X		2406	MT VERNON AV	Light Highway Rural Streets	03/06/2012	Truck 1	Complete Inspection	54	55	0	4
FOUR MILE RUN	002047SMH	X		2701	DE WITT AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	002048SMH	X		124	RANDOLPH AV	Light Highway Rural Streets	03/12/2012	Truck 1	Complete Inspection	54	55	0	3
FOUR MILE RUN	002304SMH	X		3750	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/02/2012	Truck 1	Complete Inspection	54	55	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct IlScore	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002701SMH	X	34	ANCELL ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	54	55	0	0	3
FOUR MILE RUN	002713SMH	X	66	KENNEDY ST	Light Highway Rural Easement	02/22/2012	Truck 1	Complete Inspection	54	55	0	0	2
FOUR MILE RUN	002726SMH	X	271	ASPEN ST	Light Highway Rural Streets	03/21/2012	Truck 1	Complete Inspection	54	55	0	0	3
FOUR MILE RUN	002730SMH	X	3205	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	54	55	0	0	4
FOUR MILE RUN	002793SMH	X	3200	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	54	55	0	0	3
FOUR MILE RUN	004044SMH	X	3200	COMMONWEALTH AV	Parking Lot	03/16/2012	Truck 1	Complete Inspection	54	53	15	0	2
FOUR MILE RUN	006791IN	X	1	ANCELL ST	Sidewalk	02/22/2012	Truck 1	Complete Inspection	54	55	0	0	3
FOUR MILE RUN	006792IN	X	3	ANCELL ST	Sidewalk	02/22/2012	Truck 1	Complete Inspection	54	55	0	0	3
FOUR MILE RUN	007170IN	X	3700	JEFFERSON DAVIS HY	Easement	03/01/2012	Truck 1	Complete Inspection	54	55	0	0	4
FOUR MILE RUN	008604IN	X	201	TENNESSEE AV	Sidewalk	02/22/2012	Truck 1	Complete Inspection	54	55	0	0	3
FOUR MILE RUN	000097CB	X	107	E REED AV	Sidewalk	03/23/2012	Truck 1	Complete Inspection	53	54	0	0	2
FOUR MILE RUN	000150SMH	X	2425	MENOKIN DR	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	53	55	0	0	3
FOUR MILE RUN	000180SMH	X	2600	N VAN DORN ST	Easement	02/01/2012	Truck 1	Complete Inspection	53	54	0	0	4
FOUR MILE RUN	000348SMH	X	4501	FORD AV	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	53	54	0	0	3
FOUR MILE RUN	000390SMH	X	4622	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	53	55	0	0	3
FOUR MILE RUN	001411SMH	X	2509	GADSBY PL	Sidewalk	02/08/2012	Truck 1	Complete Inspection	53	54	0	0	4
FOUR MILE RUN	002094SMH	X	3913	OLD DOMINION BV	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	53	54	0	0	4
FOUR MILE RUN	002207SMH	X	3603	RUSSELL RD	Parking Lot	03/21/2012	Truck 1	Complete Inspection	53	54	0	0	3
FOUR MILE RUN	002706SMH	X	3013	FULTON ST	Alley	02/21/2012	Truck 1	Complete Inspection	53	54	0	0	2
FOUR MILE RUN	002820SMH	X	3800	MILAN DR	Parking Lot	02/16/2012	Truck 1	Complete Inspection	53	50	25	0	3
FOUR MILE RUN	002822SMH	X	3800	MILAN DR	Yard-Back	02/20/2012	Truck 1	Complete Inspection	53	54	0	0	2
FOUR MILE RUN	002838SMH	X	802	TENNESSEE AV	Light Highway Rural Streets	02/16/2012	Truck 1	Complete Inspection	53	53	0	0	2
FOUR MILE RUN	004642IN	X	4404	SEMINARY RD	Sidewalk	04/02/2012	Truck 1	Complete Inspection	53	50	5	0	3
FOUR MILE RUN	006819IN	X	504	MONTICELLO BV	Sidewalk	02/15/2012	Truck 1	Complete Inspection	53	49	15	0	2
FOUR MILE RUN	008416IN	X	511	FOUR MILE RD	Yard-Side	04/02/2012	Truck 1	Complete Inspection	53	29	35	0	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	008607IN	X	3375	LANDOVER ST	Sidewalk	02/22/2012	Truck 1	Complete Inspection	53	54	0	0	2
FOUR MILE RUN	000322SMH	X	5100	FILLMORE AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	52	53	0	0	4
FOUR MILE RUN	000344SMH	X	4651	W BRADDOCK RD	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	52	51	5	0	4
FOUR MILE RUN	000356SMH	X	2410	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	52	51	5	0	4
FOUR MILE RUN	000358SMH	X	2416	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	52	51	5	0	3
FOUR MILE RUN	000359SMH	X	4678	W BRADDOCK RD	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	52	53	0	0	3
FOUR MILE RUN	000393SMH	X	4700	KING ST	Light Highway Rural Streets	03/09/2012	Truck 1	Complete Inspection	52	53	0	0	4
FOUR MILE RUN	001664IN	X	5150	FILLMORE AV	Light Highway Rural Streets	12/20/2011	Truck 1	Complete Inspection	52	52	0	0	2
FOUR MILE RUN	001870SMH	X	329	A CLIFFORD AV	Light Highway Rural Streets	03/05/2012	Truck 1	Complete Inspection	52	53	0	0	4
FOUR MILE RUN	002071SMH	X	3899	COURTLAND CL	Yard-Side	02/21/2012	Truck 1	Complete Inspection	52	51	5	0	3
FOUR MILE RUN	002073SMH	X	3899	COURTLAND CL	Yard-Side	02/21/2012	Truck 1	Complete Inspection	52	53	0	0	3
FOUR MILE RUN	002135SMH	X	3102	OLD DOMINION BY	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	52	53	0	0	2
FOUR MILE RUN	002161SMH	X	1	W GLEBE RD	Light Highway Rural Streets	03/22/2012	Truck 1	Complete Inspection	52	53	0	0	3
FOUR MILE RUN	002797SMH	X	310	BEVERLEY DR	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	52	53	0	0	2
FOUR MILE RUN	000157SMH	X	2225	N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	51	52	0	0	3
FOUR MILE RUN	000342SMH	X	2600	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	51	50	5	0	3
FOUR MILE RUN	000361SMH	X	2599	GADSBY PL	Easement	01/18/2012	Truck 1	Complete Inspection	51	52	0	0	2
FOUR MILE RUN	000892IN	X	3001	N BEAUREGARD ST	Sidewalk	01/16/2012	Truck 1	Complete Inspection	51	51	0	0	4
FOUR MILE RUN	000957IN	X	3101	N. HAMPTON DR.	Sidewalk	03/27/2012	Truck 1	Complete Inspection	51	51	0	0	3
FOUR MILE RUN	001406SMH	X	4505	W BRADDOCK RD	Sidewalk	02/07/2012	Truck 1	Complete Inspection	51	52	0	0	2
FOUR MILE RUN	001482SMH	X	1609	STONEBRIDGE RD	Sidewalk	02/02/2012	Truck 1	Complete Inspection	51	52	0	0	2
FOUR MILE RUN	001494SMH	X	4575	SEMINARY RD	Light Highway Rural Streets	04/02/2012	Truck 1	Complete Inspection	51	52	0	0	2
FOUR MILE RUN	002101SMH	X	600	W GLEBE RD	Light Highway Rural Streets	04/06/2012	Truck 1	Complete Inspection	51	52	0	0	4
FOUR MILE RUN	002132SMH	X	2604	OLD DOMINION BY	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	51	52	0	0	4
FOUR MILE RUN	002177SMH	X	3200	LANDOVER ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	51	52	0	0	5

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Il score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	0022305MH	X	3416	OLD DOMINION BV	Light Highway Rural Streets	03/30/2012	Truck 1	Complete Inspection	51	52	0	0	4
FOUR MILE RUN	0027005MH	X	15	ANCELL ST	Sidewalk	02/22/2012	Truck 1	Complete Inspection	51	52	0	0	3
FOUR MILE RUN	0001076IN	X	4480	KING ST	Sidewalk	03/27/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	0001605MH	X	4019	ELICOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0001915MH	X	3800	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	0001975MH	X	4401	W BRADDOCK RD	Curb/Gutter	07/20/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0003305MH	X	4700	KING ST	Easement	03/09/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	0003395MH	X	2600	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	0003455MH	X	4621	W BRADDOCK RD	Easement	01/18/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0003865MH	X	4480	KING ST	Driveway	03/27/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	000404IN	X	2212	FORT WARD PL	Sidewalk	01/23/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	000483IN	X	3900	KING ST	Easement	07/20/2012	Truck 1	Complete Inspection	50	51	0	0	4
FOUR MILE RUN	0014025MH	X	4505	W BRADDOCK RD	Light Highway Rural Streets	02/07/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0014105MH	X	4505	W BRADDOCK RD	Easement	02/07/2012	Truck 1	Complete Inspection	50	51	0	0	6
FOUR MILE RUN	0014915MH	X	4441	SEMINARY RD	Light Highway Rural Streets	04/02/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	0019595MH	X	2802	MT VERNON AV	Sidewalk	02/27/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	0020425MH	X	2803	HICKORY ST	Easement	02/22/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0020635MH	X	3360	B GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	0020685MH	X	3899	COURTLAND CL	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	0022045MH	X	142	SANBORN PL	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	0022055MH	X	142	SANBORN PL	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0022525MH	X	624	BEVERLEY DR	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	0027075MH	X	3019	FULTON ST	Alley	02/27/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	0027105MH	X	3015	MT VERNON AV	Easement	03/23/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	0027475MH	X	3603	RUSSELL RD	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	50	50	0	0	3

Basin	MH	SCREAM Insp _p	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004030SMH	X	4401	W BRADDOCK RD	Easement	02/08/2012	Truck 1	Complete Inspection	50	51	0	0	3
FOUR MILE RUN	004060SMH	X	4550	W BRADDOCK RD	Sidewalk	04/11/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	004122IN	X	4550	KENMORE AV	Sidewalk	03/28/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	004152IN	X	4550	W BRADDOCK RD	Curb/Gutter	03/28/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	004216IN	X	4660	KENMORE AV	Sidewalk	03/28/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	004603IN	X	4575	SEMINARY RD	Sidewalk	04/02/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	007091IN	X	3700	COMMONWEALTH AV	Driveway	03/01/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	007336IN	X	3125	MT VERNON AV	Sidewalk	03/16/2012	Truck 1	Complete Inspection	50	48	15	0	2
FOUR MILE RUN	008405IN	X	3899	COURTLAND CL	Sidewalk	02/21/2012	Truck 1	Complete Inspection	50	51	0	0	2
FOUR MILE RUN	008444IN	X	470	W GLEBE RD	Sidewalk	02/21/2012	Truck 1	Complete Inspection	50	45	15	0	3
FOUR MILE RUN	008808IN	X	414	TENNESSEE AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	009022IN	X	4700	KING ST	Sidewalk	03/29/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	009023IN	X	4700	KING ST	Easement	03/29/2012	Truck 1	Complete Inspection	50	50	0	0	2
FOUR MILE RUN	009024IN	X	4798	KING ST	Curb/Gutter	03/29/2012	Truck 1	Complete Inspection	50	50	0	0	3
FOUR MILE RUN	000162SMH	X	4031	ELLIOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	Complete Inspection	49	50	0	0	2
FOUR MILE RUN	000184SMH	X	3800	KING ST	Light Highway Rural Streets	03/29/2012	Truck 1	Complete Inspection	49	50	0	0	2
FOUR MILE RUN	000315SMH	X	4399	W BRADDOCK RD	Sidewalk	01/16/2012	Truck 1	Complete Inspection	49	50	0	0	3
FOUR MILE RUN	000363SMH	X	3101	N HAMPTON DR	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	49	50	0	0	4
FOUR MILE RUN	001413SMH	X	2410	GRETTER PL	Sidewalk	02/08/2012	Truck 1	Complete Inspection	49	50	0	0	4
FOUR MILE RUN	001487SMH	X	4402	KIRCHNER CT	Yard/Back	02/02/2012	Truck 1	Complete Inspection	49	50	0	0	2
FOUR MILE RUN	001784SMH	X	3625	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	49	50	0	0	3
FOUR MILE RUN	001846SMH	X	3600	JEFFERSON DAVIS HY	Parking Lot	04/12/2012	Truck 1	Complete Inspection	49	50	0	0	3
FOUR MILE RUN	001850SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/02/2012	Truck 1	Complete Inspection	49	43	25	0	3
FOUR MILE RUN	002081SMH	X	3917	ELBERT AV	Light Highway Rural Streets	04/06/2012	Truck 1	Complete Inspection	49	50	0	0	2
FOUR MILE RUN	002221SMH	X	3603	MT VERNON AV	Easement	02/28/2012	Truck 1	Complete Inspection	49	49	0	0	6

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Inscore	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002651SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	03/02/2012	Truck 1	Complete Inspection	49	50	0	0	5
FOUR MILE RUN	002781SMH	X	3606	CAMERON MILLS RD	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	49	50	0	0	2
FOUR MILE RUN	002817SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Complete Inspection	49	50	0	0	2
FOUR MILE RUN	004033SMH	X	507	MONTICELLO BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	49	50	0	0	3
FOUR MILE RUN	008832IN	X	3516	HALCYON DR	Sidewalk	02/16/2012	Truck 1	Complete Inspection	49	50	0	0	3
FOUR MILE RUN	000099SMH	X	4903	28TH ST	Light Highway Rural Streets	12/28/2011	Truck 1	Complete Inspection	48	49	0	0	3
FOUR MILE RUN	001015IN	X	4799	W BRADDOCK RD	Sidewalk	04/17/2012	Truck 1	Complete Inspection	48	48	0	0	4
FOUR MILE RUN	002180SMH	X	3214	LANDOVER ST	Light Highway Rural Streets	02/22/2012	Truck 1	Complete Inspection	48	49	0	0	3
FOUR MILE RUN	002756SMH	X	3200	COMMONWEALTH AV	Light Highway Rural Streets	03/13/2012	Truck 1	Complete Inspection	48	49	0	0	5
FOUR MILE RUN	002814SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets	04/03/2012	Truck 1	Complete Inspection	48	49	0	0	2
FOUR MILE RUN	007006IN	X	3114	RUSSELL RD	Sidewalk	03/20/2012	Truck 1	Complete Inspection	48	49	0	0	1
FOUR MILE RUN	008445IN	X	470	W GLEBE RD	Yard-Front	02/24/2012	Truck 1	Complete Inspection	48	45	5	0	4
FOUR MILE RUN	000142SMH	X	3846	KING ST	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	47	48	0	0	2
FOUR MILE RUN	000159SMH	X	2232	N EARLY ST	Curb/Gutter	01/30/2012	Truck 1	Complete Inspection	47	48	0	0	3
FOUR MILE RUN	000161SMH	X	4021	ELLIOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	Complete Inspection	47	48	0	0	5
FOUR MILE RUN	000181SMH	X	3900	KING ST	Yard-Front	01/31/2012	Truck 1	Complete Inspection	47	48	0	0	5
FOUR MILE RUN	000338SMH	X	2600	N HAMPTON DR	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	47	48	0	0	3
FOUR MILE RUN	000383SMH	X	4480	KING ST	Sidewalk	03/27/2012	Truck 1	Complete Inspection	47	48	0	0	3
FOUR MILE RUN	001419SMH	X	4550	W BRADDOCK RD	Parking Lot	02/06/2012	Truck 1	Complete Inspection	47	48	0	0	4
FOUR MILE RUN	001420SMH	X	4550	W BRADDOCK RD	Parking Lot	04/11/2012	Truck 1	Complete Inspection	47	48	0	0	3
FOUR MILE RUN	002166SMH	X	25	W GLEBE RD	Light Highway Rural Streets	03/22/2012	Truck 1	Complete Inspection	47	48	0	0	6
FOUR MILE RUN	002731SMH	X	3205	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	Complete Inspection	47	48	0	0	4
FOUR MILE RUN	000431IN	X	2500	N VAN DORN ST	Sidewalk	02/01/2012	Truck 1	Complete Inspection	46	43	5	0	3
FOUR MILE RUN	001492SMH	X	4615	SEMINARY RD	Parking Lot	02/06/2012	Truck 1	Complete Inspection	46	46	0	0	4
FOUR MILE RUN	002115SMH	X	511	MONTICELLO BV	Light Highway Rural Streets	02/15/2012	Truck 1	Complete Inspection	46	46	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002130SMH	X	2908	A RICHMOND LA	Easement	02/15/2012	Truck 1	Complete Inspection	46	46	0	0	2
FOUR MILE RUN	002788SMH	X	3200	OLD DOMINION BY Streets	Light Highway Rural	02/14/2012	Truck 1	Complete Inspection	46	46	0	0	4
FOUR MILE RUN	004061SMH	X	2200	IVOR LA	Parking Lot	04/12/2012	Truck 1	Complete Inspection	46	46	0	0	2
FOUR MILE RUN	004610IN	X	4342	LOYOLA AV	Curb/Gutter	02/02/2012	Truck 1	Complete Inspection	46	46	0	0	3
FOUR MILE RUN	008450IN	X	470	W GLEBE RD	Yard-Front	02/21/2012	Truck 1	Complete Inspection	46	38	25	0	1
FOUR MILE RUN	000316SMH	X	4899	W BRADDOCK RD	Light Highway Rural	01/17/2012	Truck 1	Complete Inspection	45	46	0	0	3
FOUR MILE RUN	000367SMH	X	2901	N HAMPTON DR	Light Highway Rural	04/11/2012	Truck 1	Complete Inspection	45	46	0	0	2
FOUR MILE RUN	003754IN	X	4300	FOXHAVEN LA	Sidewalk	02/06/2012	Truck 1	Complete Inspection	45	38	10	0	3
FOUR MILE RUN	0001061IN	X	4799	W BRADDOCK RD	Sidewalk	07/20/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	0001062IN	X	4799	W BRADDOCK RD	Sidewalk	04/17/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	0001070IN	X	3300	S 28TH ST	Sidewalk	03/27/2012	Truck 1	Complete Inspection	44	45	0	0	4
FOUR MILE RUN	0001073IN	X	4520	KING ST	Sidewalk	03/27/2012	Truck 1	Complete Inspection	44	45	0	0	4
FOUR MILE RUN	0001077IN	X	3300	S 28TH ST	Sidewalk	03/27/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	000348CB	X	506	TENNESSEE AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	0008921IN	X	5101	FILLMORE AV	Easement	12/22/2011	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	0010091IN	X	4680	W BRADDOCK RD	Yard-Back	04/17/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	001483SMH	X	4326	LOYOLA AV	Sidewalk	02/02/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	003884IN	X	4400	W BRADDOCK RD	Curb/Gutter	02/07/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	0041081IN	X	4448	W BRADDOCK RD	Curb/Gutter	02/02/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	007089IN	X	3800	JEFFERSON DAVIS HY	Easement	03/01/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	007093IN	X	3700	COMMONWEALTH AV	Sidewalk	03/01/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	007107IN	X	51	W REED AV	Curb/Gutter	02/28/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	007110IN	X	100	DALE ST	Curb/Gutter	02/28/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	008461IN	X	511	FOUR MILE RD	Sidewalk	02/20/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	008473IN	X	3911	BRUCE ST	Curb/Gutter	02/20/2012	Truck 1	Complete Inspection	44	45	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	008611IN	X	251	BURGESS AV	Curb/Gutter	02/22/2012	Truck 1	Complete Inspection	44	45	0	0	3
FOUR MILE RUN	009037IN	X	4550	KENMORE AV	Sidewalk	04/12/2012	Truck 1	Complete Inspection	44	45	0	0	2
FOUR MILE RUN	000146SMH	X	3846	KING ST	Light Highway Rural Streets	01/30/2012	Truck 1	Complete Inspection	43	44	0	0	4
FOUR MILE RUN	0001725MH	X	2500	N VAN DORN ST	Parking Lot	02/01/2012	Truck 1	Complete Inspection	43	44	0	0	3
FOUR MILE RUN	000453IN	X	2119	MARLBORO DR	Yard-Back	01/24/2012	Truck 1	Complete Inspection	43	44	0	0	3
FOUR MILE RUN	000955IN	X	3101	N HAMPTON DR	Sidewalk	04/11/2012	Truck 1	Complete Inspection	43	38	15	0	2
FOUR MILE RUN	008417IN	X	4001	MT VERNON AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	43	38	15	0	2
FOUR MILE RUN	009036IN	X	4550	W BRADDOCK RD		04/12/2012	Truck 1	Complete Inspection	43	44	0	0	2
FOUR MILE RUN	000151ND	X	4649	LATROBE PL	Easement	01/19/2012	Truck 1	Complete Inspection	42	38	5	0	3
FOUR MILE RUN	000169SMH	X	2500	N VAN DORN ST	Yard-Side	02/01/2012	Truck 1	Complete Inspection	42	38	5	0	2
FOUR MILE RUN	000339CB	X	3125	MT VERNON AV	Sidewalk	03/16/2012	Truck 1	Complete Inspection	42	42	0	0	3
FOUR MILE RUN	000393IN	X	2121	MARLBORO DR	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	000433IN	X	2500	N VAN DORN ST	Curb/Gutter	02/01/2012	Truck 1	Complete Inspection	42	38	5	0	2
FOUR MILE RUN	001020IN	X	4651	LAMBERT DR	Curb/Gutter	01/19/2012	Truck 1	Complete Inspection	42	38	5	0	2
FOUR MILE RUN	001022IN	X	4649	LATROBE PL	Easement	01/19/2012	Truck 1	Complete Inspection	42	38	5	0	3
FOUR MILE RUN	001196SMH	X	1612	N HOWARD ST	Yard-Front	02/03/2012	Truck 1	Complete Inspection	42	43	0	0	2
FOUR MILE RUN	001201SMH	X	1612	N HOWARD ST	Yard-Back	02/03/2012	Truck 1	Complete Inspection	42	42	0	0	2
FOUR MILE RUN	001399SMH	X	2010	BRADDOCK CT	Easement	02/07/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	001400SMH	X	4448	W BRADDOCK RD	Sidewalk	02/07/2012	Truck 1	Complete Inspection	42	43	0	0	4
FOUR MILE RUN	001404SMH	X	4505	W BRADDOCK RD	Easement	02/07/2012	Truck 1	Complete Inspection	42	43	0	0	5
FOUR MILE RUN	001493SMH	X	4615	SEMINARY RD	Yard-Back	02/06/2012	Truck 1	Complete Inspection	42	43	0	0	2
FOUR MILE RUN	001848SMH	X	3951	JEFFERSON DAVIS HY	Parking Lot	04/12/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	001957SMH	X	2700	MT VERNON AV	Sidewalk	02/27/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	002066SMH	X	3910	OLD DOMINION BV	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	002088SMH	X	3700	COMMONWEALTH AV	Easement	02/28/2012	Truck 1	Complete Inspection	42	43	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002092SMH	X	4118	MT VERNON AV	Sidewalk	02/20/2012	Truck 1	Complete Inspection	42	43	0	0	2
FOUR MILE RUN	002206SMH	X	3399	COMMONWEALTH AV	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	002208SMH	X	3601	RUSSELL RD	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	42	42	0	0	3
FOUR MILE RUN	002210SMH	X	3801	RUSSELL RD	Light Highway Rural Streets	04/20/2012	Truck 1	Complete Inspection	42	42	0	0	3
FOUR MILE RUN	002321SMH	X	3602	ORLANDO PL	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	42	43	0	0	2
FOUR MILE RUN	002811SMH	X	3360	B GUNSTON RD	Parking Lot	02/13/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	003882IN	X	2005	BRADDOCK CT	Curb/Gutter	02/07/2012	Truck 1	Complete Inspection	42	43	0	0	2
FOUR MILE RUN	004028SMH	X	1602	IVANHOE CT	Yard-Back	02/03/2012	Truck 1	Complete Inspection	42	43	0	0	2
FOUR MILE RUN	004119IN	X	4401	W BRADDOCK RD	Curb/Gutter	02/07/2012	Truck 1	Complete Inspection	42	26	30	0	3
FOUR MILE RUN	004212IN	X	4550	W BRADDOCK RD	Sidewalk	04/11/2012	Truck 1	Complete Inspection	42	38	5	0	3
FOUR MILE RUN	004222IN	X	4401	W BRADDOCK RD	Easement	02/07/2012	Truck 1	Complete Inspection	42	42	0	0	3
FOUR MILE RUN	007329IN	X	3125	MT VERNON AV	Sidewalk	03/16/2012	Truck 1	Complete Inspection	42	43	0	0	3
FOUR MILE RUN	007337IN	X	3125	MT VERNON AV	Sidewalk	03/16/2012	Truck 1	Complete Inspection	42	38	5	0	3
FOUR MILE RUN	009031IN	X	4480	KING ST	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	42	38	5	0	3
FOUR MILE RUN	002083SMH	X	3809	A MT VERNON AV	Easement	02/20/2012	Truck 1	Complete Inspection	41	41	0	0	3
FOUR MILE RUN	002194SMH	X	3399	COMMONWEALTH AV	Sidewalk	03/22/2012	Truck 1	Complete Inspection	41	41	0	0	3
FOUR MILE RUN	002750SMH	X	1	W GLEBE RD	Parking Lot	03/22/2012	Truck 1	Complete Inspection	41	41	0	0	6
FOUR MILE RUN	003508SMH	X	3035	A MT VERNON AV	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	41	0	43	0	3
FOUR MILE RUN	001856SMH	X	3750	JEFFERSON DAVIS HY	Parking Lot	03/02/2012	Truck 1	Complete Inspection	40	40	0	0	4
FOUR MILE RUN	002062SMH	X	3032	MANNING ST	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	40	40	0	0	2
FOUR MILE RUN	000396SMH	X	4903	28TH ST	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	39	39	0	0	4
FOUR MILE RUN	000163SMH	X	4038	ELLIOTT ST	Easement	01/23/2012	Truck 1	Complete Inspection	38	39	0	0	2
FOUR MILE RUN	002151SMH	X	3600	COMMONWEALTH AV	Sidewalk	03/22/2012	Truck 1	Complete Inspection	38	39	0	0	3
FOUR MILE RUN	000179SMH	X	2500	N VAN DORN ST	Yard-Front	02/01/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000182SMH	X	3900	KING ST	Parking Lot	01/31/2012	Truck 1	Complete Inspection	37	38	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	0001905B	X	701	CHAFFONTE DR	Light Highway Rural Streets Sidewalk	02/14/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	000242IN	X	3101	PARK CENTER DR		03/26/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	000385SMH	X	3102	S 28TH ST	Easement	02/08/2012	Truck 1	Complete Inspection	37	38	0	0	4
FOUR MILE RUN	000391IN	X	4004	ELICOTT ST	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000392IN	X	2115	MARLBORO DR	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000395IN	X	4019	ELICOTT ST	Yard-Back	01/23/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000399IN	X	4028	ELICOTT ST	Sidewalk	01/23/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	000401IN	X	4036	ELICOTT ST	Sidewalk	01/23/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000452IN	X	4005	ELICOTT ST	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000454IN	X	2125	MARLBORO DR	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000472IN	X	3800	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	000477IN	X	3900	KING ST	Main Highway Urban	01/31/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000484IN	X	2108	MARLBORO DR	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	001010IN	X	4680	W BRADDOCK RD	Yard-Back	04/17/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	001011IN	X	4680	W BRADDOCK RD	Yard-Side	04/17/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	001014IN	X	4799	W BRADDOCK RD	Sidewalk	04/17/2012	Truck 1	Complete Inspection	37	38	0	0	5
FOUR MILE RUN	001019IN	X	4651	LAMBERT DR	Curb/Gutter	01/19/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	001021IN	X	4651	LAMBERT DR	Easement	01/19/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	001088IN	X	4799	W BRADDOCK RD	Sidewalk	04/17/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	001094IN	X	5099	DAWES AV	Curb/Gutter	12/22/2011	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	001397SMH	X	2010	BRADDOCK CT	Easement	02/07/2012	Truck 1	Complete Inspection	37	26	15	0	3
FOUR MILE RUN	001837SMH	X	3525	JEFFERSON DAVIS HY	Light Highway Rural Streets Sidewalk	04/05/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	002152SMH	X	3600	COMMONWEALTH AV		02/28/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	002735SMH	X	3313	RUSSELL RD	Light Highway Rural Streets Curb/Gutter	03/21/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	003761IN	X	4301	W BRADDOCK RD		01/24/2012	Truck 1	Complete Inspection	37	38	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	003763IN	X	4011	W BRADDOCK RD	Curb/Gutter	01/24/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	004221IN	X	4550	W BRADDOCK RD	Sidewalk	04/11/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	004613IN	X	1612	STONEBRIDGE RD	Curb/Gutter	02/02/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	004657IN	X	1612	STONEBRIDGE RD	Yard/Back	02/02/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	006308IN	X	317	E RAYMOND AV	Sidewalk	03/05/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	006432IN	X	3581	JEFFERSON DAVIS HY	Sidewalk	04/05/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	006906IN	X	3800	JEFFERSON DAVIS HY	Curb/Gutter	03/02/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	007149IN	X	3603	RUSSELL RD	Parking Lot	04/09/2012	Truck 2	Complete Inspection	37	38	0	0	1
FOUR MILE RUN	007340IN	X	3125	MT VERNON AV	Parking Lot	03/16/2012	Truck 1	Complete Inspection	37	38	0	0	3
FOUR MILE RUN	007421IN	X	3800	MULAN DR	Sidewalk	02/16/2012	Truck 1	Complete Inspection	37	37	0	0	2
FOUR MILE RUN	007457IN	X	720	A W GLEBE RD	Curb/Gutter	02/20/2012	Truck 1	Complete Inspection	37	38	0	0	4
FOUR MILE RUN	008428IN	X	3899	COURTLAND CL	Easement	02/21/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	009003IN	X	1616	STONEBRIDGE RD	Yard/Back	02/02/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	009039IN	X	2200	IVOR LA	Sidewalk	04/12/2012	Truck 1	Complete Inspection	37	38	0	0	2
FOUR MILE RUN	000343SMH	X	4651	W BRADDOCK RD	Light Highway Rural Streets	01/19/2012	Truck 1	Complete Inspection	36	29	5	0	3
FOUR MILE RUN	002035SMH	X	2809	MT VERNON AV	Parking Lot	02/27/2012	Truck 1	Complete Inspection	36	36	0	0	4
FOUR MILE RUN	009015IN	X	19	ANCELL ST	Alley	03/06/2012	Truck 1	Complete Inspection	36	29	5	0	2
FOUR MILE RUN	001647IN	X	5199	HERITAGE LA	Sidewalk	12/19/2011	Truck 1	Complete Inspection	35	35	0	0	2
FOUR MILE RUN	003749IN	X	1601	N HOWARD ST	Sidewalk	02/03/2012	Truck 1	Complete Inspection	35	35	0	0	3
FOUR MILE RUN	004620IN	X	4324	LOYOLA AV	Curb/Gutter	02/02/2012	Truck 1	Complete Inspection	35	35	0	0	4
FOUR MILE RUN	009035IN	X	4550	W BRADDOCK RD	Easement	04/12/2012	Truck 1	Complete Inspection	35	35	0	0	2
FOUR MILE RUN	002163SMH	X	1	W GLEBE RD	Light Highway Rural Streets	03/22/2012	Truck 1	Complete Inspection	30	30	0	0	4
FOUR MILE RUN	002837SMH	X	3516	HALCYON DR	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	29	29	0	0	3
FOUR MILE RUN	0001405MH	X	3846	KING ST	Easement	01/31/2012	Truck 1	Complete Inspection	28	29	0	0	3
FOUR MILE RUN	0001461IN	X	3302	WYNNDHAM CL	Easement	04/13/2012	Truck 1	Complete Inspection	28	29	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000387SMH	X	4799	W BRADDOCK RD	Sidewalk	04/17/2012	Truck 1	Complete Inspection	28	29	0	0	2
FOUR MILE RUN	001195SMH	X	1608	N HOWARD ST	Yard-Front	02/03/2012	Truck 1	Complete Inspection	28	29	0	0	4
FOUR MILE RUN	001408SMH	X	4550	W BRADDOCK RD	Light Highway Rural Streets	03/28/2012	Truck 1	Complete Inspection	28	29	0	0	4
FOUR MILE RUN	002872SMH	X	3360	C GUNSTON RD	Easement	03/13/2012	Truck 1	Complete Inspection	28	29	0	0	2
FOUR MILE RUN	006805IN	X	3800	JEFFERSON DAVIS HY	Curb/Gutter	03/02/2012	Truck 1	Complete Inspection	28	29	0	0	1
FOUR MILE RUN	000911CD	X	1734	STONEBRIDGE RD	Easement	02/02/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	000432IN	X	2500	N VAN DORN ST	Sidewalk	02/01/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	000456IN	X	4401	W BRADDOCK RD	Easement	02/08/2012	Truck 1	Complete Inspection	26	26	0	0	3
FOUR MILE RUN	001498SMH	X	4316	LOYOLA AV	Yard-Back	02/03/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	002044SMH	X	2600	MT VERNON AV	Yard-Front	03/06/2012	Truck 1	Complete Inspection	26	26	0	0	3
FOUR MILE RUN	002153SMH	X	3550	COMMONWEALTH AV	Driveway	02/28/2012	Truck 1	Complete Inspection	26	26	0	0	4
FOUR MILE RUN	002311SMH	X	601	TENNESSEE AV	Light Highway Rural Streets	02/16/2012	Truck 1	Complete Inspection	26	26	0	0	3
FOUR MILE RUN	002312SMH	X	3516	HALCYON DR	Light Highway Rural Streets	02/16/2012	Truck 1	Complete Inspection	26	26	0	0	3
FOUR MILE RUN	003748IN	X	1605	N HOWARD ST	Sidewalk	02/03/2012	Truck 1	Complete Inspection	26	26	0	0	5
FOUR MILE RUN	003756IN	X	4300	FOXHAVEN LA	Yard-Back	02/06/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	004118IN	X	4401	W BRADDOCK RD	Curb/Gutter	02/07/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	004219IN	X	4550	W BRADDOCK RD	Parking Lot	02/06/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	004615IN	X	4326	LOYOLA AV	Curb/Gutter	02/02/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	004646IN	X	2200	IVOR LA	Parking Lot	02/06/2012	Truck 1	Complete Inspection	26	26	0	0	3
FOUR MILE RUN	006426IN	X	3581	JEFFERSON DAVIS HY	Sidewalk	04/05/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	006438IN	X	3825	JEFFERSON DAVIS HY	Sidewalk	04/05/2012	Truck 1	Complete Inspection	26	26	0	0	3
FOUR MILE RUN	006907IN	X	3750	JEFFERSON DAVIS HY	Easement	03/02/2012	Truck 1	Complete Inspection	26	26	0	0	1
FOUR MILE RUN	007012IN	X	312	BEVERLEY DR	Curb/Gutter	02/15/2012	Truck 1	Complete Inspection	26	26	0	0	2
FOUR MILE RUN	003650	X	3700	JEFFERSON DAVIS HY	Easement	03/02/2012	Truck 1	Complete Inspection	25	25	0	0	1
FOUR MILE RUN	002787SMH	X	3200	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	25	25	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	003708IN	X	4195	SEMINARY RD	Curb/Gutter	02/03/2012	Truck 1	Complete Inspection	23	15	5	0	2
FOUR MILE RUN	003750IN	X	1601	N HOWARD ST	Sidewalk	02/03/2012	Truck 1	Complete Inspection	23	15	5	0	2
FOUR MILE RUN	000398SMH	X	4903	28TH ST	Easement	01/05/2012	Truck 1	Complete Inspection	22	22	0	0	2
FOUR MILE RUN	002051SMH	X	110	HUME AV	Alley	02/27/2012	Truck 1	Complete Inspection	22	22	0	0	2
FOUR MILE RUN	000025O	X	2212	FORT WARD PL	Easement	01/23/2012	Truck 1	Complete Inspection	15	15	0	0	1
FOUR MILE RUN	000305CB	X	3811	MT VERNON AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	15	15	0	0	3
FOUR MILE RUN	001421SMH	X	2410	GRETTER PL.	Light Highway Rural Streets	02/08/2012	Truck 1	Complete Inspection	15	0	15	0	1
FOUR MILE RUN	001496SMH	X	4555	SEMINARY RD	Easement	02/06/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	001497SMH	X	4555	SEMINARY RD	Easement	02/06/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	001838SMH	X	3525	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	001844SMH	X	3600	JEFFERSON DAVIS HY		04/12/2012	Truck 1	Complete Inspection	15	15	0	0	1
FOUR MILE RUN	002231SMH	X	3321	OLD DOMINION BV	Light Highway Rural Streets	03/30/2012	Truck 1	Complete Inspection	15	15	0	0	4
FOUR MILE RUN	002844SMH	X	3603	OLD DOMINION BV	Light Highway Rural Streets	03/30/2012	Truck 1	Complete Inspection	15	15	0	0	4
FOUR MILE RUN	002845SMH	X	701	TENNESSEE AV	Light Highway Rural Streets	02/09/2012	Truck 1	Complete Inspection	15	15	0	0	3
FOUR MILE RUN	003704IN	X	4205	SEMINARY RD	Sidewalk	02/03/2012	Truck 1	Complete Inspection	15	15	0	0	3
FOUR MILE RUN	003705IN	X	1600	KING JAMES PL	Curb/Gutter	02/03/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	003709IN	X	1600	CHAPEL HILL DR	Sidewalk	02/03/2012	Truck 1	Complete Inspection	15	15	0	0	3
FOUR MILE RUN	003710IN	X	1600	CHAPEL HILL DR	Sidewalk	02/03/2012	Truck 1	Complete Inspection	15	15	0	0	3
FOUR MILE RUN	003711IN	X	1600	CHAPEL HILL DR	Sidewalk	02/03/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	004052SMH	X	4600	KIRKLAND PL.	Curb/Gutter	02/08/2012	Truck 1	Complete Inspection	15	15	0	0	4
FOUR MILE RUN	004227IN	X	4550	W BRADDOCK RD	Easement	02/06/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	004650IN	X	4615	SEMINARY RD	Yard-Back	02/06/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	004851IN	X	4555	SEMINARY RD	Easement	02/06/2012	Truck 1	Complete Inspection	15	15	0	0	4
FOUR MILE RUN	006427IN	X	3425	JEFFERSON DAVIS HY	Sidewalk	04/05/2012	Truck 1	Complete Inspection	15	15	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	006895IN	X	3925	JEFFERSON DAVIS HY	Curb/Gutter	03/26/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	007402IN	X	3360	B GUNSTON RD	Sidewalk	02/13/2012	Truck 1	Complete Inspection	15	15	0	0	2
FOUR MILE RUN	007443IN	X	3800	FLORENCE DR	Yard-Back	02/16/2012	Truck 1	Complete Inspection	15	15	0	0	1
FOUR MILE RUN	008727IN	X	3606	MT VERNON AV	Parking Lot	02/28/2012	Truck 1	Complete Inspection	15	15	0	0	3
FOUR MILE RUN	000346SMH	X	4621	W BRADDOCK RD	Easement	01/18/2012	Truck 1	Complete Inspection	14	14	0	0	2
FOUR MILE RUN	002711SMH	X	3025	MT VERNON AV	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	14	14	0	0	3
FOUR MILE RUN	000164SMH	X	4301	B W BRADDOCK RD	Easement	01/23/2012	Truck 1	Complete Inspection	10	10	0	0	2
FOUR MILE RUN	000360SMH	X	2901	N HAMPTON DR	Easement	01/18/2012	Truck 1	Complete Inspection	10	10	0	0	2
FOUR MILE RUN	000438IN	X	2500	N VAN DORN ST	Sidewalk	02/01/2012	Truck 1	Complete Inspection	10	10	0	0	2
FOUR MILE RUN	000458IN	X	2600	N VAN DORN ST	Sidewalk	02/01/2012	Truck 1	Complete Inspection	10	10	0	0	2
FOUR MILE RUN	000928IN	X	5100	FILLMORE AV	Sidewalk	12/21/2011	Truck 1	Complete Inspection	10	10	0	0	2
FOUR MILE RUN	002267SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	02/13/2012	Truck 1	Not Inspected - Sealed Lid	10	10	0	0	0
FOUR MILE RUN	002751SMH	X	1	W GLEBE RD	Light Highway Rural Streets	03/22/2012	Truck 1	Complete Inspection	10	10	0	0	4
FOUR MILE RUN	004050SMH	X	232	W GLEBE RD	Parking Lot	04/09/2012	Truck 1	Complete Inspection	10	10	0	0	3
FOUR MILE RUN	000002CD	X	4301B	W BRADDOCK RD	Easement	02/01/2012	Truck 1	Complete Inspection	5	5	0	0	1
FOUR MILE RUN	001486SMH	X	4402	KIRCHNER CT	Yard-Back	02/02/2012	Truck 1	Complete Inspection	5	5	0	0	2
FOUR MILE RUN	002236SMH	X	3214	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	5	5	0	0	3
FOUR MILE RUN	002790SMH	X	3207	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	5	5	0	0	2
FOUR MILE RUN	000015CP	X	4400	W BRADDOCK RD	Easement	02/08/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000016CP	X	4400	W BRADDOCK RD	Easement	02/09/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000020IO	X	3302	WYNDHAM CL	Easement	04/13/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000021IO	X	3302	WYNDHAM CL	Easement	04/13/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000023IO	X	4036	ELLIOTT ST	Easement	04/13/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000054ND	X	4418	KING ST		04/13/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	000056ND	X	3103	PARK CENTER DR		03/26/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000086IO	X	4686	W BRADDOCK RD	Easement	01/17/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000081IO	X	3100	N BEAUREGARD ST	Easement	01/16/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000082IO	X	3100	N BEAUREGARD ST	Easement	01/16/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000083IO	X	5101	FILLMORE AV	Easement/Right of Way	12/22/2011	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000084IO	X	5100	FILLMORE AV	Easement	12/21/2011	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000085IO	X	2621	GADSBY PL	Easement	01/18/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000086IO	X	2901	N HAMPTON RD	Easement	01/18/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000087IO	X	5100	FILLMORE AV	Easement	12/21/2011	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000089IO	X	3451	N BEAUREGARD ST	Easement	03/09/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000103SMH	X	4903	28TH ST	Yard/Front	12/28/2011	Truck 1	Complete Inspection	0	0	0	0	4
FOUR MILE RUN	0001052IN	X	4799	W BRADDOCK RD	Easement	12/27/2011	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	000115IO	X	2618	FOSTER AV	Easement	12/19/2011	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000131ND	X	4390	KING ST		03/27/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	000177SMH	X	2500	N VAN DORN ST	Parking Lot	02/01/2012	Truck 1	Not Inspected - Sealed Lid	0	0	0	0	0
FOUR MILE RUN	000253IO	X	1605	N HOWARD ST	Yard-Side	02/03/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000290IO	X	4448	W BRADDOCK RD	Easement	02/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000293IO	X	2410	GRETTER PL	Easement	02/08/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000294IO	X	2701	PARK CENTER DR	Easement	02/08/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000295IO	X	2509	GADSBY PL	Easement	02/08/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000297CB	X	525	FOUR MILE RD		04/06/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	000303CB	X	3915	MT VERNON AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000317SMH	X	4898	W BRADDOCK RD	Light Highway/Rural Streets	01/17/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	000319IO	X	4320	LOYOLA AV	Yard-Back	02/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000321IO	X	4402	KIRCHNER CT	Easement	02/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000325IO	X	4320	LOYOLA AV	Yard-Back	02/02/2012	Truck 1	Complete Inspection	0	0	0	0	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct Ill score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000347SMH	X	2901	N HAMPTON DR	Light Highway Rural Streets	04/11/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	000373SMH	X	4622	KING ST	Easement	03/12/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	000395SMH	X	4903	28TH ST	Easement	03/27/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	000415IO	X	3917	BRUCE ST	Easement	02/20/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000416IO	X	3703	MT VERNON AV	Easement	02/28/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000417IO	X	511	FOUR MILE RD	Easement	04/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000419IO	X		FOUR MILE RD	Easement	04/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000422IO	X	3918	BRUCE ST	Easement	02/20/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000424IO	X	2807	OLD DOMINION BV	Easement	02/15/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000426IO	X	3700	COMMONWEALTH AV	Easement	03/01/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000431IO	X	3625	EDISON ST	Easement	02/28/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000432IO	X	3625	EDISON ST	Easement	02/28/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000436IN	X	4301	B W BRADDOCK RD	Sidewalk	02/01/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	000442IO	X	320	BEVERLEY DR	Easement	02/15/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000450IO	X	3900	JEFFERSON DAVIS HY	Easement	03/26/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000451IO	X	3951	JEFFERSON DAVIS HY	Easement	03/26/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000452IO	X	3900	JEFFERSON DAVIS HY	Easement	03/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000454IO	X	3360	C GUNSTON RD	Easement	02/13/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000456IO	X	3800	MILAN DR	Easement	02/16/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000458IO	X	813	W GLEBE RD	Easement	02/16/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000463IO	X	907	W GLEBE RD	Easement	02/09/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000476ND	X	4313	LOUIS PL		07/20/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	000600IO	X		JEFFERSON DAVIS HY	Easement	03/02/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000601IO	X	4899	W BRADDOCK RD	Easement	01/17/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000603IO	X	2509	GADSBY PL	Easement	02/08/2012	Truck 1	Complete Inspection	0	0	0	0	1

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	00060410	X	2200	IVOR LA	Easement	04/12/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	000896IN	X	3001	N BEAUREGARD ST	Easement	01/16/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	000892IN	X	3001	N BEAUREGARD ST	Sidewalk	01/17/2012	Truck 1	Complete Inspection	0	0	0	0	4
FOUR MILE RUN	000904IN	X	3001	N BEAUREGARD ST	Sidewalk	01/17/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	000905IN	X	3100	N BEAUREGARD ST	Sidewalk	01/17/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	000963IN	X	2800	N HAMPTON DR	Curb/Gutter	12/27/2011	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	000980IN	X	2600	N HAMPTON DR	Sidewalk	01/18/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	001002IN	X	2621	GADSBY PL	Curb/Gutter	01/18/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	001026IN	X	4898	W BRADDOCK RD	Sidewalk	12/21/2011	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	001101IN	X	5401	SEMINARY RD	Sidewalk	12/22/2011	Truck 1	Complete Inspection	0	0	0	0	4
FOUR MILE RUN	001187ND	X	303	MONTICELLO BV		03/19/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001257ND	X	3915	MT VERNON AV		03/30/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001355ND	X	99	HERBERT ST	Light Highway Rural Streets	07/20/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001360ND	X	221	W GLEBE RD		04/20/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001371ND	X	3512	OLD DOMINION BV		03/30/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001398SMH	X	2010	BRADDOCK CT	Easement	02/07/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	001405ND	X	3360	C GUNSTON RD		03/13/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001406ND	X	3360	C GUNSTON RD		03/13/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001418ND	X	3360	C GUNSTON RD		03/13/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	001648IN	X	5117	HERITAGE LA	Sidewalk	12/19/2011	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	001854SMH	X	3700	JEFFERSON DAVIS HY		04/10/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	002074SMH	X	517	FOUR MILE RD		04/06/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	002075SMH	X	511	FOUR MILE RD		04/06/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	002078SMH	X	3903	MT VERNON AV	Light Highway Rural Streets	03/30/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	002097SMH	X	3899	COURTLAND CL		04/06/2012	Truck 1	Not Inspected - Not Opened	0	0	0	0	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	0021005SMH	X	3899	COURTLAND CL		04/06/2012	Truck 1	Not Inspected - Not Opened	0	0	0	0	0
FOUR MILE RUN	002131SMH	X	2908	A RICHMOND LA	Easement	02/15/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	002155SMH	X	100	DALE ST	Easement	02/28/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	002156SMH	X	3600	COMMONWEALTH AV	Yard-Front	02/28/2012	Truck 1	Not Inspected - No Access	0	0	0	0	0
FOUR MILE RUN	002187SMH	X	3100	COMMONWEALTH AV	Light Highway Rural Streets	04/10/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	002200SMH	X	2	E GLEBE RD	Sidewalk	03/22/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	002233SMH	X	3217	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	Truck 1	Complete Inspection	0	0	0	0	4
FOUR MILE RUN	002234SMH	X	3215	OLD DOMINION BV	Easement	02/14/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	002310SMH	X	601	TENNESSEE AV	Yard-Front	02/16/2012	Truck 1	Complete Inspection	0	0	0	0	5
FOUR MILE RUN	002315SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	002316SMH	X	950	W GLEBE RD	Light Highway Rural Streets	04/09/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	002660SMH	X	3700	JEFFERSON DAVIS HY	Yard-Side	03/02/2012	Truck 1	Complete Inspection	0	0	0	0	4
FOUR MILE RUN	002696SMH	X	2918	COMMONWEALTH AV	Yard-Front	07/20/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	002813SMH	X	3360	B GUNSTON RD		02/13/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	002832SMH	X	842	W GLEBE RD		07/20/2012	Truck 1	Not Inspected - D.N.E	0	0	0	0	0
FOUR MILE RUN	002835SMH	X	907	W GLEBE RD	Easement	02/09/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	003706IN	X	1601	KING JAMES PL		02/03/2012	Truck 1	Not Inspected - Sealed	0	0	0	0	0
FOUR MILE RUN	003740IN	X	1608	N HOWARD ST	Sidewalk	02/03/2012	Truck 1	Complete Inspection	0	0	0	0	0
FOUR MILE RUN	003885IN	X	2010	BRADDOCK CT	Curb/Gutter	02/07/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	004022SMH	X		N BEAUREGARD ST	Easement	01/16/2012	Truck 1	Complete Inspection	0	0	0	1.35	3
FOUR MILE RUN	004034SMH	X		TENNESSEE	Yard-Back	02/16/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	004035SMH	X	3906	OLD DOMINION BV	Light Highway Rural Streets	02/21/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	004038SMH	X	142	SANBORN PL		02/22/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	004039SMH	X	34	ANCELL ST	Yard-Back	02/22/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	004046SMH	X	4390	KING ST		03/27/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Crew	Status / Why Not Inspected	Total MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004049SMH	X	4798	KING ST		03/29/2012	Truck 1	Not Inspected - Not found	0	0	0	0	3
FOUR MILE RUN	004051SMH	X	4501	FORD AV		04/11/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	004634IN	X	1600	IVANHOE CT	Sidewalk	02/03/2012	Truck 1	Complete Inspection	0	0	0	0	1
FOUR MILE RUN	004645IN	X	1600	IVANHOE CT	Yard/Back	02/03/2012	Truck 1	Complete Inspection	0	0	0	0	0
FOUR MILE RUN	006747IN	X	2809	MT VERNON AV	Parking Lot	02/27/2012	Truck 1	Not Inspected - Not Opened	0	0	0	0	0
FOUR MILE RUN	006789IN	X	1	ANCELL ST	Alley	03/06/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	006894IN	X	3951	JEFFERSON DAVIS HY	Easement	03/26/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	007115IN	X	101	DALE ST	Curb/Gutter	02/28/2012	Truck 1	Not Inspected - No Access	0	0	0	0	3
FOUR MILE RUN	007123IN	X	3625	EDISON ST	Curb/Gutter	02/28/2012	Truck 1	Not Inspected - No Access	0	0	0	0	2
FOUR MILE RUN	008419IN	X	4109	MT VERNON AV	Sidewalk	03/30/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	008508IN	X	3625	EDISON ST	Curb/Gutter	02/28/2012	Truck 1	Not Inspected - No Access	0	0	0	0	2
FOUR MILE RUN	008509IN	X	3620	EDISON ST	Curb/Gutter	02/28/2012	Truck 1	Not Inspected - No Access	0	0	0	0	2
FOUR MILE RUN	008510IN	X	3620	EDISON ST	Curb/Gutter	02/28/2012	Truck 1	Not Inspected - No Access	0	0	0	0	2
FOUR MILE RUN	008723IN	X	3603	MT VERNON AV	Easement	02/28/2012	Truck 1	Not Inspected - Debris	0	0	0	0	0
FOUR MILE RUN	008772IN	X	3360	B GUNSTON RD	Sidewalk	04/03/2012	Truck 1	Not Inspected - Sealed Lid	0	0	0	0	0
FOUR MILE RUN	008812IN	X	3360	C GUNSTON RD	Easement	04/17/2012	Truck 1	Complete Inspection	0	0	0	0	3
FOUR MILE RUN	009004IN	X	1602	CHAPEL HILL DR		02/03/2012	Truck 1	Not Inspected - Not found	0	0	0	0	0
FOUR MILE RUN	009016IN	X	27	ANCELL ST	Alley	03/06/2012	Truck 1	Complete Inspection	0	0	0	0	2
FOUR MILE RUN	009017IN	X	35	ANCELL ST	Alley	03/06/2012	Truck 1	Complete Inspection	0	0	0	0	2

Appendix B – Structure Inspection Report
(Includes Defect Detail)

SCREAM™ Manhole and Lamping Inspection Status List

Sorted by Facility ID

Alexandria - Four Mile Run

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000002CD	X	4301B	W BRADDOCK RD	Easement	02/01/2012	02/01/2012	Truck 1	1		5	5	0	0	2
FOUR MILE RUN	0000011CD	X	1734	Frame Base Seal STONEBRIDGE RD Chamber	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/02/2012	02/02/2012	Truck 1	1		26	26	0	0
FOUR MILE RUN	0000015CP	X	4400	W BRADDOCK RD	Easement	I/II evidence									
FOUR MILE RUN	0000016CP	X	4400	W BRADDOCK RD	Easement	Cracked									
FOUR MILE RUN	0000020IO	X	3302	WYNDHAM CL	Easement										
FOUR MILE RUN	0000021IO	X	3302	WYNDHAM CL	Easement										
FOUR MILE RUN	0000023IO	X	4036	ELLIOTT ST	Easement										
FOUR MILE RUN	0000025IO	X	2212	FORT WARD PL	Easement										
FOUR MILE RUN	0000054ND	X	4418	KING ST	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width									
FOUR MILE RUN	0000056ND	X	3103	PARK CENTER DR											
FOUR MILE RUN	0000080IO	X	4898	W BRADDOCK RD	Easement										
FOUR MILE RUN	0000081IO	X	3100	N BEAUREGARD ST	Easement										
FOUR MILE RUN	0000082IO	X	3100	N BEAUREGARD ST	Easement										
FOUR MILE RUN	0000083IO	X	5101	FILLMORE AV	Easement/Right of Way										
FOUR MILE RUN	0000084IO	X	5100	FILLMORE AV	Easement										
FOUR MILE RUN	0000085IO	X	2621	GADSBY PL	Easement										
FOUR MILE RUN	0000086IO	X	2901	N HAMPTON RD	Easement										
FOUR MILE RUN	0000087IO	X	5100	FILLMORE AV	Easement										
FOUR MILE RUN	0000088IO	X	3451	N BEAUREGARD ST	Easement										
FOUR MILE RUN	0000097CB	X	107	E REED AV	Sidewalk										
FOUR MILE RUN	000099SMH	X	4903	Frame Connection-3 28TH ST	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth	I/II evidence								
FOUR MILE RUN	000099SMH	X	4903	Frame Base Seal	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Corroded, pitted, spalled								
				Chimney Shaft	I/II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
				Chamber	I/II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									

Basin	MH	SCREAM InsP	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
			Frame Base Seal		Cracked / deteriorated spalling	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural							
	Grade Ring		Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural								
	Grade Ring		Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural								
	Grade Ring		Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural								
	Grade Ring		Frame Base Seal	Offset	Min: 7/8" to 2" (2.5-5cm)				Structural							
	Chimney/Shft		Bricks displaced or missing		Min: <5% of area				Structural							
	Chimney/Shft		Bricks displaced or missing	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural								
	Chimney/Shft		Bricks displaced or missing	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural								
	Chimney/Shft		Bricks displaced or missing	Mortar missing	Min: <10% of area				Structural							
	Chamber		Bricks displaced or missing	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.			Structural								
	Chamber		Bricks displaced or missing	Corroded, pitted, spalled	Min: <10% of area				Structural							
	Chamber		Bricks displaced or missing	Mortar missing	Min: <10% of area				Structural							
	Channel		Bricks displaced or missing	Cracked	Min: <10% of area				Structural							
	Channel		Bricks displaced or missing	Corroded, pitted, spalled	Min: <10% of area				Structural							
	Channel		Bricks displaced or missing	Mortar missing	Min: <10% of area				Structural							
	Channel		Bricks displaced or missing	Cracked	Min: <10% of area				Structural							
	Channel		Bricks displaced or missing	Spalled	Min: <10% of area				Structural							
	Channel		Bricks displaced or missing	Easement	Min: <10% of area				Structural							
	FOUR MILE RUN	0001052IN	X	4799	W BRADDOCK RD	<u>12/27/2011</u>	Truck 1	1		0	0	0	0	0	2	
	FOUR MILE RUN	0001059IN	X	4799	W BRADDOCK RD	<u>12/27/2011</u>	Truck 1	1		62	63	0	0	0	3	
			Chamber		Chamber											
			Chamber		Chamber											
			Channel		Channel											
			Channel		Channel											
			Frame		Frame											
			Frame Base Seal		Cracked / deteriorated spalling	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Frame Base Seal		Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Grade Ring		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Grade Ring		Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Chimney/Shft		I/I evidence	Min: <10% mat'l loss, etching										
			Chamber		I/I evidence	Min: <10% mat'l loss, etching										
			W BRADDOCK RD		Sidewalk	<u>12/27/2011</u>	Truck 1	1		59	60	0	0	0	2	
			FOUR MILE RUN	000105SMH	X	4903										
			Frame		Offset	Mod: 2" to 3" (5-7.5cm)			Structural							
			Frame Base Seal		Cracked / deteriorated spalling	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Frame Base Seal		Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Grade Ring		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) width, chipping.		Structural								
			Grade Ring		I/I evidence	Min: <10% mat'l loss, etching										
			Chimney/Shft		I/I evidence	Min: <10% mat'l loss, etching										
			Chamber		Sidewalk	<u>12/27/2011</u>	Truck 1	1		57	58	0	0	0	3	
			W BRADDOCK RD		Chamber											
			FOUR MILE RUN	0001060IN	X	4799										
			FOUR MILE RUN	0001061IN	X	4799										
			FOUR MILE RUN	0001061IN	X	4799										

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	0001062IN	X	4798	W BRADDOCK RD	sidewalk	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/	44	45	0	0	3
FOUR MILE RUN	0001070IN	X	3300	Chamber Chamber Chamber S 28TH ST	Cracked, pitted, spalled Cracked	Mod. 1/16" to 1/8" (2-3mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	Structural			44	45	0	0	4
FOUR MILE RUN	0001073IN	X	4520	Chamber Chamber Chamber KING ST	Corroded, pitted, spalled I/ evidence	Mod. 1/16" to 1/8" (2-3mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural			44	45	0	0	4
FOUR MILE RUN	0001076IN	X	4480	Chamber Chamber Chamber KING ST	Corroded, pitted, spalled Cracked	Mod. 1/16" to 1/8" (2-3mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural			44	45	0	0	4
FOUR MILE RUN	0001077IN	X	3300	Chamber Chamber Chamber S 28TH ST	I/ evidence	Mod. 1/16" to 1/8" (2-3mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural			44	45	0	0	2
FOUR MILE RUN	000109SMH	X	2988	S COLUMBUS ST Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber S COLUMBUS ST	Light Highway Rural Streets Cracked / deteriorated I/ evidence	Mod. 1/16" to 1/8" (2-3mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural			44	45	0	0	2
FOUR MILE RUN	000109SMH	X	2988	Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber S COLUMBUS ST	Corroded, pitted, spalled Cracked	Mod. 1/16" to 1/8" (2-3mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural			44	45	0	0	4
FOUR MILE RUN	000109SMH	X	2988	Chamber Chamber Bench Bench	Corroded, pitted, spalled Cracked	Mod. 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural			65	66	0	0	4

Basin	MH	SCREAM Trap	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000111SMH	X	4903	Pipe Connection-4 28TH ST	Channel Chimney/Shaf	Corroded, pitted, spalled Cracked	Extreme >50% mat'l loss, >3/4" (2cm) etching Extreme: >1/4" (6mm) width, pieces, Mod: 1/8" to 3/16" (3-5mm) width	Truck 1	Structural						
FOUR MILE RUN	000112SMH	X	4903	28TH ST	Chimney/Shaf	Pipe cracked	Light Highway Rural Streets	04/13/2012	Structural						
FOUR MILE RUN	000112SMH	X	4903	28TH ST	Bricks displaced or missing Mortar missing	Bricks displaced or missing Maj: 25-50% of area	Maj: 25-50% of area	04/13/2012	Structural						
FOUR MILE RUN	000114SMH	X	4368	KING ST	Corroded, pitted, spalled Cracked	Maj: 25-50% etching Mod: 1/8" to 1/4" (3-5mm) width	Maj: 25-50% etching Mod: 1/8" to 1/4" (3-5mm) width	Truck 1	Structural						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Maj: 1/8" to 1/4" (3-6mm) width, pieces, Min: <1/4gpm, staining, mineral deposits, flow weeping	Maj: 1/8" to 1/4" (3-6mm) width, pieces, Min: <1/4gpm, staining, mineral deposits, Mod: 1/16" to 1/8" (2-3mm) width, small pieces	I/I	Structural						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Corroded, pitted, spalled Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, Min: <1/4gpm, staining, mineral deposits, flow weeping	Maj: 1/8" to 1/4" (3-6mm) width, pieces, Min: <1/4gpm, staining, mineral deposits, Mod: 1/16" to 1/8" (2-3mm) width, chipping,	Structural							
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Debris/deposition	Min: <10% mat'l loss, etching	Spalling Mod: 1-3gal bucket	Maintenance	Maintenance						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Light Highway Rural Streets	04/13/2012	04/13/2012	Truck 1	Structural						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Cracked / deteriorated spalling I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) etching	Spalling Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	Structural						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
FOUR MILE RUN	000114SMH	X	4368	Chimney/Shaf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Structural						
FOUR MILE RUN	000114SMH	X	4368	Chamber	Corroded, pitted, spalled Cracked	Min: <10% mat'l loss, etching	Spalling Min: <10% mat'l loss, etching	Structural	Structural						
FOUR MILE RUN	000114SMH	X	4368	Channel	Corroded, pitted, spalled Cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, etching	Spalling Min: <10% mat'l loss, etching	Structural	Structural						
FOUR MILE RUN	000114SMH	X	4368	KING ST	Light Highway Rural Streets	04/13/2012	04/13/2012	Truck 1	Structural						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Cracked / deteriorated spalling I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, <3/8" (1cm) etching	Spalling Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	Structural						
FOUR MILE RUN	000114SMH	X	4368	Frame Base Seal	Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
FOUR MILE RUN	000114SMH	X	4368	Chimney/Shaf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
FOUR MILE RUN	000114SMH	X	4368	Chamber	Cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, etching	Spalling Min: <10% mat'l loss, etching	Structural	Structural						
FOUR MILE RUN	000114SMH	X	4368	Chamber	Corroded, pitted, spalled										

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000115SMH	X	2618 FOSTER AV	FOSTER AV	Easement	04/13/2012	04/13/2012	Truck 1	I	0	0	0	0	2
FOUR MILE RUN	000115SMH	X	4368 KING ST	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural			67	57	35	0	1
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Chimney/Shft	Cracked	Min: <10% mat'l loss, etching	Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
				Channel	Dens/deposition	Major: 3-5gal bucket	Maintenance							
				Light Highway Rural Streets Offset	04/13/2012	04/13/2012	Truck 1	I		64	62	20	0	4
FOUR MILE RUN	000122SMH	X	3800 KING ST	Frame	Min: 7/8" to 2" (2.5-5cm)	Structural								
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Pipe Connection-1	Corroded, pitted, spalled Roots Intrusion	Mod: 1/16"-1/8" (2-3mm) dia. fingers, ~3/8" (1cm) dia. runner	Maintenance							
				Pipe Connection-1	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width	Structural							
				Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Pipe Connection-3	Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width	Structural							
				KING ST	Light Highway Rural Streets Offset	04/13/2012	04/13/2012	Truck 1	I	70	69	10	0	4
FOUR MILE RUN	000126SMH	X	3800	Frame	Min: 7/8" to 2" (2.5-5cm)	Structural								
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
				Pipe Connection-2	Roots intrusion	Small mass Extreme: >1/4" (6mm) width, pieces, missing	Maintenance							
				Pipe Connection-3	Pipe cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							
				KING ST	03/21/2012	03/21/2012	Truck 1	I		Not found	0	0	0	0
				KING ST	03/29/2012	03/29/2012	Truck 1	I		59	60	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame	Corroded, pitted, spalled	Min: etching spots, 1/16" to 1/8" (2-3mm) depth				Structural						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% matt loss, <3/8" (1cm) etching				Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, small pieces				Structural						
			Pipe Connection-1	Pipe cracked	Min: 1/16" to 1/8" (2-3mm) width				Structural						
FOUR MILE RUN	000135SMH	X	KING ST	Light Highway Rural Streets	03/29/2012	03/29/2012	Truck 1	1		64	65	0	0	0	4
			Frame	Corroded, pitted, spalled	Min: etching spots, 1/16" to 1/8" (2-3mm) depth				Structural						
			Frame Base Seal	Cracked / deteriorated	Min: <1/4gpm, staining, mineral deposits,				Structural						
			Frame Base Seal	I/I evidence	Min: <10% matt loss, <3/8" (1cm) etching				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, small pieces				Structural						
			Chamber	I/I evidence	Min: <10% matt loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Pipe Connection-1	Pipe cracked	Min: 1/16" to 1/8" (2-3mm) width				Structural						
FOUR MILE RUN	000134SMH	X	KING ST	Light Highway Rural Streets	03/29/2012	03/29/2012	Truck 1	1		73	74	0	0	0	4
			Frame	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces				Structural						
			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching ~ 3/8" (1cm)				Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Chimney/Shft	Mortar missing	Min: <10% of area				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Maj: 25-50% matt loss, etching				Structural						
			Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Chamber	Mortar missing	Min: 10-25% of area				Structural						
			Chamber	Corroded, pitted, spalled	Maj: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits,				I/I						
			Bench	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						
			Easement		01/31/2012	01/31/2012	Truck 1	1		54	55	0	0	0	3
FOUR MILE RUN	000136SMH	X	KING ST	Corroded, pitted, spalled	Min: <10% matt loss, <3/8" (1cm) etching				Structural						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
			Chimney/Shaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural	I/I						
			Chimney/Shaft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural							
			Chamber	Corroded, pitted, spalled	Min: <10% matt loss, etching			Structural							
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural	I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
FOUR MILE RUN	000140SMH	X	3846	Easement	01/31/2012	01/30/2012	Truck 1	1		28	29	0	0	0	3
FOUR MILE RUN	000142SMH	X	3846	Chimney/Shaft	Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural							
FOUR MILE RUN	000143SMH	X	2701	Chimney/Shaft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural	I/I						
FOUR MILE RUN	000143SMH	X	2701	Light Highway/Rural Streets	01/30/2012	01/30/2012	Truck 1	1		47	48	0	0	0	2
			Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural							
			Chamber	I/I evidence	Min: <10% matt loss, etching			Structural							
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			N VAN DORN ST	Light Highway/Rural Streets	03/28/2012	03/28/2012	Truck 1	1		64	65	0	0	0	2
			Frame	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/4" (3-5mm) depth			Structural							
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% matt loss, >3/8" (1cm) etching			Structural	I/I						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chimney/Shaft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural							
			Chimney/Shaft	Corroded, pitted, spalled	Min: <10% matt loss, etching			Structural							
			Chimney/Shaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural	I/I						
			Chamber	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching			Structural							
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			KING ST	Light Highway/Rural Streets	03/28/2012	03/28/2012	Truck 1	1		66	67	0	0	0	2
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural	I/I						
			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching ~ 3/8" (1cm) Structural pieces			Structural							
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural	I/I						
			Chimney/Shaft	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching			Structural							
			Chimney/Shaft	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural	I/I						
			Chamber	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural							
			Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural							
			Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural							
FOUR MILE RUN	000144SMH	X	3900	Frame Base Seal	Light Highway/Rural Streets	03/28/2012	03/28/2012	Truck 1	1		66	67	0	0	0
FOUR MILE RUN	000145SMH	X	2701	N VAN DORN ST	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural							
FOUR MILE RUN	000145SMH	X	2701	Frame Base Seal	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	NH Pot II Field Flow (gpm)	# Connecting Pipes
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, >3/8" (1cm) etching	Structural		I/I						
FOUR MILE RUN	000146IN	X	3302	Chimney/Shelf	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural								
FOUR MILE RUN	000146SMH	X	3846	Chimney/Shelf	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Structural								
FOUR MILE RUN	000147SMH	X	2425	WYNDHAM CL KING ST	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	Truck 1	1		28	29	0	0	3
FOUR MILE RUN	000147SMH	X	2425	Frame	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Truck 1	1		43	44	0	0	4
FOUR MILE RUN	000147SMH	X	2425	Chamber Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	Truck 1	1						
FOUR MILE RUN	000147SMH	X	2425	Chamber Chamber	Corroded, pitted, spalled	Min: 7/8" to 2" (2.5-5cm) width, chipping, spalling	Structural	Truck 1	1						
FOUR MILE RUN	000147SMH	X	2425	Cover Cover	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	Truck 1	1						
FOUR MILE RUN	000147SMH	X	2425	Frame Base Seal	Cracked / deteriorated	Min: >1/8" (3mm) width	Structural								
FOUR MILE RUN	000147SMH	X	2425	Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000147SMH	X	2425	Chimney/Shelf	Cracked	Min: <10% mat'l loss, etching	Structural								
FOUR MILE RUN	000147SMH	X	2425	Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000147SMH	X	2425	Chamber	I/I evidence	Min: <10% mat'l loss, etching	Structural								
FOUR MILE RUN	000147SMH	X	2425	MENOKIN DR	Light Highway Rural Streets Offset	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1		95	95	0	0	4
FOUR MILE RUN	000147SMH	X	2425	MENOKIN DR	Light Highway Rural Streets Offset	Min: 7/8" to 2" (2.5-5cm) width, chipping, spalling	Structural	Truck 1	1						
FOUR MILE RUN	000147SMH	X	2425	MENOKIN DR	Light Highway Rural Streets Offset	Min: >1/8" (3mm) width	Structural								
FOUR MILE RUN	000147SMH	X	2425	Frame	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000147SMH	X	2425	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural								
FOUR MILE RUN	000147SMH	X	2425	Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000147SMH	X	2425	Grade Ring	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
FOUR MILE RUN	000147SMH	X	2425	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000147SMH	X	2425	Chamber	I/I evidence	Min: <10% mat'l loss, etching	Structural								
FOUR MILE RUN	000147SMH	X	2425	LATROBE PL	Corroded, pitted, spalled	Min: <10% mat'l loss, staining, mineral deposits, flow weeping	Structural								
FOUR MILE RUN	000151IND	X	4649	Chamber	Easement	Min: <10% mat'l loss, etching	Structural	Truck 1	1		53	55	0	0	3
FOUR MILE RUN	000151SMH	X	2409	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000151SMH	X	2409	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural								
FOUR MILE RUN	000151SMH	X	2409	Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Maintenance								
FOUR MILE RUN	000151SMH	X	2409	MENOKIN DR	Debris/deposition	Min: <1 gal bucket	Maintenance								
FOUR MILE RUN	000151SMH	X	2409	Frame	Light Highway Rural Streets Offset	Min: 7/8" to 2" (2.5-5cm)	Structural								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
				Frame Base Seal	Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping				Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
				Grade Ring	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
				Chimney/Shft	I/I evidence	Min: <1/4/gpm, staining, mineral deposits, flow weeping			I/I							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
				Chamber	I/I evidence	Min: <1/4/gpm, staining, mineral deposits, flow weeping			I/I							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
				N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	1			62	64	0	0	2	
FOUR MILE RUN	000152SMH	X	2249	Cover	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) width, tight			Structural							
				Frame Base Seal	Cracked / deteriorated	Min: <1/16" (2mm) width, tight			Structural							
				Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
				Chimney/Shft	Cracked	Min: <1/4/gpm, staining, mineral deposits, flow weeping			I/I							
				Chimney/Shft	I/I evidence	Min: <1/4/gpm, staining, mineral deposits, flow weeping			I/I							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
				N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	1			67	68	0	0	2	
FOUR MILE RUN	000153SMH	X	2300	Cover	Fit In Frame	Min: tight			Structural							
				Cover	Cracked / deteriorated	Min: <1/16" (2mm) width, tight			Structural							
				Cover	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) width, tight			Structural							
				Frame	Cracked / broken / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width			Structural							
				Frame	Offset	Min: 7/8" to 2" (2-5cm)			Structural							
				Frame	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth			Structural							
				Frame Base Seal	Cracked / deteriorated	Spalling			Structural							
				Frame Base Seal	I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
				Chamber	Corroded, pitted, spalled	Min: <1/4/gpm, staining, mineral deposits, flow weeping			I/I							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
				N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	1			61	62	0	0	4	
FOUR MILE RUN	000154SMH	X	2249	Cover	Corroded, pitted, spalled	Min: <1/16" (2mm) width, tight			Structural							
				Cover	Fit In Frame	Min: tight			Structural							
				Cover	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							

Basin	MH	SCREAM Insp.	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Pipe Connection-4	Pipe cracked	Min: 3/16" - 1/4" (6-8mm) width				Structural						
FOUR MILE RUN	000157SMH	X	N EARLY ST	Light Highway Rural Streets	01/30/2012	Truck 1	1			51	62	0	0	0	3
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Frame Base Seal	I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chimney/Shft	Cracked	Min: <10% mat'l loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	Spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
FOUR MILE RUN	000158SMH	X	2225	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Curb/Gutter	Min: <10% mat'l loss, etching				Structural						
			N EARLY ST	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
FOUR MILE RUN	000159SMH	X	2232	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			ELLCOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	1			50	51	0	0	0	2
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
FOUR MILE RUN	000160SMH	X	4019	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			ELLCOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	1			47	48	0	0	0	2
			Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			ELLCOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	1			47	48	0	0	0	2
			Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <10% mat'l loss, etching				Structural						
FOUR MILE RUN	000161SMH	X	4021	Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching			I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <10% mat'l loss, etching				Structural						
			ELLCOTT ST	Light Highway Rural Streets	01/23/2012	Truck 1	1			47	48	0	0	0	2
			Frame Base Seal	I/I evidence	Min: <10% mat'l loss, etching				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <10% mat'l loss, etching				Structural						
FOUR MILE RUN	000162SMH	X	4031	Frame Base Seal	I/I evidence	Min: <10% mat'l loss, etching			I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <10% mat'l loss, etching				Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000163SMH	X	4038 ELLICOTT ST	Chamber	I/I evidence				Min. <1/4gpm, staining, mineral deposits, flow weeping.					
FOUR MILE RUN	000164SMH	X	4301 B W BRADDOCK RD	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural	38	39	0	0	2
FOUR MILE RUN	000165SMH	X	2208 FORT WARD PL	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural	10	10	0	0	2
FOUR MILE RUN	000166SMH	X	Pipe Connection-2	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat! loss, etching	Truck 1	1	Structural	57	58	0	0	3
FOUR MILE RUN	000167SMH	X	N VAN DORN ST	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural					
FOUR MILE RUN	000168SMH	X	2500 N VAN DORN ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural	42	38	5	0	2
FOUR MILE RUN	000169SMH	X	2500 N VAN DORN ST	Chamber	Corroded, pitted, spalled	Min: <10% mat! loss, etching	Truck 1	1	Structural					
FOUR MILE RUN	000172SMH	X	2500 N VAN DORN ST	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Maintenance	43	44	0	0	3
FOUR MILE RUN	000173SMH	X	2500 N VAN DORN ST	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat! loss, etching	Truck 1	1	Structural	60	60	0	0	3
FOUR MILE RUN	000175SMH	X	KING ST	Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural					
FOUR MILE RUN	000176SMH	X	Cover	Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural					
FOUR MILE RUN	000177SMH	X	Cover	Grade Ring	Cracked	Mod: 1/8" to 1/4" (3-6mm) width, small pieces	Truck 1	1	Structural					
FOUR MILE RUN	000178SMH	X	Cover	Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural					
FOUR MILE RUN	000179SMH	X	Cover	Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural					
FOUR MILE RUN	000180SMH	X	Cover	Grade Ring	Fit in Frame	Min: tight	Sealed Lid	1	Structural	94	94	0	0	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Port II Field Flow (gpm)	# Connecting Pipes
			Cover		Corroded, pitted, spalled Cracked / deteriorated	Mod: generally etching, 1/8" to 3/16" (3-5mm) width. Min: >1/8" (3mm) width.			Structural						
FOUR MILE RUN	000177SMH	X	2500	N VAN DORN ST	Parking Lot	02/01/2012	02/01/2012	Truck 1	1	Sealed Lid	0	0	0	0	0
FOUR MILE RUN	000178SMH	X	2500	N VAN DORN ST	Pavement Concrete	02/01/2012	02/01/2012	Truck 1	1		56	56	0	0	2
			Grade Ring		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
			Chimney/Shft		Offset	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
			Chamber		I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
FOUR MILE RUN	000179SMH	X	2500	N VAN DORN ST	Yard-Front	02/01/2012	02/01/2012	Truck 1	1		37	38	0	0	2
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
			Chamber		I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
			Chamber		Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
FOUR MILE RUN	000180SMH	X	2500	Grade Ring	Offset	Min: 7/8" to 2" (2-5.5cm)			Structural						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: <10% matt'l loss, etching			Structural						
			Chimney/Shft		I/I evidence	Min: <10% matt'l loss, etching			Structural						
			Chimney/Shft		Spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		I/I evidence	Min: <10% matt'l loss, etching			Structural						
			Chamber		Cracked	Min: <10% matt'l loss, etching			Structural						
			Chamber		Spalled	Min: <10% matt'l loss, etching			Structural						
			KING ST		Yard-Front	01/31/2012	01/31/2012	Truck 1	1		47	48	0	0	5
			Chamber		Corroded, pitted, spalled	Min: <10% matt'l loss, etching			Structural						
			Chamber		I/I evidence	Min: <10% matt'l loss, etching			Structural						
			Chamber		Cracked	Min: <10% matt'l loss, etching			Structural						
FOUR MILE RUN	000181SMH	X	3900	Chamber	Corroded, pitted, spalled	Min: <10% matt'l loss, etching			Structural						
			Chamber		I/I evidence	Min: <10% matt'l loss, etching			Structural						
			Pipe Connection-3		Pipe cracked	Min: 1/8" to 3/16" (3-5mm) width			Structural						
			Pipe Connection-4		Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width			Structural						
			KING ST		Parking Lot	01/31/2012	01/31/2012	Truck 1	1		37	38	0	0	2
			Chamber		Corroded, pitted, spalled	Min: <10% matt'l loss, etching			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 2" to 3" (5-7.5cm)			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/8" to 3/16" (3-5mm) width			I/I						
FOUR MILE RUN	000182SMH	X	3900	KING ST	Light Highway Rural Streets	03/29/2012	03/29/2012	Truck 1	1		49	50	0	0	2
			Frame		Corroded, pitted, spalled	Min: <10% matt'l loss, >38" (1cm) etching			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			I/I						
			Frame Base Seal		Cracked / deteriorated	Min: <10% matt'l loss, etching			Structural						
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% matt'l loss, etching			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link:	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	000185SMH	X	3800	KING ST Chamber	Cracked Easement	Min: 1/16" to 1/8" (2-3mm) width, spalling. <u>07/31/2012</u>	Truck 1	1	Structural		54	55	0	0	3	
FOUR MILE RUN	000185SMH	X	3800	Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber Channel	Cracked Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked Mortar missing	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: <10% area			Structural	I/I						
FOUR MILE RUN	000185SMH	X	3800	KING ST Frame Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Cracked Cracked Corroded, pitted, spalled Corroded, pitted, spalled Cracked I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% mat'l loss, etching Min: 7/8" to 2" (2-5.5cm) Extreme: >14" (6mm) width, pieces, missing Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <1/4gpm, staining, mineral deposits, flow weeping	<u>07/31/2012</u>	Truck 1	1	Structural		74	74	0	0	3
FOUR MILE RUN	000190CB	X	701	CH44LFONTE DR Chamber Chamber Chamber Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked I/I evidence Light Highway Rural Streets	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <1/4gpm, staining, mineral deposits, flow weeping	<u>07/14/2012</u>	Truck 1	1	Structural		37	38	0	0	1
FOUR MILE RUN	000191SMH	X	3800	KING ST Chimney/Shft Chimney/Shft Chamber Chamber Chamber Chamber	Cracked Corroded, pitted, spalled Cracked I/I evidence Corroded, pitted, spalled Cracked I/I evidence Corroded, pitted, spalled Cracked I/I evidence Frame Base Seal	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces I/I evidence I/I evidence Corroded, pitted, spalled Cracked I/I evidence	<u>07/31/2012</u>	Truck 1	1	Structural	I/I	50	51	0	0	3
FOUR MILE RUN	000196SMH	X	3900	Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft W BRADDOCK RD	Cracked / deteriorated I/I evidence I/I evidence Corroded, pitted, spalled Cracked / deteriorated I/I evidence I/I evidence Corroded, pitted, spalled Cracked I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces <u>07/20/2012</u>	<u>07/20/2012</u>	Truck 1	1	Structural	I/I	60	61	0	0	3
FOUR MILE RUN	000197SMH	X	4401	Chimney/Shft											2	

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
			Chimney/Shaft		Corroded, pitted, spalled	Min: <10% matt loss, etching			Structural							
			Chimney/Shaft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber		Corroded, pitted, spalled	Min: <10% matt loss, etching			Structural							
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber		I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, I/I flow weeping	03/26/2012	03/26/2012	Truck 1	1	37	38	0	0	3	
			PARK CENTER DR		Sidewalk	Cracked			Structural							
			Chamber		Corroded, pitted, spalled	Min: <1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, I/I flow weeping	03/26/2012	03/26/2012	Truck 1	1	37	38	0	0	3	
			Chamber		I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, I/I flow weeping	03/26/2012	03/26/2012	Truck 1	1	37	38	0	0	3	
FOUR MILE RUN	000242IN	X	3101		Chamber	Cracked			Structural							
			Chamber		Corroded, pitted, spalled	Min: <1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, I/I flow weeping	03/26/2012	03/26/2012	Truck 1	1	37	38	0	0	3	
			PARK CENTER DR		Sidewalk	Cracked			Structural							
			Chamber		I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, I/I flow weeping	03/26/2012	03/26/2012	Truck 1	1	37	38	0	0	3	
			Pipe Connection-3		Pipe cracked				Structural							
			N HOWARD ST		Yard-Side	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/03/2012	02/03/2012	Truck 1	1	54	55	0	0	3	
			PARK CENTER DR		Sidewalk	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching		Structural							
			Chimney/Shaft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, I/I flow weeping	02/03/2012	02/03/2012	Truck 1	1	54	55	0	0	3	
			Chimney/Shaft		Corroded, pitted, spalled	Mod: 10-25% matt loss, etching		Structural								
			Chamber		Cracked	Min: <1/16" to 1/8" (2-3mm) width, small pieces	02/03/2012	02/03/2012	Truck 1	1	54	55	0	0	3	
			Chamber		Corroded, pitted, spalled	Mod: 10-25% matt loss, etching		Structural								
			W BRADDOCK RD		Easement	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
			GRETTER PL		Easement	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	2	
			PARK CENTER DR		Easement	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
			GADSEY PL		Easement	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
FOUR MILE RUN	000253IO	X	1605		FOUR MILE RD	Min: <1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
			3103		FOUR MILE RUN	Mod: 1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	2	
			PARK CENTER DR		Easement	Mod: 1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
			W BRADDOCK RD		Easement	Mod: 1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
			GADSEY PL		Easement	Mod: 1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/02/2012	02/02/2012	Truck 1	1	0	0	0	0	1	
FOUR MILE RUN	000294IO	X	2701		FOUR MILE RD	Min: <1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/08/2012	02/08/2012	Truck 1	1	0	0	0	0	1	
			2509		FOUR MILE RD	Mod: 1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/08/2012	02/08/2012	Truck 1	1	0	0	0	0	1	
			FOUR MILE RUN		FOUR MILE RD	Min: <1/16" to 1/8" (2-3mm) width, staining, mineral deposits, I/I flow weeping	02/08/2012	02/08/2012	Truck 1	1	0	0	0	0	0	
			MT VERNON AV		Sidewalk	Not found			Structural							
			3811		MT VERNON AV				Structural							
			Pipe Connection-3		Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width	03/30/2012	03/30/2012	Truck 1	1	15	15	0	0	3	
			W BRADDOCK RD		Sidewalk	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining	01/16/2012	01/16/2012	Truck 1	1	49	50	0	0	3
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% matt loss, <3/8" (1cm) etching			Structural							
			Frame Base Seal		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
			Chimney/Shaft		Corroded, pitted, spalled	Min: <10% matt loss, etching			Structural							
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining			Structural							
			Chamber		Corroded, pitted, spalled	Min: <10% matt loss, etching			Structural							
FOUR MILE RUN	000315SMH	X	4899													

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shaft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, spalling, etching			Structural						
			Chimney/Shaft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/27/2012	Truck 1	I/I						
			N HAMPTON DR		Yard-Side	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/27/2012	Truck 1	I/I						
FOUR MILE RUN	000324SMH	X	3101	Chimney/Shaft	I/I evidence	Min: 3-/0gpm, staining, flow running									2
			Chimney/Shaft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shaft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching	02/02/2012	Truck 1	I/I						
FOUR MILE RUN	000325IO	X	4320	LOYOLA AV	Yard-Back	Min: <10% mat'l loss, etching	02/02/2012	Truck 1	I/I						1
FOUR MILE RUN	000325SMH	X	4390	KING ST	Yard-Front	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/27/2012	Truck 1	I/I						3
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, >3/8" (1cm) etching			Structural						
			Frame Base Seal		I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I						
			Chimney/Shaft		I/I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I						
			Chimney/Shaft		Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	04/11/2012	Truck 1	I/I						
			N HAMPTON DR		Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/11/2012	Truck 1	I/I						
			Frame Base Seal		Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural									
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shaft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shaft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/09/2012	Truck 1	I/I						
			KING ST		Light Highway Rural Streets	Min: <10% mat'l loss, etching ~ 3/8" (1cm) Structural									
			Cover		Cracked / deteriorated	Min: <1/16" (2mm) width, light depth			Structural						
			Frame		Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 1/8" (2-3mm) Structural									
			Frame Base Seal		Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, etching			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shaft		Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
			Chimney/Shaft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
FOUR MILE RUN	000328SMH	X	4700												4

Basin	MH	SCREAM Insp	Building Address	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000330IN	X	3800	KING ST	Chamber	I/I evidence Easement	Min <1/16" staining, mineral deposits, flow weeping 01/31/2012	Truck 1	1	No Access	83	84	0	0	0	2
FOUR MILE RUN	000330SMH	X	4700	KING ST	Frame	Cracked / broken / deteriorated Corroded, pitted, spalled	Major: 1/8" to 3/16" (3-5mm) width advanced etching, 3/16" to 3/8" (5-10mm) mat'l loss	Truck 1	1	Structural						
FOUR MILE RUN	000335IN	X	3800	Frame Base Seal	Frame	Corroded, pitted, spalled	Major: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching	Truck 1	1	Structural						
FOUR MILE RUN	000335SMH	X	2600	CHIMNEY/SHAFT	Frame Base Seal	Cracked / deteriorated	Major: 3/8"-3/4" (10-20mm) width, pieces, missing	Truck 1	1	Structural						
FOUR MILE RUN	000335SMH	X	3125	MT VERNON AV	Chimney/Shaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Spalling	Truck 1	1	Structural						
FOUR MILE RUN	000339CB	X	3125	Frame Base Seal	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Truck 1	1	Structural						
FOUR MILE RUN	000339SMH	X	2600	N HAMPTON DR	Chimney/Shaft	I/I evidence Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping 01/31/2012	Truck 1	1	I/I						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Spalling	Truck 1	1	Structural						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Truck 1	1	Structural						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	I/I evidence Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping 01/19/2012	Truck 1	1	I/I						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Spalling	Truck 1	1	Structural						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Truck 1	1	Structural						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	I/I evidence Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping 01/19/2012	Truck 1	1	I/I						
FOUR MILE RUN	000339SMH	X	3125	Frame Base Seal	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, Spalling	Truck 1	1	Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	000340SMH	X	2600	N HAMPTON DR	Chimney/Shaf	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shaf	Cracked	Min: <1/16" staining, mineral deposits, flow weeping		II							
					Chamber	Corroded, pitted, spalled II evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Chamber	Min: <1/16" staining, mineral deposits, flow weeping	01/19/2012	Truck 1	II							
FOUR MILE RUN	000340SMH	X	2600	Frame	Frame Base Seal	Cracked / deteriorated Mod: 2" to 3" (5-7.5cm)	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, >3/8" (1cm) etching		Structural							
					Chimney/Shaf	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chimney/Shaf	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shaf	Min: <1/16" staining, mineral deposits, flow weeping	01/19/2012	Truck 1	II							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Chamber	Min: <1/16" staining, mineral deposits, flow weeping	01/19/2012	Truck 1	II							
FOUR MILE RUN	000341SMH	X	2600	N HAMPTON DR	Frame	Light Highway Rural Streets Offset	Mod: 3" to 4" (7.5-10cm)		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Chamber	Min: <1/16" staining, mineral deposits, flow weeping	01/19/2012	Truck 1	II							
FOUR MILE RUN	000342SMH	X	2600	N HAMPTON DR	Frame	Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Cracked / deteriorated II evidence	Min: <10% mat'l loss, etching		Structural							
					Chamber	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Chamber	Min: <1/16" staining, mineral deposits, flow weeping	01/19/2012	Truck 1	II							
FOUR MILE RUN	000343SMH	X	4651	W BRADDOCK RD	Frame	Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
					Chamber	Cracked	Min: <10% mat'l loss, etching		Structural							
					Chamber	Corroded, pitted, spalled II evidence	Min: <10% mat'l loss, etching		Structural							
					Channel	Debris/Deposition	Min: <1gal bucket		Maintenance							
FOUR MILE RUN	000343SMH	X	4651	W BRADDOCK RD	Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural								
					Chimney/Shaf	Cracked	Min: <10% mat'l loss, etching		Structural							
					Chimney/Shaf	Corroded, pitted, spalled II evidence	Min: <1/16" staining, mineral deposits, flow weeping		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							
FOUR MILE RUN	000344SMH	X	4651	FOUR MILE RUN	Chimney/Shaf	Min: <1/16" staining, mineral deposits, flow weeping		Structural								
					Chimney/Shaf	Corroded, pitted, spalled II evidence	Min: <1/16" staining, mineral deposits, flow weeping		Structural							
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	000345SMH	X	4621	W BRADDOCK RD	Chimney/Shelf Chamber Channel	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping Min: <10% mat'l loss, etching flow weeping	Debris/deposition	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling I/I evidence	Maintenance	50	51	0	0	2
FOUR MILE RUN	000346SMH	X	4621	W BRADDOCK RD	Chimney/Shelf Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling I/I evidence	Easement	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling I/I evidence	Structural	50	51	0	0	2
FOUR MILE RUN	000347SMH	X	2901	N HAMPTON DR	Frame Base Seal Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Light Highway/Rural Streets	Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling I/I evidence	Structural	14	14	0	0	2
FOUR MILE RUN	000348CB	X	506	TENNESSEE AV	Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Sidewalk	Cracked	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	0	0	0	0	3
FOUR MILE RUN	000349SMH	X	4501	FORD AV	Frame Base Seal Frame Base Seal Chimney/Shelf Chimney/Shelf Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching ~ 3/8" (1cm) flow weeping Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) flow weeping	Light Highway/Rural Streets	Cracked / deteriorated I/I evidence	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	44	45	0	0	2
FOUR MILE RUN	000349SMH	X	2901	N HAMPTON DR	Frame Base Seal Chimney/Shelf Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Light Highway/Rural Streets	Cracked / deteriorated I/I evidence	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	53	54	0	0	3
FOUR MILE RUN	000349SMH	X	2410	N HAMPTON DR	Frame Base Seal Chimney/Shelf Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: 3/8"-3/4" (10-20mm) width, pieces, missing etching I/I evidence	Light Highway/Rural Streets	Cracked / deteriorated I/I evidence	Min: 1/16"-3/4" (10-20mm) width, pieces, missing etching I/I evidence	Structural	61	62	0	0	3
FOUR MILE RUN	000350SMH	X	2901	N HAMPTON DR	Chimney/Shelf Chimney/Shelf Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching flow weeping Min: <10% mat'l loss, etching spalling Min: <10% mat'l loss, etching flow weeping	Light Highway/Rural Streets	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching flow weeping Min: <10% mat'l loss, etching spalling Min: <10% mat'l loss, etching flow weeping	Structural	52	51	5	0	4

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000358SMH	X	2416	N HAMPTON DR Chimney/Shaft	Light Highway Rural Streets	Debris/deposition Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Truck 1	I/I	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	2416	Chimney/Shaft	Light Highway Rural Streets	Debris/deposition	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Truck 1	I/I	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	2416	Chimney/Shaft	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Structural	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	2416	Chamber	Light Highway Rural Streets	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural	Structural	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	2416	Chamber	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Structural	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	2416	Chamber	Light Highway Rural Streets	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Maintenance	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	2416	Channel	Light Highway Rural Streets	Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Maintenance	52	51	5	0	3
FOUR MILE RUN	000358SMH	X	4678	W BRADDOCK RD Frame Base Seal	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	4678	Frame Base Seal	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	Structural	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	4678	Chimney/Shaft	Light Highway Rural Streets	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	4678	Chimney/Shaft	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	Structural	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	4678	Chamber	Light Highway Rural Streets	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	4678	Chamber	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	Structural	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	4678	Chamber	Light Highway Rural Streets	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Maintenance	52	53	0	0	3
FOUR MILE RUN	000358SMH	X	2901	N HAMPTON DR Steps	Easement	Broken / missing / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	51	51	10	0	2
FOUR MILE RUN	000358SMH	X	2559	GADSBY PL.	Easement	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	51	51	10	0	2
FOUR MILE RUN	000358SMH	X	2559	Chimney/Shaft	Easement	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	Structural	51	51	10	0	2
FOUR MILE RUN	000358SMH	X	2559	Chamber	Easement	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	51	51	10	0	2
FOUR MILE RUN	000358SMH	X	2559	Chamber	Easement	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I	Maintenance	51	51	10	0	2
FOUR MILE RUN	000362SMH	X	2280	N BEAUREGARD ST Frame Base Seal	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Frame Base Seal	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	Structural	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Chimney/Shaft	Light Highway Rural Streets	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Structural	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Chimney/Shaft	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	Structural	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Chamber	Light Highway Rural Streets	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	Structural	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Chamber	Light Highway Rural Streets	Corroded, pitted, spalled	Mod: 10-25% of area	Structural	Structural	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Pipe Connection-2	Light Highway Rural Streets	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I	Maintenance	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Pipe Connection-3	Light Highway Rural Streets	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Maintenance	66	67	0	0	3
FOUR MILE RUN	000362SMH	X	2280	Pipe Connection-4	Light Highway Rural Streets	Pipes cracked	Min: 3/16"-1/4" (5-8mm) width	Structural	Maintenance	66	67	0	0	3
FOUR MILE RUN	000363SMH	X	3101	N HAMPTON DR	Light Highway Rural Streets	04/11/2012	Truck 1	1	49	50	50	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame Base Seal	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chimney/Shft	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chimney/Shft	Chimney/Shft	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chamber	Chamber	Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching				Structural					
FOUR MILE RUN	000364SMH	X	N HAMPTON DR	Frame Base Seal	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>04/11/2012</u>	Truck 1	1		I/I	63	64	0	0	3
			Chimney/Shft	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chimney/Shft	Chimney/Shft	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chamber	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 10-25% mat'l loss, etching				Structural					
FOUR MILE RUN	000365IO	X	3101	Frame Base Seal	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>03/02/2012</u>	Truck 1	1		I/I	25	25	0	0	1
			Chamber	Chamber	Corroded, pitted, spalled I/I evidence	Mod: generally etching, 1/8" to 3/16" (3- 5mm) depth				Structural					
			JEFFERSON DAVIS HY	Pipe Connection-1 KING ST	Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural				I/I					
FOUR MILE RUN	000365SMH	X	4700	Frame	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural					
			Frame Base Seal	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chimney/Shft	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural					
			Chimney/Shft	Chimney/Shft	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chamber	Chamber	Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% mat'l loss, etching				Structural					
FOUR MILE RUN	000367SMH	X	2901	Frame Base Seal	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>04/11/2012</u>	Truck 1	1		I/I	45	46	0	0	2
			Chimney/Shft	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chamber	Chamber	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural					
			KING ST	Frame	Cracked / deteriorated Corroded, pitted, spalled Cracked / broken / deteriorated Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Extreme: >3/16" (5mm) width Min: etching spotty, 1/16" to 1/8" (2-3mm) Structural				Structural					
FOUR MILE RUN	000368SMH	X	4622	Frame							81	82	0	0	2

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	00036SSMH	X	KING ST 4622	Frame Base Seal	Corroded, pitted, spalled II evidence	Min: <10% matl loss, <3/8" (1cm) etching		Structural						
FOUR MILE RUN	000371SMH	X	KING ST 4651	Frame Base Seal	Cracked / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	Corroded, pitted, spalled	Mod: generally etchings, 1/8" to 3/16" (3-5mm) depth		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Frame	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching - 3/8" (1cm)		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	II evidence	Min: <10% matl loss, etching		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	II evidence	Mod: generally etchings, 1/8" to 3/16" (3-5mm) depth		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chamber	Cracked	Mod: 10-25% matl loss, etching - 3/8" (1cm)		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Pipe Connection-2	Pipe cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Light Highway/Rural Streets	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Light Highway/Rural Streets	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Light Highway/Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	Corroded, pitted, spalled	Mod: <10% matl loss, etching		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching		Structural						
FOUR MILE RUN	000372SMH	X	KING ST 4651	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000373SMH	X	4622	KING ST	Chamber	Cracked	I/I evidence		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I				0	0
FOUR MILE RUN	000374SMH	X	4622	KING ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% matt'l loss, etching	Truck 1	1	Not found	0	0	0	0	0
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1						5
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matt'l loss, etching ~3/8" (1cm) Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
					Chimney/Shft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matt'l loss, etching	Truck 1	1						
					Chamber	I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
					Chamber	Corroded, pitted, spalled	Mod: 10-25% matt'l loss, etching	Truck 1	1						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1						
FOUR MILE RUN	000377SMH	X	4474	KING ST	Frame Base Seal	Cracked / deteriorated	Min: <10% matt'l loss, etching	Truck 1	1						
					Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1						
					Chimney/Shft	I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1						
					Chamber	I/I evidence	Min: <10% matt'l loss, etching	Truck 1	1						
					Chamber	Corroded, pitted, spalled	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
					Chamber	I/I evidence	Min: <10% matt'l loss, etching	Truck 1	1						
FOUR MILE RUN	000381SMH	X	4474	KING ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% matt'l loss, etching	Truck 1	1						
					Frame Base Seal	I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1						
					Chimney/Shft	I/I evidence	Min: <10% matt'l loss, etching	Truck 1	1						
					Chamber	Cracked	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
					Chamber	I/I evidence	Min: <10% matt'l loss, etching	Truck 1	1						
					Chamber	Corroded, pitted, spalled	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						
FOUR MILE RUN	000383SMH	X	4480	KING ST	Frame Base Seal	I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping	Truck 1	1						3
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% matt'l loss, etching	Truck 1	1						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000385SMH	X	3102	Chamber S 28TH ST	Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits flow weeping	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I		37	38	0	0	4
FOUR MILE RUN	000386SMH	X	4799	W BRADDOCK RD	Corroded, pitted, spalled Easement	<u>02/06/2012</u>	<u>Truck 1</u>	1	Structural						
FOUR MILE RUN	000387SMH	X	4799	Chimney/Shft KING ST	Cracked I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000388SMH	X	4480	W BRADDOCK RD	Cracked Sidewalk	<u>12/27/2011</u>	<u>Truck 1</u>	1	Structural						2
FOUR MILE RUN	000389SMH	X	4898	Chimney/Shft KING ST	Cracked / deteriorated Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	000390SMH	X	4622	Frame Base Seal	Corroded, pitted, spalled Cracked I/I evidence	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural								
FOUR MILE RUN	000391SMH	X	4622	Frame Base Seal	Corroded, pitted, spalled Cracked I/I evidence	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural								
FOUR MILE RUN	000392SMH	X	4622	Light Highway Rural Streets	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural								
FOUR MILE RUN	000393SMH	X	4622	Light Highway Rural Streets	Mortar missing I/I evidence	Min: <10% mat'l loss, etching Min: <10% of area flow weeping	Structural								

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000391IN	X	4004	Frame Base Seal Chimney/Shft Chamber	Cracked / deteriorated Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, spalling	Chipping,	Structural	Min: <10% matl loss, <3/8" (1cm) etching	Structural	I/I			
FOUR MILE RUN	000391SMH	X	3400	Frame Base Seal Chimney/Shft Chamber	I/I evidence I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I			
FOUR MILE RUN	000392IN	X	2115	Frame Base Seal Chimney/Shft Chamber	Corroded, pitted, spalled Cracked	Min: <10% matl loss, etching	Chipping,	Structural	Min: <10% matl loss, etching	Structural	I/I			
FOUR MILE RUN	000392SMH	X	4700	Frame Base Seal Chimney/Shft Chamber	I/I evidence I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matl loss, etching	Structural	Min: <10% matl loss, etching	Structural	I/I			
FOUR MILE RUN	000393IN	X	2121	Frame Base Seal Chimney/Shft Chamber	Cracked / deteriorated Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, spalling	Chipping,	Structural	Min: <10% matl loss, <3/8" (1cm) etching	Structural	I/I			

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000393SMH	X	4700 KING ST	Chamber Pipe Connection-1	III evidence	Corroded, pitted, spalled	Min. <1/4gpm, staining, mineral deposits, flow weeping Min. <10% matt loss, etching	Structural						
FOUR MILE RUN	000394SMH	X	5098 DAWES AV	Frame Base Seal	Light Highway/Rural Streets	Cracked / deteriorated	Mod: 10-25% matt loss, etching ~3/8" (1cm) width	Structural		52	53	0	0	4
FOUR MILE RUN	000395IN	X	4019 ELLICOTT ST	Frame Base Seal	Frame Base Seal	III evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
FOUR MILE RUN	000395SMH	X	4903 28TH ST	Chimney/Shelf	Chimney/Shelf	III evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Min. <10% matt loss, etching	Structural						
FOUR MILE RUN	000395SMH	X	4903 28TH ST	Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
FOUR MILE RUN	000397SMH	X	4903 28TH ST	Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chimney/Shelf	Offset	Mod: 2" to 3" (5-7.5cm)	Structural							
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chimney/Shelf	Cracked	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min. <10% matt loss, etching	Structural						
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chamber	III evidence	Mod: 2-4 broken, missing	Structural							
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chamber	Easement	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth	Structural						
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chimney/Shelf	Offset	Mod: 2" to 3" (5-7.5cm)	Structural							
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chimney/Shelf	Cracked	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min. 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chamber	III evidence	Corroded, pitted, spalled	Min: <10% matt loss, etching	Structural						
FOUR MILE RUN	000398SMH	X	4903 28TH ST	Chimney/Shelf	Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	#Connecting Pipes			
FOUR MILE RUN	000399IN	X	4028	ELLICOTT ST	Sidewalk	I/I evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping 01/23/2012	Truck 1	1	I/I	37	38	0	0	3
FOUR MILE RUN	000399SMH	X	4903	Chamber Chamber Chamber 28TH ST	Chamber Chamber Chamber Frame	Corroded, pitted, spalled, etching	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	I/I	Structural									
FOUR MILE RUN	000400SMH	X	4036	Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Easement Offset	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling 01/05/2012	Truck 1	1	Structural								
FOUR MILE RUN	000401IN	X	5401	SEMINARY RD	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	I/I	Structural										
FOUR MILE RUN	000401SMH	X	4036	Pipe Connection-3 Pipe Connection-4 ELLICOTT ST	Pipe Connection-3 Pipe Connection-4 Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping 01/23/2012	I/I	Structural									
FOUR MILE RUN	000401IN	X	5401	SEMINARY RD	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	I/I	Structural										
FOUR MILE RUN	000401SMH	X	2212	FORT WARD PL	Cracked	Mod: 1/16"-3/8" (2-10mm) width, small pieces Mod: 10-25% mat'l loss, etching - 3/8" (1cm)	I/I	Structural										
FOUR MILE RUN	000404IN	X			Chamber Chamber Chamber Steps	Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	I/I	Structural									
FOUR MILE RUN	000404IN	X			Chamber Chamber Chamber Pipe Connection-1	Corroded, pitted, spalled /I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping 01/23/2012	Truck 1	1	Structural								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000415IO	X	3917	Pipe Connection-2	I/I evidence	Med: 1-3gpm, trickle flow dripping	I/I				0	0	0	0	1
FOUR MILE RUN	000416IO	X	3703	BRUCE ST.	Easement	02/20/2012	02/20/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000417IO	X	511	MT VERNON AV	Easement	02/28/2012	02/28/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000419IO	X	FOUR MILE RD	FOUR MILE RD	Easement	04/02/2012	04/02/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000422IO	X	3918	BRUCE ST	Easement	02/20/2012	02/20/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000424IO	X	2897	OLD DOMINION BV	Easement	02/15/2012	02/15/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000426IO	X	3700	COMMONWEALTH AV	Easement	03/01/2012	03/01/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000431IN	X	2500	N VAN DORN ST	Sidewalk	02/07/2012	02/01/2012	Truck 1	1		46	43	5	0	3
FOUR MILE RUN	000431IO	X	3625	EDISON ST	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I								
FOUR MILE RUN	000432IN	X	2500	N VAN DORN ST	Chamber	02/28/2012	02/01/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000432IO	X	3625	EDISON ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I			0	0	0	0	2
FOUR MILE RUN	000433IN	X	2500	N VAN DORN ST	Chamber	02/28/2012	02/01/2012	Truck 1	1		0	0	0	0	2
FOUR MILE RUN	000436IN	X	4301	B W BRADDOCK RD	Cracked	02/01/2012	02/01/2012	Truck 1	1		0	0	0	0	2
FOUR MILE RUN	000438IN	X	2500	N VAN DORN ST	Chamber	02/01/2012	02/01/2012	Truck 1	1		10	10	0	0	2
FOUR MILE RUN	000442IO	X	320	BEVERLY DR	Frame	Cracked / broken / deteriorated	Min: <1/16" (2mm) width	Structural							
FOUR MILE RUN	000456IO	X	3900	JEFFERSON DAVIS HY	Easement	02/15/2012	02/28/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000457IO	X	3981	JEFFERSON DAVIS HY	Easement	03/26/2012	03/26/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000458IN	X	4005	ELLCOTT ST	*Curb/Gutter	01/24/2012	01/24/2012	Truck 1	1		37	38	0	0	2
FOUR MILE RUN	000459IO	X	3900	JEFFERSON DAVIS HY	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
FOUR MILE RUN	000459IN	X	2119	MARLBORO DR	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural							
FOUR MILE RUN	000462IO	X	3900	JEFFERSON DAVIS HY	Easement	03/02/2012	03/02/2012	Truck 1	1		0	0	0	0	1
FOUR MILE RUN	000453IN	X			Yard-Back	01/24/2012	01/24/2012	Truck 1	1		43	44	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000454IN	X	2125	Chamber Pipe Connection-3 MARLBORO DR	I/ evidence Cracked Pipe cracked Curb/Gutter	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I							2
FOUR MILE RUN	000454IO	X	3350	Chamber Chamber Chamber C. GUNSTON RD	I/ evidence Corroded, pitted, spalled Easement	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I		37	38	0	0	0	1
FOUR MILE RUN	000454IN	X	4401	W BRADDOCK RD	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		26	26	0	0	0	3
FOUR MILE RUN	000456IO	X	3800	CHAMBER MILAN DR	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		0	0	0	0	0	1
FOUR MILE RUN	000456IN	X	2500	N VAN DORN ST	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		10	10	0	0	0	2
FOUR MILE RUN	000458IO	X	813	Pipe Connection-1 W GLEBE RD	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		0	0	0	0	0	1
FOUR MILE RUN	000458IN	X	4301	W BRADDOCK RD	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		61	61	0	0	0	2
FOUR MILE RUN	000463IO	X	907	W GLEBE RD	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		0	0	0	0	0	1
FOUR MILE RUN	000472IN	X	3800	KING ST	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		37	38	0	0	0	3
FOUR MILE RUN	000476ND	X	4313	LOUIS PL.	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		Not found	0	0	0	0	0
FOUR MILE RUN	000477IN	X	3900	KING ST	I/ evidence Cracked Easement	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/8" to 3/16" (3-5mm) width	Structural	I/I		37	38	0	0	0	2
FOUR MILE RUN	000483IN	X	3900	Chimney/Shft	I/ evidence Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I		50	51	0	0	0	4
FOUR MILE RUN	000483IN	X	3900	Chimney/Shft	I/ evidence Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I							
FOUR MILE RUN	000483IN	X	3900	Chimney/Shft	I/ evidence Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I							
FOUR MILE RUN	000483IN	X	3900	Chamber	I/ evidence Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I							
FOUR MILE RUN	000483IN	X	3900	Chamber	I/ evidence Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I							
FOUR MILE RUN	000483IN	X	3900	Chamber	I/ evidence Cracked, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	I/I							

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000484IN	X	2108 MARLBORO DR.	Curb/Gutter	01/24/2012	01/24/2012	Truck 1	1		37	38	0	0	3
FOUR MILE RUN	000552SMH	X	5165 SEMINARY RD	Chamber	II evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping					
FOUR MILE RUN	000552SMH	X	5165 SEMINARY RD	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching								
FOUR MILE RUN	000552SMH	X	5165 SEMINARY RD	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	12/19/2011	12/19/2011	Truck 1	1				4
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	03/12/2012	03/12/2012	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <38' (1cm) etching								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Frame Base Seal	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, flow weeping	03/12/2012	03/12/2012	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chimney/Shft	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chamber	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Light Highway/Rural Streets	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, flow weeping	03/12/2012	03/12/2012	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, <38' (1cm) etching								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chimney/Shft	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, flow weeping	03/12/2012	03/12/2012	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chimney/Shft	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chamber	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Channel	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Channel	Debris/deposition	Mod: 1-3gal bucket								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Channel	Cracked	Mod: 1/16" to 1/4" (3-6mm) width, pieces, missing	12/19/2011	12/19/2011	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Light Highway/Rural Streets	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	03/12/2012	03/12/2012	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~38' (1cm) Structural pieces								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
FOUR MILE RUN	000553SMH	X	5169 HERITAGE LA.	Chamber	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	12/19/2011	12/19/2011	Truck 1	1				
FOUR MILE RUN	000553SMH	X	5169 SEMINARY RD	Frame	Offset	Mod: 2" to 3" (5-7.5cm)								
FOUR MILE RUN	000553SMH	X	5169 SEMINARY RD	Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces								
FOUR MILE RUN	000553SMH	X	5169 SEMINARY RD	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <38' (1cm) etching								
FOUR MILE RUN	000553SMH	X	5169 SEMINARY RD	Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces								
FOUR MILE RUN	000553SMH	X	5169 SEMINARY RD	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	WHPot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000567SMH	X	2648	FOSTER AV	Chamber	Cracked, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	Structural	Min: <10% mat'l loss, etching	61	62	0	0	2
FOUR MILE RUN	000567SMH	X	2618	Frame Base Seal	Yard-Front	Offset	Min: 7/8" to 2" (2.5-5cm)	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5200	Frame Base Seal	Chimney/Shft	Cracked / deteriorated	Maj: 3/8"-3/4" (10-20mm) width, pieces, missing	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	FOSTER AV	Offset	Extreme: > 4" (10cm)	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Cracked	Min: <10% mat'l loss, etching	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Light Highway Rural Streets	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Corroded, pitted, spalled	Mod: 25-50% mat'l loss, etching	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	I/I evidence	Maj: 25-50% of area	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Corroded, pitted, spalled	Maj: 1/8"-1/4" (3-6mm) width, pieces, missing	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	I/I evidence	Mod: 10-25% mat'l loss, etching	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Light Highway Rural Streets	Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Cracked / deteriorated	Mod: 10-25% of area	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Corroded, pitted, spalled	Maj: 1/8" to 1/4" (3-6mm) width, chipping, spalling	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	I/I evidence	Min: <10% mat'l loss, etching	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	DAWES AV	Cracked	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	I/I evidence	Maj: 1/8"-1/4" (3-6mm) width, pieces, missing	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Truck 1	I/I						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Light Highway Rural Streets	I/I evidence	Maj: 1/8"-1/4" (3-6mm) width, pieces, missing	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	Cracked	Min: <10% mat'l loss, etching	Truck 1	Structural						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chimney/Shft	I/I evidence	Maj: 25-50% mat'l loss, etching	Truck 1	I/I						
FOUR MILE RUN	000568SMH	X	5184	Frame Base Seal	Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	00050010	X		Chamber	Corroded, pitted, spalled I/I evidence	Mod: 10-25% mat'l loss, etching			Structural	I/I					
FOUR MILE RUN	00060110	X	4889	JEFFERSON DAVIS HY W BRADDOCK RD	Easement	Min: < 1/4gpm, staining, mineral deposits, flow weeping <u>03/02/2012</u>	Truck 1	1		0	0	0	0	0	1
FOUR MILE RUN	00060310	X	2569	GADSBY PL	Easement	Min: < 1/4gpm, staining, mineral deposits, flow weeping <u>01/17/2012</u>	Truck 1	1		0	0	0	0	0	1
FOUR MILE RUN	00060410	X	2200	IVOR LA.	Easement	Mod: 10-25% mat'l loss, etching <u>02/08/2012</u>	Truck 1	1		0	0	0	0	0	1
FOUR MILE RUN	0008921N	X	3001	N BEAUREGARD ST	Sidewalk	Mod: 1/16" to 1/8" (2-3mm) width, small pieces <u>01/16/2012</u>	Truck 1	1		51	51	0	0	0	4
FOUR MILE RUN	0008961N	X	3001	N BEAUREGARD ST	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009021N	X	3001	N BEAUREGARD ST	Pipe Connection-4	Corroded, pitted, spalled Mortar, "boot", or other seal	Mod: 1/16"-1/8" (2-3mm) width cracks, separation, or torn mat' Mod: 1/8" to 3/16" (3-5mm) width	Structural							
FOUR MILE RUN	0009041N	X	3001	N BEAUREGARD ST	Pipe Connection-4	Pipe cracked	Mod: 1/16"-1/8" (2-3mm) width cracks, separation, or torn mat' Mod: 1/8" to 3/16" (3-5mm) width	Structural							
FOUR MILE RUN	0009051N	X	3100	N BEAUREGARD ST	Easement	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural								
FOUR MILE RUN	0009201N	X	2280	N BEAUREGARD ST	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009211N	X	5101	FILLMORE AV	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009271N	X	2280	N BEAUREGARD ST	Pipe Connection-4	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009281N	X	5100	FILLMORE AV	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009311N	X	5100	FILLMORE AV	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009341N	X	5100	Pipe Connection-2	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009461N	X	5100	Pipe Connection-1	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009481N	X	5100	Pipe Connection-2	Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							
FOUR MILE RUN	0009521N	X	5100	FILLMORE AV	Light Highway Rural Streets	Mod: 1-3gpm, trickle flow dripping I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: < 10% mat'l loss, etching	Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	000955IN	X	3101	N HAMPTON DR.	Chamber Chamber Chamber Chamber	Cracked, pitted, spalled Cracked Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% matl loss, <38° (1cm) etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod:10-25% matl loss, etching	Structural Structural Structural I/I						2	
FOUR MILE RUN	000957IN	X	3101	N HAMPTON DR.	Chamber Chamber Channel	Cracked Corroded, pitted, spalled Dens/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% matl loss, etching Mod: 1-3gpm, staining, mineral deposits, flow weeping	Structural Maintenance						3	
FOUR MILE RUN	000963IN	X	2800	N HAMPTON DR	Chamber Chamber Chamber	Cracked Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod:10-25% matl loss, etching Mod: 1-3gpm, trickle, flow dripping	Structural Structural I/I						2	
FOUR MILE RUN	000969IN	X	2600	N HAMPTON DR		Curb/Gutter	12/27/2011	Truck 1	1		0	0	0		3
FOUR MILE RUN	001002IN	X	2621	GASBRY PL		Sidewalk Curb/Gutter	01/18/2012	Truck 1	1		0	0	0		2
FOUR MILE RUN	001009IN	X	4680	W BRADDOCK RD		Yard-Back	01/17/2012	Truck 1	1		44	45	0		3
FOUR MILE RUN	001010IN	X	4680	W BRADDOCK RD	Chamber Chamber Chamber	I/I evidence Cracked Corroded, pitted, spalled Yard-Back	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% matl loss, etching	Structural Structural I/I						3	
FOUR MILE RUN	001011IN	X	4680	W BRADDOCK RD	Chamber Chamber Chamber	Cracked Corroded, pitted, spalled Yard-Side	04/17/2012	Truck 1	1		37	38	0		3
FOUR MILE RUN	001014IN	X	4799	W BRADDOCK RD	Chamber Chamber Chamber	Cracked I/I evidence Corroded, pitted, spalled Sidewalk	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matl loss, etching	Structural Structural I/I						2	
FOUR MILE RUN	001015IN	X	4799	W BRADDOCK RD	Chamber Chamber	Cracked Corroded, pitted, spalled Cracked	04/17/2012	Truck 1	1		37	38	0		5
FOUR MILE RUN	001019IN	X	4651	LAMBERT DR	Chamber Chamber	Cracked I/I evidence Curb/Gutter	Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural I/I			48	48	0		3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Port II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	001020IN	X	4651	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
FOUR MILE RUN	001021IN	X	4651	Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching	Structural									
FOUR MILE RUN	001022IN	X	4649	LAMBERT DR	Curb/Gutter	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>01/19/2012</u>	Truck 1	1	I/I	42	38	5	0	2		
FOUR MILE RUN	001023IN	X	4898	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
FOUR MILE RUN	001026IN	X	4898	LATROBE PL	Easement	Min: <10% mat'l loss, etching	Structural									
FOUR MILE RUN	001028IN	X	4898	Chamber	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>01/19/2012</u>	Truck 1	1	I/I	42	38	5	0	2		
FOUR MILE RUN	001034IN	X	4899	W BRADDOCK RD	Debris/position	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
FOUR MILE RUN	001038IN	X	4799	Chamber	Sidewalk	Min: <10% mat'l loss, etching	Structural									
FOUR MILE RUN	001044IN	X	5099	Chamber	Sidewalk	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>01/16/2012</u>	Truck 1	1	I/I	42	38	5	0	2		
FOUR MILE RUN	001049IN	X	5401	Chamber	Cracked	Min: <10% mat'l loss, etching	Structural									
FOUR MILE RUN	001101IN	X	303	Chamber	Sidewalk	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>01/22/2011</u>	Truck 1	1	I/I	0	0	0	0	4		
FOUR MILE RUN	001187ND	X	1608	Chamber	Sidewalk	Min: <10% mat'l loss, etching	Structural									
FOUR MILE RUN	001195SMH	X	N HOWARD ST	DAWES AV	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>01/22/2011</u>	Truck 1	1	I/I	37	38	0	0	2		
FOUR MILE RUN	001196SMH	X	5401	SEMINARY RD	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
FOUR MILE RUN	001197ND	X	303	MONTICELLO BV	Sidewalk	Min: <10% mat'l loss, etching	Structural									
FOUR MILE RUN	001198SMH	X	1608	N HOWARD ST	Yard-Front	Min: <1/4gpm, staining, mineral deposits, flow weeping <u>03/19/2012</u>	Truck 1	1	I/I	Not found	0	0	0	0	4	
FOUR MILE RUN	001203IN	X	28			Min: <1/4gpm, staining, mineral deposits, flow weeping <u>02/03/2012</u>	Truck 1	1	I/I	28	29	0	0	4		

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001196SMH	X	1612	Chimney/Shft Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Truck 1	1	42	43	0	0	2
FOUR MILE RUN	001201SMH	X	1612	N HOWARD ST Chimney/Shft Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	42	43	0	0	2
FOUR MILE RUN	001257ND	X	3915	MT VERNON AV Chimney/Shft Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	Not found	0	0	0	0
FOUR MILE RUN	001356ND	X	99	HERBERT ST W GIEBE RD	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	Not found	0	0	0	0
FOUR MILE RUN	001360ND	X	221	OLD DOMINION BV	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	Not found	0	0	0	0
FOUR MILE RUN	001371ND	X	3512	BRADDOCK CT	Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping	Maintenance	Truck 1	1	Not found	0	0	0	0
FOUR MILE RUN	001397SMH	X	2010	Chamber Channel	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Truck 1	1	37	26	15	0	3
FOUR MILE RUN	001398SMH	X	2010	BRADDOCK CT	Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	0	0	0	0	2
FOUR MILE RUN	001399SMH	X	2010	Chimney/Shft Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	42	43	0	0	3
FOUR MILE RUN	001400SMH	X	4448	W BRADDOCK RD	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	42	43	0	0	4
FOUR MILE RUN	001401SMH	X	4501	W BRADDOCK RD	Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	54	55	0	0	4
FOUR MILE RUN	001401SMH	X	4501	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	Truck 1	1	54	55	0	0	4
FOUR MILE RUN	001401SMH	X	4501	Frame Base Seal	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	54	55	0	0	4
FOUR MILE RUN	001401SMH	X	4501	Chimney/Shft Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	54	55	0	0	4
FOUR MILE RUN	001401SMH	X	4501	Chimney/Shft Chamber	Corroded, pitted, spalled	Min: <10% matt loss, etching	Structural	Truck 1	1	54	55	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001402SMH	X	4505	W BRAZZOCK RD	Chamber Chamber Chimney/Shft	Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	I/I evidence	Structural						2
FOUR MILE RUN	001404SMH	X	4505	C GUNSTON RD	Chamber Chamber Chamber Chamber Chamber	Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	Structural	Truck 1	1	50	51	0	0	2
FOUR MILE RUN	001405ND	X	3360	W BRAZZOCK RD	Frame	Corroded, pitted, spalled Cracked / deteriorated	Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	42	43	0	0	5
FOUR MILE RUN	001405SMH	X	4505	C GUNSTON RD	Frame Base Seal	Corroded, pitted, spalled Cracked / deteriorated	Min: <10% mat'l loss, <3/8" (1cm) etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	Not found	0	0	0	0
FOUR MILE RUN	001406ND	X	3360	KENMORE AV	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	51	52	0	0	2
FOUR MILE RUN	001406SMH	X	4550	W BRAZZOCK RD	Frame Base Seal Frame Base Seal	Corroded, pitted, spalled Cracked	Min: <10% mat'l loss, <3/8" (1cm) etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	Structural	Truck 1	1	Not found	0	0	0	0
FOUR MILE RUN	001407SMH	X	4550		Channel	Debris/deposition	Mod: 1/16" to 1/8" (2-3mm) width, chipping, small pieces Maj: 3-5gal bucket	Maintenance			66	61	35	0	3
FOUR MILE RUN	001407SMH	X	4550		Light Highway Rural Streets						54	55	0	0	3
					Frame Base Seal	I/I evidence									
					Frame Base Seal										

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shft		I/ I evidence	Min: <1/4gpm, staining, mineral deposits,									
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		I/ I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
FOUR MILE RUN	001408SMH	X	W BRADDOCK RD		Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/28/2012	Truck 1	1		28	29	0	0	4
FOUR MILE RUN	001409SMH	X	4550	W BRADDOCK RD	Light Highway Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/28/2012	Truck 1	1		57	59	0	0	3
FOUR MILE RUN	001410SMH	X	4550	Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
FOUR MILE RUN	001410SMH	X	4550	Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
FOUR MILE RUN	001410SMH	X	4550	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
FOUR MILE RUN	001410SMH	X	4550	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		I/ I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		I/ I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Chamber		Cracked	Min: weeping	02/08/2012	Truck 1	1		50	51	0	0	6
FOUR MILE RUN	001411SMH	X	4505	W BRADDOCK RD	Easement	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/08/2012	Truck 1	1						
FOUR MILE RUN	001411SMH	X	2509	GADBRY PL	I/ I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
FOUR MILE RUN	001411SMH	X	2509	GADBRY PL	Cracked	Min: weeping	02/08/2012	Truck 1	1		53	54	0	0	4
FOUR MILE RUN	001413SMH	X	2410	GRETTER PL	I/ I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
FOUR MILE RUN	001413SMH	X	2410	Frame	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	001413SMH	X	2410	Frame Base Seal	I/ I evidence	Mod: 1-3gpm, trickle, flow dripping			I/I						
FOUR MILE RUN	001413SMH	X	2410	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/08/2012	Truck 1	1		49	50	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001417SMH	X	4550	Chimney/Shaft Chamber Chamber	Cracked I/I evidence Cracked I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural I/I								
FOUR MILE RUN	001418ND	X	3360	KEINMORE AVE Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaft Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Corroded, pitted, spalled Cracked / deteriorated I/I evidence Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	Structural I/I	Truck 1 1	56	57	0	0	3		
FOUR MILE RUN	001418SMH	X	4550	W BRAZZOCK RD Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaft Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Parking Lot I/I evidence Cracked / deteriorated I/I evidence Corroded, pitted, spalled Cracked I/I evidence Corroded, pitted, spalled Cracked I/I evidence Corroded, pitted, spalled Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, <3/8" (1cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural I/I	Truck 1 1	Not found	0	0	0	0	0	
FOUR MILE RUN	001419SMH	X	4550	W BRAZZOCK RD Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Parking Lot Cracked Corroded, pitted, spalled I/I evidence I/I evidence Corroded, pitted, spalled Cracked I/I evidence Corroded, pitted, spalled Cracked I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural I/I Structural I/I Structural I/I Structural I/I Structural I/I Structural I/I	Truck 1 1	47	48	0	0	4		
FOUR MILE RUN	001420SMH	X	4550	W BRAZZOCK RD Chimney/Shaft Chimney/Shaft Chamber Chamber Chamber	Parking Lot Corroded, pitted, spalled I/I evidence I/I evidence Corroded, pitted, spalled Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural I/I Structural I/I Structural I/I Structural I/I Structural I/I	Truck 1 1	47	48	0	0	3		

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			SEMINARY RD		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/02/2012	Truck 1	1						
			Chamber		Light Highway Rural Streets	Mod 10-25% mat'l loss, etching	02/06/2012	Truck 1	1						
			Chamber		Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			SEMINARY RD		Parking Lot										4
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			Chamber		Yard-Back	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			SEMINARY RD		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/02/2012	Truck 1	1						
			SEMINARY RD		Light Highway Rural Streets	Mod 10-25% mat'l loss, etching	02/06/2012	Truck 1	1						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			SEMINARY RD		Yard-Back	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/02/2012	Truck 1	1						
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			SEMINARY RD		Easement	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1						
			SEMINARY RD		Chamber	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			FOUR MILE RUN	001496SMH X	4555	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1						
			FOUR MILE RUN	001497SMH X	4555	Min: <10% mat'l loss, <3/8" (1cm) etching	02/06/2012	Truck 1	1						
			FOUR MILE RUN	001498SMH X	4316	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			FOUR MILE RUN	001499SMH X	4555	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			LOYOLA AV		Chamber	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1						
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link.	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	001647IN	X	5199 HERITAGE LA	Sidewalk	12/19/2011	12/19/2011	Truck 1	1	Structural	35	35	0	0	2	
FOUR MILE RUN	001648IN	X	5117 HERITAGE LA	Cracked I/I evidence	Mod.: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping	12/19/2011	12/19/2011	Truck 1	1	0	0	0	0	3	
FOUR MILE RUN	001664IN	X	5150 FILMORE AV	Sidewalk Light Highway Rural Streets	Cracked Maj: 1/8" to 1/4" (3-6mm) width, pieces, missing Mod:10-25% matt' loss, etching	12/20/2011	12/20/2011	Truck 1	1	52	52	0	0	2	
FOUR MILE RUN	001744SMH	X	3360 C GUNSTON RD	Corroded, pitted, spalled Easement	Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spelling Mod:10-25% matt' loss, etching	03/13/2012	03/13/2012	Truck 1	1	57	55	5	0	1	
FOUR MILE RUN	001744SMH	X	3360 C GUNSTON RD	Chimney/Shft Chimney/Shft Chamber Chamber Channel	Corroded, pitted, spalled Debris/deposition	Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spelling Mod:10-25% matt' loss, etching Min: <1gal bucket	04/05/2012	04/05/2012	Truck 1	1	49	50	0	0	3
FOUR MILE RUN	001784SMH	X	3625 JEFFERSON DAVIS HY	Light Highway Rural Streets Surface wear	Corroded, pitted, spalled I/I evidence	Cracked Min: smooth spots, 1/16" to 1/8" (2-3mm) matt' loss Min: <10% matt' loss, etching	04/05/2012	04/05/2012	Truck 1	1	67	67	2	0	3
FOUR MILE RUN	001785SMH	X	3700 JEFFERSON DAVIS HY	Light Highway Rural Streets Cracked / deteriorated	Corroded, pitted, spalled I/I evidence	Cracked Min: <10% matt' loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping	04/05/2012	04/05/2012	Truck 1	1	67	67	2	0	3
FOUR MILE RUN	001786SMH	X	3651 JEFFERSON DAVIS HY	Light Highway Rural Streets I/I evidence	Corroded, pitted, spalled Debris/deposition	Cracked Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt' loss, etching ~ 3/8" (1cm) Structural	04/05/2012	04/05/2012	Truck 1	1	62	63	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	001787SMH	X	3750	JEFFERSON DAVIS HY Chamber	Cracked Streets / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/05/2012	Truck 1	1	Structural	99	99	0	0	4	
FOUR MILE RUN	001788SMH	X	3399	Cover Frame Base Seal Frame Base Seal Chimney/Shaf	I/I evidence Corroded, pitted, spalled Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, >3/8" (1cm) etching Min: <10% mat'l loss, etching				Structural						
FOUR MILE RUN	001789SMH	X	3399	Chamber Chamber Chamber Chamber Channel Channel Channel COMMONWEALTH AV Frame Chamber Chamber Chamber Chamber Chamber Chamber Chamber COMMONWEALTH AV	I/I evidence Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	03/05/2012	Truck 1	1	Structural	62	63	0	0	4	
FOUR MILE RUN	001792SMH	X	104	1/2 E REED AV	Offset Cracked Corroded, pitted, spalled Mortar missing	Min: 7/8" to 2" (2.5-5cm) Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching Min: <10% of area				Structural						
FOUR MILE RUN	001793SMH	X			Chamber Chamber Chamber Chamber Chamber Chamber Chamber COMMONWEALTH AV Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaf	I/I evidence Corroded, pitted, spalled I/I evidence Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% mat'l loss, etching Mod: 5-20% of area Mod: 10-25% of area	03/05/2012	Truck 1	1	Structural	72	72	0	0	2
FOUR MILE RUN	001794SMH	X			Chamber Chamber Chamber Channel Channel Channel COMMONWEALTH AV Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaf	Cracked / deteriorated Corroded, pitted, spalled I/I evidence Mortar missing	Mod: 3/8"-3/4" (10-20mm) width, pieces, missing Mod: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% of area			Structural						
FOUR MILE RUN	001795SMH	X			Chamber Chamber Chamber Channel Channel Channel COMMONWEALTH AV Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shaf	I/I evidence Corroded, pitted, spalled I/I evidence Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: <10% of area	03/05/2012	Truck 1	1	Structural					
FOUR MILE RUN	001796SMH	X			Channel Channel	Corroded, pitted, spalled Corroded, pitted, spalled	Min: <10% mat'l loss, etching Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	001797SMH	X			Light Highway Rural Streets	03/23/2012	Truck 1	1								
FOUR MILE RUN	001798SMH	X			Frame Base Seal Chimney/Shaf	Corroded, pitted, spalled I/I evidence Cracked Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching			Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001797SMH	X	326 E RAYMOND AV	Chimney/Shaft	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping.		I/						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chamber	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/						
			Pipe Connection-5	Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width			Structural						
FOUR MILE RUN	001797SMH	X	326 E RAYMOND AV	Light Highway Rural Streets	03/05/2012	03/05/2012	Truck 1	1		60	61	0	0	2
			Frame Base Seal	I/ evidence	Min: <1/4gpm, staining, mineral deposits, spalling			Structural						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Chimney/Shaft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/						
FOUR MILE RUN	001798SMH	X	124 E RAYMOND AV	Sidewalk	02/21/2012	02/21/2012	Truck 1	1		54	55	0	0	3
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shaft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	I/ evidence	Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	001800SMH	X	3700 JEFFERSON DAVIS HY	Light Highway Rural Streets	03/01/2012	03/01/2012	Truck 1	1		72	70	34	0	2
			Frame Base Seal	Corroded, pitted, spalled	Min: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching			Structural						
			Frame Base Seal	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 3/8"-3/4" (10-20mm) width, pieces, missing			Structural						
			Chimney/Shaft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
			Chamber	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/						
			Bench	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping			Maintenance						
			Channel	Debris/deposition	Min: <1 gal bucket			Maintenance						
			Pipe Connection-2	Roots intrusion	Min: <1 gal bucket			Maintenance						
FOUR MILE RUN	001813SMH	X	329 A CLIFFORD AV	Sidewalk	03/05/2012	03/05/2012	Truck 1	1		61	61	0	0	3
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal	I/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001814SMH	X	A ASHBY ST	Frame Base Seal Chamber	Corroded, pitted, spalled Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching	Structural	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I		
FOUR MILE RUN	001814SMH	X	Pipe Connection-2	Frame Base Seal	Cracked / deteriorated Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width	Structural	I/I evidence	Mod: 1/16" to 3/8" (2-10mm) width, small pieces	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chimney/Shft	Light Highway Rural Streets	03/05/2012	Truck 1	1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	56	57
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching - 3/8" (1cm)	Structural	I/I evidence	Mod: 1/16" to 1/8" (2-10mm) width, small pieces	Structural	I/I	I/I	I/I		2
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	I/I evidence	Min: <10% mat'l loss, etching	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Corroded, pitted, spalled	Min: 1/16" to 3/4" (10-20mm) width, pieces, missing	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Cracked	Min: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, pieces, missing	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	335	Frame Base Seal Chamber	Cracked	Min: <10% mat'l loss, etching	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	3525	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	70	71
FOUR MILE RUN	001814SMH	X	3525	JEFFERSON DAVIS HY	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	3600	JEFFERSON DAVIS HY	Light Highway Rural Streets	04/05/2012	Truck 1	1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	70	71
FOUR MILE RUN	001814SMH	X	3600	JEFFERSON DAVIS HY	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	3600	Frame Base Seal Chamber	Parking Lot	04/12/2012	Truck 1	1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	49	50
FOUR MILE RUN	001814SMH	X	3600	Frame Base Seal Chamber	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	3600	Frame Base Seal Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	I/I		
FOUR MILE RUN	001814SMH	X	3600	Frame Base Seal Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	I/I	I/I		

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	001848SMH	X	3951	JEFFERSON DAVIS HY	Parking lot	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1		42	43	0	0	3	
				Chimney/Shft	I/I evidence	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/12/2012								
				Chamber	I/I evidence	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/12/2012								
				Chamber	I/I evidence	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/02/2012	Truck 1	1						
FOUR MILE RUN	001850SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/02/2012	Truck 1	1		49	43	25	0	3
				Frame Base Seal	Cracked	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/01/2012								
				Chamber	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/01/2012								
				Chamber	I/I evidence	Debris/deposition	Mod: 1-3gal bucket	Mod: 1-3gal bucket		Maintenance						
				Bench												
				Channel												
FOUR MILE RUN	001851SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural pieces	03/01/2012	Truck 1	1		62	61	15	0	2
				Frame Base Seal	Cracked / deteriorated	I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces	03/01/2012								
				Frame Base Seal	Cracked	I/I evidence	Mod: 1-3gpm, trickle flow dripping	03/01/2012								
				Frame Base Seal	Cracked	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/01/2012								
				Chimney/Shft	Corroded, pitted, spalled	I/I evidence	Min: <10% mat'l loss, etching	03/01/2012								
				Chimney/Shft	Corroded, pitted, spalled	I/I evidence	Mod: 1-3gpm, trickle flow dripping	03/01/2012								
				Chamber	Corroded, pitted, spalled	I/I evidence	Min: <10% mat'l loss, etching	03/01/2012								
				Chamber	Corroded, pitted, spalled	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/01/2012								
				Chamber	Corroded, pitted, spalled	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/01/2012								
				Channel	Debris/deposition		Mod: 1-3gal bucket			Maintenance						
					Sidewalk											
FOUR MILE RUN	001852SMH	X	3399	COMMONWEALTH AV	I/I evidence	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/05/2012	Truck 1	1		59	60	0	0	3
				Frame Base Seal	Corroded, pitted, spalled	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/05/2012								
				Frame Base Seal	Cracked / deteriorated	I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural pieces	03/05/2012								
				Chamber	Corroded, pitted, spalled	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/01/2012								
				Chamber	Corroded, pitted, spalled	I/I evidence	Mod: 10-25% mat'l loss, etching	03/01/2012								
				Chamber	Corroded, pitted, spalled	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	03/01/2012								
FOUR MILE RUN	001853SMH	X	3700	JEFFERSON DAVIS HY	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/01/2012	Truck 1	1		70	70	15	0	3
				Frame Base Seal	Corroded, pitted, spalled	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/01/2012								
				Frame Base Seal	Corroded, pitted, spalled	I/I evidence	Mod: 25-50% mat'l loss, etching	03/01/2012								
				Chimney/Shft	Corroded, pitted, spalled	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/01/2012								

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct I score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shafft		I/I evidence	Mod: 1/35pm, visible flow/dripping									
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching				Structural					
			Chamber		Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chamber		Debris/deposition	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Channel		Mod: 1-3gal bucket	Mod: 1-3gal bucket				Maintenance					
FOUR MILE RUN	001854SMH	X	3700	JEFFERSON DAVIS HY		04/10/2012	04/10/2012	Truck 1	1	Not found	0	0	0	0	:0
FOUR MILE RUN	001855SMH	X	3750	JEFFERSON DAVIS HY	Parking Lot	07/20/2012	07/20/2012	Truck 1	1		56	57	0	0	:4
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chimney/Shafft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chimney/Shafft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chimney/Shafft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chamber		I/I evidence	Min: <10% mat'l loss, etching				Structural					
			Chamber		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			JEFFERSON DAVIS HY		Parking Lot	03/02/2012	03/02/2012	Truck 1	1		40	40	0	0	:4
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			HUME AV		Light Highway Rural Streets	03/05/2012	03/05/2012	Truck 1	1		59	60	0	0	:4
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chimney/Shafft		I/I evidence	Min: <10% mat'l loss, etching				Structural					
			Chimney/Shafft		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chimney/Shafft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chamber		I/I evidence	Min: <10% mat'l loss, etching				Structural					
			Chamber		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Chamber		Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural					
			HUME AV		Sidewalk	03/05/2012	03/05/2012	Truck 1	1		85	85	0	0	:4
			Frame Base Seal		Corroded, pitted, spalled	Extreme: >80% mat'l loss, >3/4" (2cm) etching				Structural					
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
			Frame Base Seal		Cracked / deteriorated	Extreme: >3/4" (20mm) width				Structural					
			Grade Ring		Cracked	Mat: 1/4" to 3/8" (6-10mm) width, pieces, missing				Structural					
			Grade Ring		Corroded, pitted, spalled	Mat: 25-50% mat'l loss, etching				Structural					
			Grade Ring		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I					
FOUR MILE RUN	001869SMH	X	328												

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chamber	Bends displaced or missing	Min: <25% of area			Structural						
			Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Cracked	Mat: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural						
			Chamber	Motor missing	Min: <10% of area			Structural						
			Channel	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Pipe Connection-1	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
			Pipe Connection-3	Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width			Structural						
			Pipe Connection-4	Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width			Structural						
FOUR MILE RUN	001870SMH	X	A CLIFFORD AV	Light Highway Rural Streets	03/05/2012	03/06/2012	Truck 1	1		52	53	0	0	4
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
FOUR MILE RUN	001877SMH	X	LAVERNIE AV	Light Highway Rural Streets	03/05/2012	03/06/2012	Truck 1	1		56	57	0	0	4
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Sidewalk	03/06/2012	03/06/2012	Truck 1	1							
FOUR MILE RUN	001917SMH	X	MT VERNON AV	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Frame Base Seal	Cracked / deteriorated	Mat: 3/8"-3/4" (10-20mm) width, pieces, missing			Structural						
			Frame Base Seal	Corroded, pitted, spalled	Mat: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching			Structural						
			Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	001917SMH	X	2600							71	72	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001950SMH	X	3005	RUSSELL RD	Light Highway/Rural Streets	03/19/2012	03/19/2012	Truck 1	1	Structural	71	72	0	0	3
			Chamber		I/I evidence										
			Chamber		Mortar missing	Min: <1% of area									
			Frame Base Seal		Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces									
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss; <3/8" (1cm) etching									
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
			Chimney/Shft		Mortar missing	Min: <10% of area									
			Chimney/Shft		Bricks displaced or missing	Min: <5% of area									
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
			Chamber		Mortar missing	Min: <10% of area									
			Chamber		Bricks displaced or missing	Min: <5% of area									
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
			Chamber		I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping									
			RUSSELL RD		Light Highway/Rural Streets	03/19/2012	03/19/2012	Truck 1	1	Structural	67	68	0	0	3
			Frame Base Seal		I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces									
			Frame Base Seal		Corroded, pitted, spalled	Min: <14gpm, staining, mineral deposits, flow weeping									
			Chamber		I/I evidence	Min: <5% of area									
			Chamber		Bricks displaced or missing	Mod: 1/16" to 1/8" (2-3mm) width, small pieces									
			Chamber		Cracked	Mod: 10-25% mat'l loss, etching									
			Chamber		Mortar missing	Mod: 10-25% of area									
			GROVES AV		Light Highway/Rural Streets	03/16/2012	03/16/2012	Truck 1	1	Structural	56	57	0	0	3
			Frame Base Seal		I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching									
			Chimney/Shft		I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping									
			Chimney/Shft		Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping									
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
			Chamber		I/I evidence	Min: <10% mat'l loss, etching									
			MT VERNON AV		Sidewalk	02/27/2012	02/27/2012	Truck 1	1	Structural	42	43	0	0	3
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling									
			Chimney/Shft		I/I evidence	Min: <14gpm, staining, mineral deposits, flow weeping									
FOUR MILE RUN	001957SMH	X	2700												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001958SMH	X	2802	MT VERNON AV	Chamber	Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping spalling	Truck 1	1	I/I	97	97	0	0	2
FOUR MILE RUN	001958SMH	X	2802	Cover	Corroded, pitted, spalled Cracked	Extreme: >3/8" (10mm) mat'l loss Maj: 1/4" to 3/8" (6-10mm) width, pieces, missing	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001958SMH	X	2802	Grade Ring	Corroded, pitted, spalled	Maj: 25-50% mat'l loss, etching	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001958SMH	X	2802	Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/I						
FOUR MILE RUN	001958SMH	X	2802	Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001958SMH	X	2802	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	2700	MT VERNON AV	Chamber	Corroded, pitted, spalled I/I evidence	Min: etching spotty, 1/16" to 1/8" (2-3mm) mat'l loss Mod: 1-3gpm, trickle, flow dripping	Truck 1	1	Structural	Structural				
FOUR MILE RUN	001960SMH	X	2700	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	2700	Chamber	Montar missing	Min: <10% of area	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	2700	MT VERNON AV	Sidewalk	I/I evidence	Min: etching spotty, 1/16" to 1/8" (2-3mm) mat'l loss	Truck 1	1	Structural	Structural				
FOUR MILE RUN	001960SMH	X	2700	Cover	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	2700	Frame Base Seal	Cracked / deteriorated	Mod: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) width, pieces, missing	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	2700	Frame Base Seal	I/I evidence	Mod: 3/8"-3/4" (10-20mm) width, pieces, etching	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	2700	Frame Base Seal	Corroded, pitted, spalled	Extreme: >1/4" (6mm) width, pieces, missing	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	2700	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	2700	Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	2700	E DEL RAY AV	Light Highway Rural Streets Offset	I/I evidence	Min: 7/8" to 2" (2.5-5cm) width, small pieces	Truck 1	1	Structural	Structural				
FOUR MILE RUN	001960SMH	X	1	Frame	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) width, small pieces	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	1	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Frame Base Seal	Montar missing	Mod: 10-25% of area	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	1	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Chimney/Shft	Bricks displaced or missing	Mod: 10-25% of area	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	1	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	1	Chamber	Montar missing	Mod: 10-25% of area	Truck 1	1	I/I						
FOUR MILE RUN	001960SMH	X	1	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	Structural	Structural					
FOUR MILE RUN	001960SMH	X	1	Chamber	Bricks displaced or missing	Min: <5% of area	Truck 1	1	I/I						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	001984SMH	X	2598	DE WITT AV Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Light Highway Rural Streets Corroded, pitted, spalled Cracked / deteriorated II evidence Cracked Corroded, pitted, spalled II evidence Cracked II evidence Corroded, pitted, spalled Cracked	Mod: 1/3gal/tucket Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) width, chipping, spalling Min: 1/16" to 1/8" (2-3mm) width, chipping, structural Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% mat'l loss, etching	Truck 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	Maintenance		65	66	0	0	4
FOUR MILE RUN	001998SMH	X	2400	MT VERNON AV Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Pipe Connection-3	Light Highway Rural Streets Cracked / deteriorated Corroded, pitted, spalled II evidence Cracked II evidence Corroded, pitted, spalled II evidence	Mod: 1/3gal/tucket Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	Truck 1 1 1 1 1 1 1 1	Maintenance		58	59	0	0	4
FOUR MILE RUN	002001SMH	X	2406	MT VERNON AV Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft	Light Highway Rural Streets Corroded, pitted, spalled Cracked / deteriorated II evidence Cracked II evidence Corroded, pitted, spalled Cracked	Mod: 1/3gal/tucket Min: <10% mat'l loss, >3/8" (1cm) etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1 1 1 1 1 1 1 1	Maintenance		54	55	0	0	4
FOUR MILE RUN	002002SMH	X	2600	MT VERNON AV Frame Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft	Light Highway Rural Streets Corroded, pitted, spalled Cracked / deteriorated II evidence Cracked Corroded, pitted, spalled Cracked	Mod: 1/3gal/tucket Min: etching spotty, 1/16" to 1/8" (2-3mm) depth Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, >3/8" (1cm) etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching	Truck 1 1 1 1 1 1 1 1	Maintenance		57	58	0	0	4
FOUR MILE RUN	002008SMH	X	2313	COMMONWEALTH AV Frame Frame	Light Highway Rural Streets Corroded, pitted, spalled Offset	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: etching spotty, 1/16" to 1/8" (2-3mm) depth Mod: 2" to 3" (5-7.5cm)	Truck 1 1 1	Maintenance		64	65	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH-Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002009SMH	X	1	E DEL RAY AV	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
					Chimney/Shft	Mortar missing	Min: <10% mat'l loss, etching			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% of area			Structural					
					Chamber	Mortar missing	Min: <10% of area			Structural					
					Pipe Connection-1	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
						Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width			Structural					
							03/16/2012	Truck 1	1						
FOUR MILE RUN	002009SMH	X	1	E DEL RAY AV	Light Highway Rural Streets	Cracked / deteriorated	Min: <1/16" (2mm) width, light			Structural					
					Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm)			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Chimney/Shft	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Mortar missing	Min: <10% of area			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	Mortar missing	Min: <10% of area			Structural					
FOUR MILE RUN	002026SMH	X	2	E OXFORD AV	Light Highway Rural Streets	I/I evidence	Min: <1/16" to 1/8" (2-3mm)		I/I	Structural					
					Frame	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Chimney/Shft	Mortar missing	Min: <10% of area			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural					
					Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural					
					MT VERNON AV	Light Highway Rural Streets	Cracked / broken / deteriorated	Min: <1/16" (2mm) width	I/I	Structural					
FOUR MILE RUN	002027SMH	X	2600		Frame	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping		I/I	Structural					
					Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural					
					Chimney/Shft										

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shft		I/I evidence										
			Chimney/Shft		Mortar missing					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Chamber		Mortar missing					Min: <10% of area					
			Chamber		Corroded, pitted, spalled					Min: <10% matt loss, etching					
			Chamber		I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping					
FOUR MILE RUN	002028SMH	X	MT VERNON AV	2800	Grade Ring	Yard-Front	02/27/2012	Truck 1	Mod.	10-25% matt loss, etching					
			Grade Ring		Corroded, pitted, spalled					Mod: 1/8" to 1/4" (3-6mm) width, small pieces					
			Grade Ring		I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Chimney/Shft		I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Chimney/Shft		Cracked					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					
FOUR MILE RUN	002034SMH	X	MT VERNON AV	2800	Cover	Yard-Side	02/27/2012	Truck 1	Mod.	advanced etching, 3/16" to 3/8" (5- 10mm) matt loss					
			Cover		Corroded, pitted, spalled					Min: smooth spots, 1/16" to 1/8" (2-3mm) matt loss					
			Cover		Parking Lot	02/27/2012	Truck 1	Mod.	10-25% matt loss, etching						
			Cover		I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Cover		Corroded, pitted, spalled					Min: <10% matt loss, etching					
FOUR MILE RUN	002035SMH	X	MT VERNON AV	2808	CHAMBER	Light Highway Rural Streets	02/22/2012	Truck 1	Mod.	1/16" to 1/8" (2-3mm) width, chipping, spalling					
			CHAMBER		Corroded, pitted, spalled					Min: etching spotty, 1/16" to 1/8" (2-3mm) depth					
			CHAMBER		Offset					Min: 7/8" to 2" (2-5.5cm)					
			KENNEDY ST		Frame	Cracked / deteriorated				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					
			Frame		I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Frame		Corroded, pitted, spalled					Min: <10% matt loss, >3/8" (1cm) etching					
			Frame Base Seal		Corroded, pitted, spalled					Min: <10% matt loss, etching					
			Frame Base Seal		Cracked					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					
			Frame Base Seal		I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Chimney/Shft		Corroded, pitted, spalled					Min: <10% matt loss, >3/8" (1cm) etching					
			Chimney/Shft		Cracked					Min: <10% matt loss, etching					
			Chimney/Shft		I/I evidence					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					
			Chamber		Corroded, pitted, spalled					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Chamber		Cracked					Min: <10% matt loss, etching					
			KENNEDY ST		Light Highway Rural Streets	02/22/2012	Truck 1	Mod.	1/16" to 1/8" (2-3mm) width, chipping, spalling						
			Frame		Corroded, pitted, spalled					Min: etching spotty, 1/16" to 1/8" (2-3mm) depth					
			Frame Base Seal		Cracked / deteriorated					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					
			Frame Base Seal		I/I evidence					Min: ~1/16" to 1/8" (2-3mm) dia., fingers, small frags					
			Frame Base Seal		Roots Intrusion					Min: <1/4gpm, staining, mineral deposits, flow weeping					
			Chimney/Shft		Corroded, pitted, spalled					Min: <10% matt loss, etching					
			Chimney/Shft		Cracked					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					
FOUR MILE RUN	002041SMH	X		81			02/22/2012	Truck 1	Mod.	1/16" to 1/8" (2-3mm) width, chipping, spalling					
										Min: etching spotty, 1/16" to 1/8" (2-3mm) depth					
										Min: 1/16" to 1/8" (2-3mm) dia., fingers, small frags					
										Min: <1/4gpm, staining, mineral deposits, flow weeping					
										Min: <10% matt loss, etching					
										Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling					

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002047SMH	X	2701 DE WITT AV	Frame Base Seal Chimney/Shelf Chimney/Shelf Chimney/Shelf Pipe Connection-1	03/12/2012	Light Highway Rural Streets	Cracked / pitted, spalled Corroded, pitted, spalled I/I evidence Pipe cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, mineral deposits, flow weeping	I/I	54	55	0	0	3
FOUR MILE RUN	002048SMH	X	124 RANDOLPH AV	Frame Base Seal Chimney/Shelf Chamber Chamber Chamber	03/12/2012	Light Highway Rural Streets	Cracked / deteriorated Corroded, pitted, spalled Cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, mineral deposits, flow weeping	Structural	54	55	0	0	3
FOUR MILE RUN	002048SMH	X	124 RANDOLPH AV	Frame Base Seal Chimney/Shelf Chimney/Shelf Chamber Chamber Chamber	03/12/2012	Light Highway Rural Streets	Cracked / deteriorated Corroded, pitted, spalled Cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, mineral deposits, flow weeping	Structural	54	55	0	0	3
FOUR MILE RUN	002049SMH	X	201 RANDOLPH AV	Frame Base Seal Frame Base Seal Frame Base Seal Frame Base Seal Frame Base Seal	03/12/2012	Light Highway Rural Streets	Cracked / deteriorated Corroded, pitted, spalled Cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, mineral deposits, flow weeping	Structural	61	62	0	0	5
FOUR MILE RUN	002050SMH	X	124 E RAYMOND AV	Frame Base Seal Frame Base Seal Frame Base Seal Chamber	03/12/2012	Light Highway Rural Streets	Cracked / deteriorated Corroded, pitted, spalled I/I evidence Pipe cracked	Min: <1/16" to 1/8" (2-3mm) width, chipping, mineral deposits, flow weeping	Structural	58	59	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002051SMH	X	110	HUME AV	Chamber	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	Structural	I/I	22	22	0	0	2
FOUR MILE RUN	002060SMH	X	2836	MT VERNON AV	Cover	I/I evidence	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) mat'l loss Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	74	75	0	0	3
FOUR MILE RUN	002061SMH	X	2832	MT VERNON AV	Frame Base Seal	I/I evidence	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	74	75	0	0	2
FOUR MILE RUN	002062SMH	X	3360	B GUNSTON RD	Frame Base Seal	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I	74	75	0	0	2
FOUR MILE RUN	002063SMH	X	3032	Grade Ring	Chimney/Shelf	I/I evidence	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	40	40	0	0	2
FOUR MILE RUN	002063SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	50	51	0	0	3
FOUR MILE RUN	002063SMH	X	3360	B GUNSTON RD	Chimney/Shelf	I/I evidence	Cracked / deteriorated	Min: <10% mat'l loss, etching	Structural	I/I	40	40	0	0	2
FOUR MILE RUN	002063SMH	X	3360	B GUNSTON RD	Chamber	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	I/I	40	40	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	#Connecting Pipes
FOUR MILE RUN	002064SMH	X	3360	Chamber B GUNSTON RD	Cracked / I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling			I/I		78	79	0	0	2
FOUR MILE RUN	002065SMH	X	3910	Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chamber Chamber	Light Highway Rural I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, Maj: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching	Truck 1	1							
FOUR MILE RUN	002065SMH	X	3910	OLD DOMINION BV	Cracked, pitted, spalled Corroded, pitted, Cracked / deteriorated Corroded, pitted, spalled Corroded, pitted, spalled Cracked / I/I evidence	Corroded, pitted, spalled / Maj: 3/8"-3/4" (10-20mm) width, pieces, missing Corroded, pitted, spalled / Mod: 10-25% mat'l loss, etching Extreme: >1/4" (6mm) width, pieces, missing Min: <10% mat'l loss, etching									
FOUR MILE RUN	002065SMH	X	3910	Frame Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chamber	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: generally etching, 1/8" to 3/16" (3-5mm) depth Min: <10% mat'l loss, >3/8" (1cm) etching	Truck 1	1							
FOUR MILE RUN	002065SMH	X	3910	OLD DOMINION BV	Cracked / I/I evidence	Corroded, pitted, spalled / Cracked / deteriorated Corroded, pitted, spalled / Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling									
FOUR MILE RUN	002065SMH	X	3910	Chamber Chamber Chamber	Cracked / I/I evidence	Corroded, pitted, spalled / Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% area	Truck 1	1							
FOUR MILE RUN	002068SMH	X	3899	COURTLAND CL	Light Highway Rural Streets	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Truck 1	1							
FOUR MILE RUN	002068SMH	X	3899	Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Corroded, pitted, spalled / I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching									
FOUR MILE RUN	002068SMH	X	3899	COURTLAND CL	Light Highway Rural Streets	Min: 1/16"-3/8" (2-10mm) width, small pieces Mod: 25-50% mat'l loss, 3/8"-3/4" (1-2cm) etching	Truck 1	1							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II Score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			If Frame Base Seal	I/I evidence	Mod: <1/3gpm, trickle flow dripping										
			Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching										
			Chimney/Shft	I/I evidence	Mod: 1-3gpm, trickle, flow dripping										
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling										
			Chamber	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching										
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling										
			Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping										
			COURTLAND CL	Yard-Side	02/21/2012 02/21/2012 Truck 1	1									
FOUR MILE RUN	002071SMH	X	3899	Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% matl los, etching										
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling										
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Chamber	Corroded, pitted, spalled	Min: <10% matl los, etching										
			Channel	Debris/Debris/Position	Min: <1gal bucket										
			COURTLAND CL	Light Highway/Rural Streets	02/21/2012 02/21/2012 Truck 1	1									
			Cover	Yes, >50%											
			Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching										
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling										
			Chamber	Corroded, pitted, spalled	Min: <10% matl loss, etching										
			COURTLAND CL	Yard-Side	02/21/2012 02/21/2012 Truck 1	1									
			Frame	Offset	Mod: 2" to 3" (5-7.5cm)										
			Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
FOUR MILE RUN	002072SMH	X	3899	FOUR MILE RD	04/06/2012 04/06/2012 Truck 1	1									
			FOUR MILE RD	FOUR MILE RD	04/06/2012 04/06/2012 Truck 1	1									
			FOUR MILE RD	Sidewalk	02/20/2012 02/20/2012 Truck 1	1									
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% matl los, <3/8" (1cm) etching										
			Frame Base Seal	Cracked	Mod: 1/16"-3/8" (2-10mm) width, small pieces										
			Chimney/Shft	I/I evidence	Min: <10% matl loss, etching										
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
FOUR MILE RUN	002074SMH	X	517												
			FOUR MILE RUN	002075SMH	X	511									
			FOUR MILE RUN	002076SMH	X	511									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002077SMH	X	3999	COURTLAND CL	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural						
			Chamber	Corroded, pitted, spalled, I/I evidence	Mod: <10% mat'l loss, etching										
			Chamber	Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 1-3gal bucket	02/21/2012	02/21/2012	Truck 1	I/I					
			Channel	Light Highway/Rural Streets	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) Structural				Maintenance						
FOUR MILE RUN	002077SMH	X	3999	Frame Base Seal	Cracked, pitted, spalled, I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 1/16"-3/8" (2-10mm) width, small pieces	I/I	Structural						
			Frame Base Seal	Cracked / deteriorated I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 1/16"-3/8" (2-10mm) width, small pieces	I/I	Structural							
			Frame Base Seal	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural							
			Chimney/Shelf	Corroded, pitted, spalled, I/I evidence	Min: <10% mat'l loss, etching	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural							
			Chimney/Shelf	Cracked	Min: <10% mat'l loss, etching	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural							
			Chimney/Shelf	Light Highway/Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural							
			Chamber	Corroded, pitted, spalled, I/I evidence	Min: <10% mat'l loss, etching	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural							
			Chamber	Cracked	Min: <10% mat'l loss, etching	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural							
FOUR MILE RUN	002078SMH	X	3903	MT VERNON AV	Frame Base Seal	Corroded, pitted, spalled depth	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/30/2012	03/30/2012	Truck 1	1	0	0	0	3
FOUR MILE RUN	002079SMH	X	511	FOUR MILE RD	Frame Base Seal	Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/20/2012	02/20/2012	Truck 1	1	0	0	0	3
			Frame Base Seal	Corroded, pitted, spalled, I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching	Mod: 10-25% of area	Structural								
			Frame Base Seal	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Roots intrusion	Min: <1/16" to 1/8" (2-3mm) dia., fingers, small mass	Maintenance							
			Chimney/Shelf	Mortar missing	Mod: 5-20% of area	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Chimney/Shelf	Roots intrusion	Min: 10% of area	Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Chimney/Shelf	I/I evidence	Min: -5% of area	Bricks displaced or missing I/I evidence	Mod: 1-3gal bucket	Maintenance							
			Chamber	Bricks displaced or missing I/I evidence	Mod: 10-25% of area	Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Chamber	Debris/deposition	Min: 5-20% of area	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Channel	I/I evidence	Min: 10% of area	Mortar missing	Mod: 1-3gal bucket	Maintenance							
			Pipe Connection-3	Slip/Joint	Min: -5% of area	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			FOUR MILE RD	Cover	Mod: 10-25% of area	Missing Bolts or Broken Bolts	Min: <10% mat'l loss, etching	I/I	Structural						
			Chimney/Shelf	I/I evidence	Mod: 25-50% of area	Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Chimney/Shelf	Bricks displaced or missing I/I evidence	Mod: 5-20% of area	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Chamber	Cover	Min: <10% mat'l loss, etching	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
			Chamber												
			Chamber												
FOUR MILE RUN	002080SMH	X	511												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002061SMH	X	3917	ELBERT AV	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, spalling	Truck 1	1	Structural	49	50	0	0	2
FOUR MILE RUN	002062SMH	X	3917	Frame Base Seal Chimney/Shft Chamber	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	04/06/2012	04/06/2012	Truck 1	1	
FOUR MILE RUN	002063SMH	X	3917	Frame Base Seal Chimney/Shft Chamber	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Structural	I/I evidence	Min: <10% mat'l loss, etching	04/06/2012	04/06/2012	Truck 1	1	
FOUR MILE RUN	002064SMH	X	3809	A MT VERNON AV	Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Structural	I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1	
FOUR MILE RUN	002065SMH	X	3809	A MT VERNON AV	Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Structural	I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1	
FOUR MILE RUN	002066SMH	X	3700	COMMONWEALTH AV	Frame	Offset	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Structural	I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1	
FOUR MILE RUN	002067SMH	X		Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural	I/I evidence	Min: <10% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1		
FOUR MILE RUN	002068SMH	X		Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Structural	I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1		
FOUR MILE RUN	002069SMH	X		Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural	I/I evidence	Min: <10% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1		
FOUR MILE RUN	002070SMH	X		Frame Base Seal Chimney/Shft	Cracked	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural	I/I evidence	Min: <10% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1		
FOUR MILE RUN	002071SMH	X		Frame Base Seal Chimney/Shft	Cracked	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural	I/I evidence	Min: <10% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1		
FOUR MILE RUN	002072SMH	X		Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural	I/I evidence	Min: <10% mat'l loss, etching ~ 3/8" (1cm) Structural	02/20/2012	02/20/2012	Truck 1	1		

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002086SMH	X	3911	Chamber	I/ I evidence	Corroded, pitted, spalled Sidewalk	Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: <10% mat'l loss, etching	Structural	I/I	56	57	0	0	3
FOUR MILE RUN	002086SMH	X	3911	CHIMNEY/SHAFT	I/ I evidence	Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat'l loss, etching	Structural	I/I	02/20/2012	Truck 1	1		
FOUR MILE RUN	002088SMH	X	3700	CHIMNEY/SHAFT	I/ I evidence	Corroded, pitted, spalled Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces. Min: <10% mat'l loss, etching	Structural	I/I	02/28/2012	Truck 1	1		
FOUR MILE RUN	002088SMH	X	3700	CHAMBER	I/ I evidence	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	02/28/2012	Truck 1	1		
FOUR MILE RUN	002094SMH	X	4118	COMM/WEALTH AV	I/ I evidence	Mortar missing	Min: <10% of area	Structural	I/I	02/20/2012	Truck 1	1		
FOUR MILE RUN	002092SMH	X	4118	CHAMBER	I/ I evidence	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	02/20/2012	Truck 1	1		
FOUR MILE RUN	002094SMH	X	3913	OLD DOMINION BY	I/ I evidence	Corroded, pitted, spalled Sidewalk	Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	02/21/2012	Truck 1	1		
FOUR MILE RUN	002094SMH	X	3913	MT VERNON AV	I/ I evidence	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	02/21/2012	Truck 1	1		
FOUR MILE RUN	002094SMH	X	3899	OLD DOMINION BY	I/ I evidence	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	02/21/2012	Truck 1	1		
FOUR MILE RUN	002094SMH	X	3899	CHAMBER	I/ I evidence	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	I/I	02/21/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	Frame Base Seal	I/ I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	04/02/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	Frame Base Seal	I/ I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I	04/02/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	CHAMBER	I/ I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural	I/I	04/02/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	FOUR MILE RD	I/ I evidence	Parking Lot	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I	04/02/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	Frame Base Seal	I/ I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I	04/02/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	Frame Base Seal	I/ I evidence	Cracked / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	04/02/2012	Truck 1	1		
FOUR MILE RUN	002096SMH	X	511	Frame Base Seal	I/ I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	I/I	04/02/2012	Truck 1	1		

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II Score	MH Maint Score	MH Pot II Field Flow (qpm)	# Connecting Pipes
			Grade Ring	Cracked	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, Mod: 10-25% matl loss, etching			Structural						0
			Grade Ring	I/ evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,			I/I						0
			Channel	Debris/deposition	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, Mod: ~3gal bucket			Maintenance						2
FOUR MILE RUN	.002097SMH	X	3899	COURTLAND CL	Light Highway/Rural Streets	04/06/2012	04/06/2012	Truck 1	1	Not Opened	0	0	0	0	0
FOUR MILE RUN	002098SMH	X	3899	Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						2
			Frame Base Seal	I/ evidence	Corroded / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Bass Seal		Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching			Structural						
			Frame Bass Seal	I/ evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Chamber	Cracked	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chamber	I/ evidence	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
			Chamber		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,			I/I						
FOUR MILE RUN	002100SMH	X	3899	COURTLAND CL	Light Highway/Rural Streets	04/06/2012	04/06/2012	Truck 1	1	Not Opened	0	0	0	0	0
FOUR MILE RUN	002101SMH	X	600	W GLEBE RD	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						4
			Frame	I/ evidence	Corroded / deteriorated	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching			Structural						
			Frame Bass Seal	I/ evidence	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft	Cracked	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
			Chimney/Shft	I/ evidence	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
MONTECILLO BV			Frame	Cracked	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) depth			Structural						
			Frame Base Seal	I/ evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Frame Base Seal		Corroded / deteriorated	Min: <10% matl loss, etching			Structural						
			Frame Bass Seal	I/ evidence	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft	Cracked	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
			Chimney/Shft	I/ evidence	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
FOUR MILE RUN	002102SMH	X	308	MONTECILLO BV	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,			I/I						5
			Frame	I/ evidence	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
			Frame Base Seal		Corroded / deteriorated	Min: <10% matl loss, etching			Structural						
			Frame Bass Seal	I/ evidence	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	Cracked	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural						
			Chamber	I/ evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Pipe Connection-4	Pipe cracked	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (3-5mm) width			Structural						
MONTECILLO BV			Frame	Cracked	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal	I/ evidence	Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching			I/I						
FOUR MILE RUN	002107SMH	X	404	MONTECILLO BV	Light Highway/Rural Streets	03/19/2012	03/19/2012	Truck 1	1	Not Opened	0	0	0	0	3
			Frame Base Seal	I/ evidence	Corroded / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching			Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame Base Seal Chimney/Shaff	I/ I evidence	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						
			Chimney/Shaff	II/ I evidence	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						
			Cracked	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Corroded, pitted, spalled	I/ I evidence	Min: <10% matt' los, etching			Structural						
			Chamber Chamber	Cracked	Min: <1/16gpm, staining, mineral deposits, flow weeping			Structural						
			Corroded, pitted, spalled	I/ I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Light Highway Rural Streets Offset	02/15/2012 02/15/2012	Truck 1	1								4
FOUR MILE RUN	002110SMH	X	2800 OLD DOMINION BV	Frame	Min: 7/8" to 2" (2-5.5cm)			Structural						
			Frame Base Seal	I/ I evidence	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						
			Frame Base Seal	Corroded, pitted, Cracked / deteriorated	Min: <10% matt' los, <3/8" (1cm) etching			Structural						
			Frame Base Seal Chimney/Shaff	I/ I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shaff Chimney/Shaff	Cracked	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						
			Corroded, pitted, spalled	I/ I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width				Structural						
FOUR MILE RUN	002111SMH	X	2800 OLD DOMINION BV	Light Highway Rural Streets	02/15/2012 02/15/2012	Truck 1	1							
			Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
			Frame	Cracked / broken / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
			Frame Base Seal	I/ I evidence	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						
			Frame Base Seal Chimney/Shaff	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shaff Chimney/Shaff	Corroded, pitted, spalled	Min: <10% matt' los, <3/8" (1cm) etching			Structural						
			Corroded, pitted, spalled	I/ I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Cracked	Min: <10% matt' los, etching				Structural						
FOUR MILE RUN	002112SMH	X	505 MONTECILLO BV	Light Highway Rural Streets	02/15/2012 02/15/2012	Truck 1	1							
			Frame Base Seal	I/ I evidence	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						
			Frame Base Seal Chimney/Shaff	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chamber	Corroded, pitted, spalled	Mod: 10-25% matt' los, etching			Structural						
			Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Pipe Connection-2	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
FOUR MILE RUN	002113SMH	X	504 MONTECILLO BV	Light Highway Rural Streets	02/15/2012 02/15/2012	Truck 1	1							3
			Grade Riffg	I/ I evidence	Min: <1/16gpm, staining, mineral deposits, flow weeping			I/ I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002115SMH	X	511	Grade Ring	Corroded, pitted, spalled, cracked	Extreme >50% mat'l loss, >3/4" (2cm) etching			Structural						
	Chamber	I/I evidence			>2/8" (10mm) width, pieces, missing				Structural						
	Chamber	Cracked			Extr. min. <1/4gpm, staining, mineral deposits, flow weeping	Min: 1/16" to 1/8" (2-3mm) width, chipping.			I/I						
MONTECELLO BV				Frame Base Seal	Light Highway/Rural Streets	02/15/2012	'Truck 1	1	Structural						
	Chimney/Shft	Cracked / deteriorated			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
	Chimney/Shft	I/I evidence			Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
OLD DOMINION BV				Frame	Light Highway/Rural Streets	02/15/2012	'Truck 1	1	Structural						
	Frame Base Seal	Corroded, pitted, spalled			Min: etching spoty, 1/16" to 1/8" (2-3mm) depth	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
	Frame Base Seal	Corroded, pitted, spalled			Min: <10% mat'l loss, <3/8" (1cm) etching	Mod: <10% mat'l loss, etching			Structural						
	Chimney/Shft	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber	Cracked / deteriorated			Mod: 1/16"-3/8" (2-10mm) width, small pieces	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
	Chamber	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Min: <10% mat'l loss, etching			I/I						
A RICHMOND LA				Frame	Light Highway/Rural Streets	02/15/2012	'Truck 1	1	Structural						
	Frame Base Seal	Corroded, pitted, spalled			Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
	Chimney/Shft	I/I evidence			Mod: generally etching, 1/8" to 3/16" (3-5mm) depth	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
	Chamber	Corroded, pitted, spalled			Mod: 1/16"-25% mat'l loss, etching ~3/8" (1cm) Structural	Mod: 1/16"-25% mat'l loss, etching ~3/8" (1cm) Structural			I/I						
	Chamber	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
FOUR MILE RUN	002128SMH	X	2804	A RICHMOND LA	Pipe Connection-1	02/15/2012	'Truck 1	1	Structural						
	Frame	Corroded, pitted, spalled			Min: <10% mat'l loss, etching	Min: <10% mat'l loss, etching			I/I						
	Frame Base Seal	I/I evidence			Mod: 1/16"-3/8" (2-10mm) width, small pieces	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
	Frame Base Seal	Corroded, pitted, spalled			Mod: 1/16"-25% mat'l loss, etching ~3/8" (1cm) Structural	Mod: 1/16"-25% mat'l loss, etching ~3/8" (1cm) Structural			I/I						
	Chimney/Shft	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chimney/Shft	Corroded, pitted, spalled			Mod: 1/16"-3/8" (2-10mm) width, small pieces	Mod: 1/16"-3/8" (2-10mm) width, small pieces			I/I						
	Pipe Connection-1	Cracked			Mod: 1/16"-3/8" (2-10mm) width, small pieces	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
A RICHMOND LA				Easelment	02/15/2012	'Truck 1	1	Structural							
	Grade Ring	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Grade Ring	I/I evidence			Min: <10% mat'l loss, etching	Min: <10% mat'l loss, etching			I/I						
	Chimney/Shft	Cracked			Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
FOUR MILE RUN	002130SMH	X	2908	Grade Ring	02/15/2012	'Truck 1	1	Structural							
	Grade Ring	I/I evidence			Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chimney/Shft	Cracked			Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping			Structural						
A RICHMOND LA				Easelment	02/15/2012	'Truck 1	1	Structural							
OLD DOMINION BV				Light Highway/Rural Streets	02/15/2012	'Truck 1	1	Structural							
FOUR MILE RUN	002131SMH	X	2908							0	0	0	0	0	2
FOUR MILE RUN	002132SMH	X	2804							51	52	0	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
				Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural							
				Frame	Cracked / broken / deteriorated	Min: <1/16" (2mm) width			Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Frame Base Seal	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
				Chimney/Shft	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
FOUR MILE RUN	002135SMH	X	3102	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	Truck 1	1			52	53	0	0	0	2
				Frame	Cracked / broken / deteriorated	Min: <1/16" (2mm) width			Structural							
				Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chimney/Shft	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chamber	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
FOUR MILE RUN	002144SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	1			65	66	0	0	0	4
				Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural							
				Frame Base Seal	Cracked / deteriorated	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
				Frame Base Seal	II/ evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chimney/Shft	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
				Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, Mod: 10-25% mat'l loss, etching			Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chamber	II/ evidence	Mod: 1-3gpm, trickle, flow dripping			II/							
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
				Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
FOUR MILE RUN	002146SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	Truck 1	1			79	80	0	0	0	2
				Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural							
				Frame Base Seal	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
				Grade Ring	II/ evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			II/							
				Grade Ring	Offset	Mod: 1/8" to 1/4" (3-6mm) width, small pieces			Structural							
				Grade Ring	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Grade Ring	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chimney/Shft	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
				Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							

Basin	MH	SCREAM InsP	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shaff	I/I evidence	Mod. 1-2gpm, trickle flow dripping				I/I						
FOUR MILE RUN	002149SMH	X	3700	JEFFERSON DAVIS HY	Chamber	Corroded, pitted, spalled	Mod: 1-3gpm, trickle flow dripping		I/I	Min: <10% mat'l loss, etching	Structural				
FOUR MILE RUN	002150SMH	X	3560	COMMONWEALTH AV	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/01/2012	Truck 1	1	Structural				
FOUR MILE RUN	002151SMH	X	3600	COMMONWEALTH AV	Frame Base Seal	Corroded, pitted, spalled / deteriorated	Mod: 10-25% mat'l loss, etching - 3/8" (1cm) structural pieces	03/02/2012	Truck 1	1	Structural				
FOUR MILE RUN	002152SMH	X	3600	COMMONWEALTH AV	Chamber	I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces		I/I	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural				
FOUR MILE RUN	002153SMH	X	3560	DALE ST	Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/28/2012	Truck 1	1	Structural				
FOUR MILE RUN	002155SMH	X	100	COMMONWEALTH AV	Chamber	I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces	02/29/2012	Truck 1	1	Structural				
FOUR MILE RUN	002156SMH	X	3600	E GLEBE RD	Chamber	Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/29/2012	Truck 1	1	No Access	0	0	0	-
FOUR MILE RUN	002156SMH	X	2	Light Highway Rural Streets	Frame	Cracked / broken / deteriorated	Min: <1/16" (2mm) width	02/29/2012	Truck 1	1	Structural				
FOUR MILE RUN	002156SMH	X	100	Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm)				Structural					
FOUR MILE RUN	002156SMH	X	2	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/10/2012	Truck 1	1	Structural					
FOUR MILE RUN	002156SMH	X	2	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame Base Seal	Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping					Structural						
			Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching				Structural						
			Chimney/Shft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: <5% of area flow weeping				I/I						
			Chamber	Bricks displaced or missing I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat'l loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat'l loss, etching				Structural						
			Chamber	Mortar missing	Min: <10% of area				Structural						
			Channel	Debris/deposition	Maj: 3-5gal bucket				Maintenance						
FOUR MILE RUN	002161SMH	X	1	W GLOBE RD	Light Highway Rural Streets	03/22/2012	03/22/2012	Truck 1	1		52	53	0	0	3
			Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Grade Ring	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching				Structural						
			Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat'l loss, etching				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat'l loss, etching				I/I						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat'l loss, etching				Structural						
FOUR MILE RUN	002162SMH	X	3550	COMMONWEALTH AV	Light Highway Rural Streets Offset	03/22/2012	03/22/2012	Truck 1	1		63	63	0	0	2
			Frame	I/I evidence	Min: 7/8" to 2" (2.5-5cm)				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft	Cracked	Mod: 10-25% mat'l loss, etching				Structural						
			Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural						
			Chamber	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Structural						
			Chamber	I/I evidence	Mod: 10-25% mat'l loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			W GLOBE RD	Light Highway Rural Streets	03/22/2012	03/22/2012	Truck 1	2		30	30	0	0	4	
FOUR MILE RUN	002163SMH	X	1	W REED AV	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching			Structural						
			FOUR MILE RUN	W GLOBE RD	Light Highway Rural Streets	03/22/2012	03/22/2012	Truck 1	1		47	48	0	0	6
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces				Structural						
			Frame Base Seal	Corroded, pitted, spalled	Mod:10-25% mat'l loss, etching ~3/8" (1cm)				Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			W REED AV	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
FOUR MILE RUN	002165SMH	X	107	Frame Base Seal	Corroded, pitted, spalled	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces				Structural						
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	002177SMH	X	3200	LANDOVER ST	Chamber	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, flow weeping	Min: <10% matt loss, etching	Structural	—	—	—	—	—	
FOUR MILE RUN	002179SMH	X	3301	LANDOVER ST	Chamber	Cracked	Spalling	Min: 1/16" to 1/8" (2-3mm) width, chipping, Min: <10% matt loss, etching	Structural	Truck 1	1	51	52	0	0	
FOUR MILE RUN	002180SMH	X	3214	LANDOVER ST	Frame Base Seal	Light Highway Rural Streets	Corroded, pitted, spalled	Min: <10% matt loss, depth	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	52	0	0	5
FOUR MILE RUN	002181SMH	X	3301	LANDOVER ST	Frame Base Seal	Corroded / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	51	52	0	0	5
FOUR MILE RUN	002177SMH	X	3200	LANDOVER ST	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matt loss, etching	Structural	Truck 1	1	51	52	0	0	5
FOUR MILE RUN	002179SMH	X	3301	LANDOVER ST	Frame Base Seal	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002180SMH	X	3214	LANDOVER ST	Frame Base Seal	Cracked / deteriorated	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	57	59	0	0	4	
FOUR MILE RUN	002181SMH	X	3301	LANDOVER ST	Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002177SMH	X	3200	LANDOVER ST	Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matt loss, etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002179SMH	X	3301	LANDOVER ST	Chamber	Cracked / deteriorated	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	57	59	0	0	4	
FOUR MILE RUN	002180SMH	X	3214	LANDOVER ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matt loss, etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002181SMH	X	3301	LANDOVER ST	Chamber	Corroded, pitted, spalled	Min: <10% matt loss, etching	Min: <10% matt loss, etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002177SMH	X	3200	LANDOVER ST	Frame Base Seal	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matt loss, etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002179SMH	X	3301	LANDOVER ST	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002180SMH	X	3214	LANDOVER ST	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matt loss, <3/8" (1cm) etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002181SMH	X	3301	LANDOVER ST	Frame Base Seal	Corroded, pitted, spalled	Min: <10% matt loss, etching	Min: <10% matt loss, etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002177SMH	X	3200	LANDOVER ST	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% matt loss, etching	Structural	Truck 1	1	57	59	0	0	4
FOUR MILE RUN	002179SMH	X	3301	LANDOVER ST	Chamber	Mortar missing	Min: <10% of area	Min: <10% of area	Structural	Bricks displaced or missing	—	—	—	—	—	—
FOUR MILE RUN	002180SMH	X	3214	LANDOVER ST	Chamber	I/I evidence	Min: <5% of area	Min: <5% of area	Structural	Bricks displaced or missing	—	—	—	—	—	—

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002182SMH	X	3314	Pipe Connection-1 LANDOVER ST Cover Frame Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Corroded, pitted, spalled Pipe cracked Offset Corroded, pitted, spalled Cracked / deteriorated Corroded, pitted, spalled Cracked I/I evidence I/I evidence Corroded, pitted, spalled Cracked	Mod: 10-25% mat'l los., etching Mod: 1/16" to 1/8" (2-3mm) width Mod: 2" to 3" (5-7.5cm) Min: <10% mat'l los, <3/8" (1cm) etching Min: <10% mat'l los, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l los, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l los, staining, mineral deposits, flow weeping Min: <10% mat'l los, staining, mineral deposits, flow weeping Min: <10% mat'l los, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	68	67	0	0	4
FOUR MILE RUN	002182SMH	X	3315	LANDOVER ST Frame Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Corroded, pitted, spalled Cracked / deteriorated I/I evidence Corroded, pitted, spalled I/I evidence Corroded, pitted, spalled Cracked	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l los, <3/8" (1cm) etching Min: <10% mat'l los, staining, mineral deposits, flow weeping Min: <10% mat'l los, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l los, etching	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	59	60	0	0	3
FOUR MILE RUN	002184SMH	X	216	TENNESSEE AV Cover Frame Frame Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Chamber Chamber Chamber	Cracked / deteriorated Corroded, pitted, spalled Cracked / broken / deteriorated Cracked / deteriorated Corroded, pitted, spalled Cracked I/I evidence Cracked Curb/Gutter	Min: >10% (3mm) width Min: etching spotty, 1/16" to 1/8" (2-3mm) depth Mod: 1/16" to 1/8" (2-3mm) width Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l los, etching Min: <10% mat'l los, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) width	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	95	95	0	0	3	

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002187SMH	X	3100	COMMONWEALTH AV	Light Highway/Rural Streets	04/10/2012	04/10/2012	Truck 1	1		0	0	0	0	3
FOUR MILE RUN	002188SMH	X	3125	MT VERNON AV	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) Structural Mod: 1/16"-3/8" (2-10mm) width, small pieces	I/I		65	66	0	0	5
					Frame Base Seal	Corroded, pitted, spalled									
					Frame Base Seal	Cracked / deteriorated									
					Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching	Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching	I/I						
					Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Mod: 10-25% mat'l loss, etching	Structural						
					Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching	Structural						
					Chamber	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Mod: 10-25% mat'l loss, etching	I/I						
					Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Mod: 10-25% mat'l loss, etching	Structural						
					WILSON AV	Light Highway/Rural Streets	03/23/2012	Truck 1	1		70	71	0	0	4
					Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm)		Structural						
					Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: <10% mat'l loss, <3/8" (1cm) etching	I/I						
					Frame Base Seal	Corroded, pitted, spalled	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling	Mod: <10% mat'l loss, <3/8" (1cm) etching	Structural						
					Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: <10% mat'l loss, <3/8" (1cm) etching	I/I						
					Chimney/Shft	Bricks displaced or missing	Min: <10% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching		Structural						
					Chamber	Bricks displaced or missing	Min: <5% of area		Structural						
					Chamber	Corroded, pitted, spalled	Min: <10% of area		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: <10% mat'l loss, etching	Structural						
					COMMONWEALTH AV	Sidewalk	03/22/2012	Truck 1	1		41	41	0	0	3
					Frame	Offset	Min: 7/8" to 2" (2.5-5cm)		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching		Structural						
					WILSON AV	Light Highway/Rural Streets	03/23/2012	Truck 1	1		70	71	0	0	5
					Frame	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3- String depth		Structural						
					Frame Base Seal	I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural						
					Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural						
					Chimney/Shft	Bricks displaced or missing	Min: <10% of area		Structural						
					Chimney/Shft	Corroded, pitted, spalled	Min: <10% of area		Structural						
					Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching	Structural						
					Chamber	Bricks displaced or missing	Min: <5% of area		Structural						
					Chamber	Mortar missing	Min: <10% of area		Structural						
					FOUR MILE RUN	002194SMH	X	3399							
					FOUR MILE RUN	002195SMH	X	3501							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002197SMH	X	3513	WILSON AV	Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping	Truck 1	I/I	Structural	80	80	0	0	2
FOUR MILE RUN	002200SMH	X	2	E GLEBE RD	Chimney/Shft	Bricks displaced or missing Mortar missing	Mod: 10-25% of area	Structural	Structural						
FOUR MILE RUN	002200SMH	X	3110	MT VERNON AV	Chimney/Shft	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X	2	E GLEBE RD	Chimney/Shft	Bricks displaced or missing Corroded, pitted, spalled Mortar missing	Mod: 5-20% of area Min: <10% mat'l loss, etching Min: <5% of area	Structural	Structural						
FOUR MILE RUN	002200SMH	X	142	SANBORN PL	Chamber	Cracked, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X	142	SANBORN PL	Chimney/Shft	Cracked, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X	142	SANBORN PL	Chimney/Shft	Cracked, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X	3399	COMMONWEALTH AV	Chimney/Shft	Cracked, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X			Chimney/Shft	Cracked, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X			Chimney/Shft	Cracked, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X			Chamber	Cracked, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X			Chamber	Cracked, pitted, spalled I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	I/I	Structural					
FOUR MILE RUN	002200SMH	X			Chamber	Cracked, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching	Truck 1	I/I	Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	.002207SMH	X	3603	Frame	Cracked / deteriorated / spalled	Min: <1/16" (2mm) width / Min: <1/16" (2mm) depth			Structural						
				Frame	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/21/2012	Truck 1	I/I						3
			RUSSELL RD	Parking Lot	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/21/2012	Truck 1	1						
FOUR MILE RUN	002208SMH	X	3601	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/09/2012	Truck 1	I/I						
				Frame Base Seal	Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching			I/I						
			RUSSELL RD	Pipe Connection-1	Corroded, pitted, spalled Pipe cracked	Min: <10% mat'l loss, etching	Mod: 1/16" to 1/8" (2-3mm) width		Structural						
FOUR MILE RUN	002209SMH	X	3801	Light Highway Rural Streets	Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/09/2012	Truck 1	1						3
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching			I/I						
			RUSSELL RD	Light Highway Rural Streets	Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/20/2012	Truck 1	1						
FOUR MILE RUN	002210SMH	X	3801	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
				Frame Base Seal	Cracked / deteriorated I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/20/2012	Truck 1	I/I						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/20/2012	Truck 1	I/I						
			Chamber	Cracked	Corroded, pitted, spalled Debris/Deposit	Min: <10% mat'l loss, etching	Extreme: >5 gal bucket		Maintenance						
			Chamber	Chamber	I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Channel	Chamber	Cracked	Corroded, pitted, spalled Debris/Deposit	Extreme: >5 gal bucket		Maintenance						
			RUSSELL RD	Light Highway Rural Streets	Cracked / deteriorated I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching	04/20/2012	Truck 1	1						
FOUR MILE RUN	002212SMH	X	3408	Frame Base Seal	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/20/2012	Truck 1	I/I						2
				Frame Base Seal	I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching	04/20/2012	Truck 1	1						
				Chimney/Shft	Corroded, pitted, spalled Mortar missing	Min: <10% of area			Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shft	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, flow weeping	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <1/4gpm, staining, mineral deposits,	Structural	I/I					
			Chamber	I/I evidence	Cracked	Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chamber		Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching	Structural	I/I					
			Chamber		Mortar missing	Min: <10% of area		Structural						
FOUR MILE RUN	002217SMH	X	MT VERNON AV	Light Highway Rural Streets	04/20/2012	04/20/2012	Truck 1	1		59	60	0	0	2
			Frame Base Seal	I/I evidence		Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I					
			Frame Base Seal		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I					
			Chimney/Shft	I/I evidence	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Mortar missing	Min: <10% of area		Structural						
FOUR MILE RUN	002218SMH	X	MT VERNON AV	Light Highway Rural Streets	04/20/2012	04/20/2012	Truck 1	1		59	60	0	0	2
			Frame Base Seal	I/I evidence		Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I					
			Frame Base Seal		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Mortar missing	Min: <10% of area		Structural						
			Chimney/Shft	I/I evidence		Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching	Structural	I/I					
			Chamber	I/I evidence		Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching	Structural	I/I					
			Chamber		Mortar missing	Min: <10% of area		Structural						
FOUR MILE RUN	002220SMH	X	MT VERNON AV	Light Highway Rural Streets	04/20/2012	04/20/2012	Truck 1	1		59	60	0	0	2
			Frame Base Seal	I/I evidence		Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Frame Base Seal		Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I					
			Frame Base Seal		Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft	I/I evidence		Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					
			Chimney/Shft		Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits,	Min: <10% mat'l loss, etching	Structural	I/I					

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002221SMH	X	3603	Chimney/Shaf Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% of area		Structural						
FOUR MILE RUN	002224SMH	X	3507	Chimney/Shaf Chamber	Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% of area	I/I	Structural						
FOUR MILE RUN	002225SMH	X	3637	MT VERNON AV	Easement	Min: <10% matt loss, etching spalling 02/28/2012	Truck 1	Structural						
FOUR MILE RUN	002227SMH	X	3360	Chimney/Shaf Chamber	Corroded, pitted, spalled Cracked	Mod: 10-25% matt loss, etching Min: <10% matt loss, etching spalling 02/28/2012	Truck 1	Structural						
FOUR MILE RUN	002221SMH	X	3603	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling 03/21/2012	Truck 1	Structural						
FOUR MILE RUN	002224SMH	X	3507	Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	I/I	Structural						
FOUR MILE RUN	002225SMH	X	3637	Frame Base Seal	Corroded, pitted, spalled Cracked	Mod: 10-25% matt loss, etching ~ 3/8" (1cm) Mod: 1/16" to 1/8" (2-3mm) width, small pieces	I/I	Structural						
FOUR MILE RUN	002227SMH	X	3360	Frame Base Seal	Corroded, pitted, spalled Cracked	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling 04/20/2012	Truck 1	Structural						
FOUR MILE RUN	002221SMH	X	3603	Frame Base Seal	Cracked / deteriorated	Min: <10% matt loss, >3/8" (1cm) etching flow weeping	I/I	Structural						
FOUR MILE RUN	002224SMH	X	3507	Frame Base Seal	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural						
FOUR MILE RUN	002225SMH	X	3637	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% matt loss, etching flow weeping	I/I	Structural						
FOUR MILE RUN	002227SMH	X	3360	Frame Base Seal	Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	I/I	Structural						
FOUR MILE RUN	002221SMH	X	3603	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling 04/03/2012	Truck 1	Structural						
FOUR MILE RUN	002224SMH	X	3507	Frame Base Seal	Cracked / deteriorated	Min: <10% matt loss, etching flow weeping	I/I	Structural						
FOUR MILE RUN	002225SMH	X	3637	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	I/I	Structural						
FOUR MILE RUN	002227SMH	X	3360	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling 04/03/2012	Truck 1	Structural						
FOUR MILE RUN	002221SMH	X	3603	B GUNSTON RD	Light Highway Rural Streets	Min: etching spots, 1/16" to 1/8" (2-3mm) depth		Structural						
FOUR MILE RUN	002224SMH	X	3507	Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
FOUR MILE RUN	002225SMH	X	3637	Frame Base Seal	Corroded, pitted, spalled Cracked	Min: <10% matt loss, <3/8" (1cm) etching Mod: 10-25% matt loss, etching	I/I	Structural						
FOUR MILE RUN	002227SMH	X	3360	Chimney/Shaf Chamber	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shaft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural	I/I					
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
FOUR MILE RUN	002230SMH	X	OLD DOMINION BV	Frame	03/30/2012	03/30/2012	Truck 1	1		51	52	0	0	4
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, depth			Structural	I/I					
			Frame Base Seal	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
			Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shaft	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Chimney/Shaft	Cracked	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shaft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural	I/I					
FOUR MILE RUN	002231SMH	X	OLD DOMINION BV	Light Highway Rural Streets	03/30/2012	03/30/2012	Truck 1	1		15	15	0	0	4
			Pipe Connection-1	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
			OLD DOMINION BV	Light Highway Rural Streets Easement	02/14/2012	02/14/2012	Truck 1	1		0	0	0	0	4
			OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	02/14/2012	Truck 1	1		0	0	0	0	3
			OLD DOMINION BV	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural	I/I					
			Frame	Corroded, pitted, spalled / broken / deteriorated	Min: <1/16" (2mm) width			Structural						
			Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural	I/I					
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural	I/I					
			Chimney/Shaft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shaft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chamber	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, pieces, missing			Structural	I/I					
			Chamber	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
			Pipe Connection-1	Cracked	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
			Pipe Connection-2	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
			Pipe Connection-3	Pipe cracked	Mod: 1/8" to 3/16" (3-5mm) width			Structural						
FOUR MILE RUN	002236SMH	X	OLD DOMINION BV	Light Highway Rural Streets	02/14/2012	02/14/2012	Truck 1	1		5	5	0	0	3
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			CHALFONTE DR	Light Highway Rural Streets	02/14/2012 - 02/14/2012	Truck 1	1		99	99	0	0	3	
			Cover	I/I evidence	Extreme: separating into pieces			Structural	I/I					
			Chimney/Shaft		Min: <1/4gpm, staining, mineral deposits, flow weeping									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002245SMH	X	3360	Chimney/Shft Chamber Chamber	Chimney/Shft	Corroded, pitted, spalled Cracked	Min: <10% mat'l loss, etching I/I evidence	Min: 1/8" to 1/4" (3-6mm) width, pieces, missing flow weeping Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, Corroded / deteriorated	Structural						
FOUR MILE RUN	002247SMH	X	3360	C GUNSTON RD Frame	Light Highway Rural Streets	Corroded, pitted, spalled Cracked / deteriorated Corroded, pitted, spalled I/I evidence	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, <3g" (1cm) etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces I/I evidence	Structural Structural Structural	Truck 1	1	65	.66	0	0	2
FOUR MILE RUN	002247SMH	X	3360	C GUNSTON RD Frame	Frame Base Seal	Corroded, pitted, spalled Cracked / deteriorated Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	Structural Structural Structural							
FOUR MILE RUN	002247SMH	X	3360	C GUNSTON RD Frame	Frame Base Seal	Corroded, pitted, spalled Cracked / deteriorated Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <10% mat'l loss, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	Structural Structural Structural	Truck 1	1	66	.67	0	0	2
FOUR MILE RUN	002252SMH	X	624	BEVERLEY DR Cover	Light Highway Rural Streets	Corroded, pitted, spalled Cracked / deteriorated Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <10% mat'l loss, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural Structural Structural	Truck 1	1	50	50	0	0	3
FOUR MILE RUN	002267SMH	X	3360	C GUNSTON RD Cover	Light Highway Rural Streets Fit in Frame	Corroded, pitted, spalled Cracked / broken / deteriorated Corroded, pitted, spalled I/I evidence	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth Min: 1/16" to 1/8" (2-3mm) width Min: <10% mat'l loss, etching	Structural Structural Structural	Truck 1	1	10	10	0	0	0
FOUR MILE RUN	002269SMH	X	3360	C GUNSTON RD Frame	Light Highway Rural Streets	Corroded, pitted, spalled Cracked / deteriorated Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <10% mat'l loss, staining, mineral deposits, flow weeping	Structural Structural Structural	Truck 1	1	67	68	0	0	4

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Field Flow (gpm)	#Connecting Pipes
FOUR MILE RUN	002284SMH	X	3360	C GUNSTON RD Chamber	Cracked	Light Highway/Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	I	59	60	0	0	2
				Frame Base Seal	I/I evidence	Corroded, pitted, spalled, etching	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural						
				Frame Base Seal	I/I evidence	Cracked / deteriorated	Min: <14gpm, staining, mineral deposits, flow weeping	I/I	Structural					
				Chimney/Shelf	I/I evidence	Corroded, pitted, spalled	Min: 1/16" to 3/8" (2-10mm) width, small pieces	I/I	Structural					
				Chimney/Shelf	I/I evidence	Cracked	Min: <14gpm, staining, mineral deposits, flow weeping	I/I	Structural					
				Chimney/Shelf	I/I evidence	Corroded, pitted, spalled, etching	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural					
				Chamber	I/I evidence	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural					
				Chamber	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chamber	I/I evidence	Spalled	Min: <10% mat'l loss, etching	I/I	Structural					
FOUR MILE RUN	002285SMH	X	3360	C GUNSTON RD Frame	Cracked / deteriorated	Light Highway/Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	I	62	64	0	0	2
				Frame Base Seal	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Structural						
				Frame Base Seal	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chimney/Shelf	I/I evidence	Cracked	Min: <14gpm, staining, mineral deposits, flow weeping	I/I	Structural					
				Chimney/Shelf	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chamber	I/I evidence	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural					
				Chamber	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chamber	I/I evidence	Spalled	Min: <10% mat'l loss, etching	I/I	Structural					
FOUR MILE RUN	002286SMH	X	3360	C GUNSTON RD Frame	Cracked / deteriorated	Light Highway/Rural Streets	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	I	65	66	0	0	2
				Frame Base Seal	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	I/I	Structural					
				Frame Base Seal	I/I evidence	Cracked	Min: <14gpm, staining, mineral deposits, flow weeping	I/I	Structural					
				Frame Base Seal	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chimney/Shelf	I/I evidence	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	I/I	Structural					
				Chimney/Shelf	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chamber	I/I evidence	Spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chamber	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	I/I	Structural					
				Chamber	I/I evidence	Spalled	Min: <10% mat'l loss, etching	I/I	Structural					
FOUR MILE RUN	002283SMH	X	3900	JEFFERSON DAVIS HY	Easement	Offset	Mat: 3" to 4" (7.5-10cm)	Truck 1	I	72	73	0	0	2
				Frame	I/I evidence	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
				Chimney/Shelf	I/I evidence	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002294SMH	X	3900	JEFFERSON DAVIS HY	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Chamber	Cracked		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
				Chamber	Corroded, pitted, spalled		Min: <10% mat'l loss, etching			Structural					
				Chamber	Cracked / deteriorated		Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Light Highway Rural Streets	I/I evidence	04/05/2012	04/05/2012 - Truck 1				56	57	0	0	2
FOUR MILE RUN	002295SMH	X	3951	JEFFERSON DAVIS HY	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching, flwg weeping			Structural					
				Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I						
				Grade Ring	Cracked		Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Grade Ring	Corroded, pitted, spalled		Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
				Grade Ring	I/I evidence	Mod: 10-25% mat'l loss, etching			Structural						
				Chimney/Shft	Corroded, pitted, spalled		Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching			Structural						
				Chamber	Corroded, pitted, spalled		Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Chamber	I/I evidence	Min: <10% mat'l loss, etching			Structural						
				Light Highway Rural Streets	Corroded, pitted, spalled	03/26/2012	03/26/2012 - Truck 1			I/I	61	62	0	0	2
FOUR MILE RUN	002296SMH	X	3750	JEFFERSON DAVIS HY	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
				Frame Base Seal	I/I evidence	Min: 1/16" to 1/4" (3-6mm) width, small pieces			I/I						
				Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I						
				Chimney/Shft	I/I evidence	Min: <10% mat'l loss, etching			Structural						
				Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I						
				Chamber	I/I evidence	Min: <10% mat'l loss, etching			Structural						
				Light Highway Rural Streets	Corroded, pitted, spalled	04/05/2012	04/05/2012 - Truck 1			I/I	69	69	0	0	5
FOUR MILE RUN	002304SMH	X	3750	JEFFERSON DAVIS HY	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I					
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching, flwg weeping			Structural						
				Chamber	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <10% mat'l loss, etching			I/I						
				Light Highway Rural Streets	Corroded, pitted, spalled	03/02/2012	03/02/2012 - Truck 1			I/I	54	55	0	0	4
				Frame Base Seal	I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching, flwg weeping			Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			I/I						
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flwg weeping			I/I						
				Light Highway Rural Streets	Corroded, pitted, spalled	03/02/2012	03/02/2012 - Truck 1			I/I	54	55	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002310SMH	X	601	TENNESSEE AV	Crack(s)	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/16/2012	Truck 1	1	Structural	0	0	0	0	5
FOUR MILE RUN	002311SMH	X	601	TENNESSEE AV	Yard-Front	Light Highway/Rural Streets /I evidence	02/16/2012	Truck 1	1		25	26	0	0	3
FOUR MILE RUN	002312SMH	X	3516	HALCYON DR	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/16/2012	Truck 1	1		26	26	0	0	3
FOUR MILE RUN	002314SMH	X	3360	C. GUNSTON RD	Light Highway/Rural Streets /I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012	Truck 1	1	Structural	26	26	0	0	3
FOUR MILE RUN	002315SMH	X	3360	C. GUNSTON RD	Bricks displaced or missing	Mod: <5% of area	02/09/2012	Truck 1	1	Structural	65	65	0	0	3
FOUR MILE RUN	002316SMH	X	950	W GLEBE RD	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	04/09/2012	Truck 1	1	Structural	0	0	0	0	2
FOUR MILE RUN	002317SMH	X	3850	CAMERON MILLS RD	Cracked	Min: 1/8" to 1/4" (3-6mm) width, places, missing	04/09/2012	Truck 1	1	Structural	0	0	0	0	2
				Cover	/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/09/2012	Truck 1	1	Structural	72	73	0	0	3
				Frame	Mod: 10-25% of area	Mod: 10-25% mat'l loss, etching	04/09/2012	Truck 1	1	Structural	0	0	0	0	2
				Frame	Cracked / broken / deteriorated	Min: <1/16" to 1/8" (2-3mm) width	04/09/2012	Truck 1	1	Structural	0	0	0	0	2
				Frame Base Seal	/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	Bricks displaced or missing	Min: <5% of area	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	/I evidence	Min: <10% of area	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	Mod: 10-25% mat'l loss, etching	Min: <1/16" (2mm) width, light	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth	04/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame	Cracked / broken / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width	04/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	Bricks displaced or missing	Min: <5% of area	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	/I evidence	Min: <10% of area	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Chimney/Shft	Mod: 10-25% mat'l loss, etching	Min: <1/16" (2mm) width, small pieces	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Cover	Cracked / broken / deteriorated	Min: generally etching, 1/8" to 3/16" (3-5mm) depth	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame	/I evidence	Min: <1/16" to 1/8" (2-3mm) width	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	Cracked / broken / deteriorated	Min: <10% mat'l loss, <3/8" (1cm) etching	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Cover	Fit in Frame	Min: tight	02/09/2012	Truck 1	1	Structural	68	69	0	0	3
				Frame	Cracked / broken / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame	/I evidence	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Frame Base Seal	/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012	Truck 1	1	Structural	0	0	0	0	3
				Cameron Mills Rd	Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/09/2012	Truck 1	1	Structural	0	0	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002319SMH	X	3707	CAMERON MILLS RD	Frame	Cracked	Conroed, pitted, spalled	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
FOUR MILE RUN	002319SMH	X	3707	CHIMNEY/SHAFT	Chimney/Shaft	Cracked	Conroed, pitted, spalled	I/I evidence	Min: <10% mat loss, etching	Structural					
FOUR MILE RUN	002320SMH	X	3602	ORLANDO PL	Frame	Cracked	Conroed, pitted, spalled	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural					
FOUR MILE RUN	002321SMH	X	3602	CHIMNEY/SHAFT	Chimney/Shaft	Cracked	Conroed, pitted, spalled	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
FOUR MILE RUN	002325SMH	X	3603	OLD DOMINION BY	Frame	Cracked	Conroed, pitted, spalled	I/I evidence	Min: <10% mat loss, etching	Structural					
FOUR MILE RUN	002325SMH	X	3603	CHIMNEY/SHAFT	Chimney/Shaft	Cracked	Conroed, pitted, spalled	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural					
FOUR MILE RUN	002325SMH	X	3603	CHIMNEY/SHAFT	Chimney/Shaft	Cracked	Conroed, pitted, spalled	I/I evidence	Min: <10% mat loss, etching	Structural					

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002338SMH	X	3360 C GUNSTON RD	Light Highway Rural Streets	04/17/2012	04/04/2012	Truck 1	1	Structural	95	95	0	0	2
			Cover	Cracked / deteriorated Offset	Mod: >1/8" (3mm) width Mod: 2" to 3" (5-7.5cm)				Structural					
			Frame	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
			Frame Base Seal	Corroded, pitted, spalled Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching			Structural					
			Frame Base Seal	Corroded, pitted, spalled, I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching			Structural					
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				I/I					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				I/I					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				I/I					
FOUR MILE RUN	002651SMH	X	3700 JEFFERSON DAVIS HY	Light Highway Rural Streets	03/02/2012	03/02/2012	Truck 1	1	Structural	49	50	0	0	5
			Frame Base Seal	Cracked / deteriorated VI evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching			Structural					
			Frame Base Seal	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			I/I					
			Chimney/Shft	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			I/I					
			Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				I/I					
FOUR MILE RUN	002652SMH	X	3700 JEFFERSON DAVIS HY	Light Highway Rural Streets	03/02/2012	03/02/2012	Truck 1	1	Structural	56	55	10	0	2
			Frame Base Seal	VI evidence	Min: <10% mat'l loss, <3/8" (1cm) etching	Min: <10% mat'l loss, etching			Structural					
			Frame Base Seal	Cracked / deteriorated VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			I/I					
			Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching			Structural					
			Chimney/Shft	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			I/I					
			Chamber	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			I/I					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				I/I					
			Bench	Debris/Deposition	Min: <1 gal bucket				Maintenance					
			Channel	Debris/Deposition	Min: <1 gal bucket				Maintenance					
FOUR MILE RUN	002660SMH	X	3700 PINE ST	Yard-Side	03/02/2012	03/02/2012	Truck 1	1	Structural	0	0	0	0	4
FOUR MILE RUN	002661SMH	X	269 JEFFERSON DAVIS HY	Light Highway Rural Streets	03/19/2012	03/19/2012	Truck 1	1	Structural	69	70	0	0	4
			Frame Base Seal	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural					
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching	Min: <10% mat'l loss, etching			Structural					
			Chimney/Shft	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Min: <10% mat'l loss, etching			Structural					
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				I/I					
			Chimney/Shft	VI evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <5% of area			Structural					
			Chimney/Shft	Bricks displaced or missing	Min: <10% of area				Structural					

Basin	MH	SCREAM insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	002683SMH	X	2818	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping										
				Chamber	Mortar missing	Min: <10% of area				Structural						
				Chamber	Bricks displaced or missing	Min: <5% of area				Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching depth	03/19/2012	Truck 1	1	Structural						
			RUSSELL RD	Light Highway/Rural Streets	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth	03/19/2012			Structural						
				Frame -	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
				Frame Base Seal	I/I evidence	Min: <4/gpm, staining, mineral deposits, flow weeping				I/I						
				Frame Base Seal	Mortar missing	Min: <10% of area				Structural						
				Chimney/Shelf	Bricks displaced or missing	Min: <5% of area				Structural						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
				Chamber	Bricks displaced or missing	Min: <5% of area				Structural						
				Chamber	Mortar missing	Min: <10% of area				Structural						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
				Channel	Mortar missing	Min: <10% of area				Structural						
				Channel	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
				Channel	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width				Structural						
			Pipe Connection-1	RUSSELL RD	Light Highway/Rural Streets	03/19/2012	Truck 1	1								
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
				Chimney/Shelf	Mortar missing	Min: <10% of area				Structural						
				Chimney/Shelf	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
				Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
				Chimney/Shelf	Bricks displaced or missing	Min: <5% of area				Structural						
				Chamber	Mortar missing	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
				Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
				Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
				Chamber	Bricks displaced or missing	Min: <5% of area				Structural						
				Chamber	Mortar missing	Min: <10% of area				Structural						
			Pipe Connection-1	MONTECILLO BY	Light Highway/Rural Streets	03/19/2012	Truck 1	1								
				Pipe Connection-4	Pipe cracked	Mod: 1/16" to 3/16" (3-5mm) width				Structural						
				FOUR MILE RUN	002685SMH	X	308									
				Frame Base Seal	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth				Structural						
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min. <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal		Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft		I/I evidence	Min: <1/4gpm, staining, mineral deposits,			III						
			Chimney/Shft		Mortar missing	Min: <10% of area			Structural						
			Chimney/Shft		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching			Structural						
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching			Structural						
			Chamber		Mortar missing	Min: <10% of area			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/19/2012	Truck 1	I/I						
			MONTICELLO BY		Light Highway/Rural Streets	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
			Frame		Corroded, pitted, spalled I/I evidence	Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Chimney/Shft		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shft		Mortar missing	Min: <10% of area			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		Mortar missing	Min: <10% of area			Structural						
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching	07/20/2012	Truck 1	I/I						
			COMMONWEALTH AV		Yard/Front	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/05/2012	Truck 1	I/I						
			ANCELL ST		I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Cracked / deteriorated Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Frame Base Seal		Mortar missing	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shft		Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shft		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shft		Mortar missing	Min: <10% mat'l loss, etching			Structural						
			Chamber		Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching			Structural						
			Chamber		Mortar missing	Min: <10% of area			Structural						
			ANCELL ST		Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			I/I						
			Frame		Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
			Frame Base Seal		Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		Mortar missing	Min: <10% mat'l loss, etching			Structural						
			ANCELL ST		Sidewalk	Min: 2/2/2012	Truck 1	1							
			Frame		Offset	Min: 7/8" to 2" (2.5-5cm)			Structural						
			Frame Base Seal		Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Frame Base Seal		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		Mortar missing	Min: <10% mat'l loss, etching			Structural						
			ANCELL ST		Corroded, pitted, spalled I/I evidence	Min: 2/22/2012	Truck 1	1							
			Frame		Offset	Min: 2/22/2012			Structural						
			Frame Base Seal		Cracked / deteriorated I/I evidence	Min: 2/22/2012			Structural						
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			ANCELL ST		Mortar missing	Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	002696SMH	X	2918												
FOUR MILE RUN	002697SMH	X	1												
FOUR MILE RUN	002696SMH	X	2918												
FOUR MILE RUN	002697SMH	X	1												
FOUR MILE RUN	002700SMH	X	15												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002701SMH	X	34	ANCILL ST Chimney	Median missing Street's Offset	Min: >10% of area	02/22/2012	02/22/2012	Truck 1	I	54	55	0	.0	.3
FOUR MILE RUN	002702SMH	X	15	ANCILL ST Chamber	Frame Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chimney/Shft Chamber	Corroded, pitted, spalled Cracked / deteriorated II/ evidence Corroded, pitted, spalled Cracked	Min: 7/8" to 2" (2.5-5cm) Min: <10% mat'l loss, <3/8" (1cm) etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural Structural Structural I/I Structural Structural							
FOUR MILE RUN	002704SMH	X	21	CLIFFORD AV	Frame Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chamber	Corroded, pitted, spalled Cracked / deteriorated II/ evidence Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural Structural Structural I/I Structural Structural							
FOUR MILE RUN	002705SMH	X	2924	MT VERNON AV	Frame Base Seal Frame Base Seal Frame Base Seal Chimney/Shft Chimney/Shft Chamber	Corroded, pitted, spalled Cracked / deteriorated II/ evidence Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Min: 1/8" to 1/4" (3-6mm) width, pieces, missing Min: <1/4gpm, staining, mineral deposits,	Structural Structural Structural I/I Structural Structural							
FOUR MILE RUN	002706SMH	X													

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pd II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002706SMH	X	3013	FULTON ST Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/27/2012	Truck 1	I	53	54	0	*	0
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	02/27/2012	Truck 1	I					2
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching ~3/8" (1cm) Structural								
				Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural					
				Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/27/2012	Truck 1	I/I					
FOUR MILE RUN	002707SMH	X	3019	FULTON ST	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/27/2012	Truck 1	I	50	51	0	0	2
				Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% matl loss, etching ~3/8" (1cm) Structural								
				Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural					
				Chimney/Shft	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural					
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/10/2012	Truck 1	I/I					
FOUR MILE RUN	002708SMH	X	3000	FULTON ST	Light Highway Rural Streets	Min: etching spots, 1/16" to 1/8" (2-3mm) depth	04/10/2012	Truck 1	I	67	68	0	0	2
				Frame	Corroded, pitted, spalled	Min: <1/16" (2mm) width			Structural					
				Frame	Cracked / broken / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
				Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching			Structural					
				Chimney/Shft	Cracked	Min: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural					
				Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/23/2012	Truck 1	I/I					
				MT VERNON AV	Easement	Min: <10% matl loss, etching								
FOUR MILE RUN	002710SMH	X	3015	Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/10/2012	Truck 1	I	50	51	0	0	3
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					
				Chimney/Shft	I/I evidence	Min: <10% matl loss, etching			Structural					
				Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I					
				Chamber	I/I evidence	Min: <10% matl loss, etching								
				Chamber	Corroded, pitted, spalled	Min: <10% matl loss, etching			Structural					
FOUR MILE RUN	002711SMH	X	3025	MT VERNON AV	Light Highway Rural Streets	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/10/2012	Truck 1	I	14	14	0	0	3
				Frame Base Seal	Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching			Structural					
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/10/2012	Truck 1	I					
				KENNEDY ST	Easement	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/10/2012	Truck 1	I/I					
FOUR MILE RUN	002713SMH	X	66	Frame Base Seal	I/I evidence	Min: <10% matl loss, etching			Structural					
				Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/10/2012	Truck 1	I/I					
				Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural					

Basin	MH	SCREAM Insp.	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow, (gpm)	# Connecting Pipes
			Chimney/Shft	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching flow weeping	Min: <1/4gpm, staining, mineral deposits, spalling			Structural	I/I					
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			Structural	I/I					
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
FOUR MILE RUN	002714SMH	X	A KENNEDY ST	Easement	02/22/2012	02/22/2012	Truck 1	1			71	72	0	0	2
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
			Chimney/Shft	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching			Structural	I/I					
			Chimney/Shft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching			Structural							
			Chamber	Pipe cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching		Structural							
FOUR MILE RUN	002726SMH	X	ASPEN ST	Light Highway Rural Streets	03/21/2012	03/21/2012	Truck 1	1			54	55	0	0	3
			Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chimney/Shft	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching			Structural							
			Chimney/Shft	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching		Structural							
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching		Structural							
			Chamber	Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching		Structural							
			Chamber	Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
FOUR MILE RUN	002728SMH	X	ASPEN ST	Light Highway Rural Streets	03/21/2012	03/21/2012	Truck 1	1			59	61	0	0	3
			Frame Base Seal	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm) Structural pieces		Structural							
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small spalling			Structural							
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching		Structural							
			Chimney/Shft	Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, etching		Structural							
			Chamber	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
FOUR MILE RUN	002730SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	03/20/2012	Truck 1	1			54	55	0	0	4
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Min: <10% mat'l loss, <3/8" (1cm) etching		Structural							
			Frame Base Seal	Corroded, pitted, spalled											

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
FOUR MILE RUN	002731SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	1				47	48	0	0	4
			Chimney/Shft	I/I evidence	Min: <10% matt loss, etching				Structural						
			Chamber	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	I/I evidence	Min: <10% matt loss, etching				Structural						
			Pipe Connection-1	Pipe cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
FOUR MILE RUN	002734SMH	X	RUSSELL RD	Light Highway Rural Streets	03/21/2012	93/21/2012	Truck 1	1			65	66	0	0	2
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces				Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching ~ 3/8" (1cm)				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural						
			Chamber	Corroded, pitted, spalled	Mod: 10-25% matt loss, etching				I/I						
			Chamber	I/I evidence	Min: <10% matt loss, etching				Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
FOUR MILE RUN	002735SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	93/21/2012	Truck 1	1			37	38	0	0	2
			Chamber	I/I evidence	Min: <10% matt loss, etching				Structural						
			Chamber	Cracked	Mod: 1/8" to 1/4" (3-6mm) width, small pieces				Structural						
			Grade Ring	Corroded, pitted, spalled	Mod: 25-50% matt loss, etching				Structural						
			Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Grade Ring	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <10% matt loss, etching				Structural						
FOUR MILE RUN	002736SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	93/21/2012	Truck 1	1			69	70	0	0	3
			Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Grade Ring	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% matt loss, etching				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Cracked	Min: <10% matt loss, etching				Structural						
FOUR MILE RUN	002737SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	93/21/2012	Truck 1	1			67	67	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shaft	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching	Mod: 1-3gpm, trickle, flow dripping			I/I						
			Chimney/Shaft	Bricks displaced or missing	Min: <5% of area	Structural									
			Chimney/Shaft	Mortar missing	Min: <10% of area	Structural									
			Chamber	Mortar missing	Min: <10% of area	Structural									
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural									
			Chamber	Bricks displaced or missing	Min: <5% of area	Structural									
			Chamber	I/I evidence	Mod: 1-3gpm, trickle, flow dripping	I/I									
FOUR MILE RUN	002738SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	1			56	56	0	.0	.0	2
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I									
			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25%, mat'l loss, etching ~1/8" (1cm)	Structural									
			Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural									
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	Structural									
			Chamber	I/I evidence	Mod: 1/4gpm, staining, mineral deposits, flow weeping	I/I									
FOUR MILE RUN	002739SMH	X	RUSSELL RD	Light Highway Rural Streets	03/20/2012	Truck 1	1			63	64	0	.0	.0	2
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural									
			Frame Base Seal	I/I evidence	Min: <10% mat'l loss, etching	Structural									
			Chimney/Shaft	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural									
			Chimney/Shaft	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural									
			Chimney/Shaft	I/I evidence	Mod: 1/4gpm, staining, mineral deposits, flow weeping	I/I									
FOUR MILE RUN	002740SMH	X	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	1			59	59	0	0	0	2
			Frame	Corroded, pitted, spalled	Mod: generally etching, 1/8" to 3/16" (3-5mm) depth	Structural									
			Frame Base Seal	I/I evidence	Mod: 1/4gpm, staining, mineral deposits, flow weeping	I/I									
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
			Chimney/Shaft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									
FOUR MILE RUN	002741SMH	X	RUSSELL RD	Light Highway Rural Streets	03/21/2012	Truck 1	1			65	66	0	0	0	2
			Frame	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~3/8" (1cm)	Structural									
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I									
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	.02748SMH	X	3637	RUSSELL RD	Light Highway Rural Streets I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping 04/09/2012	Min: <1/4gpm, staining, mineral deposits, flow weeping 04/09/2012	Truck 1	I/I		79	80	0	>0	3
FOUR MILE RUN	.02749SMH	X	1	W GLEE RD	Frame Base Seal Chimney/Shaft	Corroded, pitted, spalled / deteriorated Mortar missing I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% of area	Structural	I/I						
FOUR MILE RUN	.02750SMH	X	1	W GLEE RD	Frame Base Seal Chimney/Shaft	Corroded, pitted, spalled / deteriorated Mortar missing I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% of area	Structural	I/I						
FOUR MILE RUN	.02751SMH	X	1	RUSSELL RD	Frame Base Seal Chimney/Shaft	Corroded, pitted, spalled / deteriorated Mortar missing I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% of area	Structural	I/I						
FOUR MILE RUN	.02752SMH	X	3200	RUSSELL RD	Frame Base Seal Chimney/Shaft	Corroded, pitted, spalled / deteriorated Mortar missing I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% of area	Structural	I/I						
FOUR MILE RUN	.02753SMH	X	3405	RUSSELL RD	Frame Base Seal Chimney/Shaft	Corroded, pitted, spalled / deteriorated Mortar missing I/I evidence	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 10-25% of area	Structural	I/I						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II Score	MH Maint Score	MH Port II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002754SMH	X	3400	Chimney/Shelf	Cracked	Mod. 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
	Chamber	Corroded, pitted, spalled	Min: <10% mat' loss, etching												
	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits,							I/I					
	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	RUSSELL RD	Light Highway/Rural Streets	03/20/2012	Truck 1	1										
	Frame Base Seal	Cracked, pitted, spalled	Min: <10% mat' loss, <3/8" (1cm) etching						Structural						
	Frame Base Seal	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	Frame Base Seal	Cracked / deteriorated	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						I/I						
	Grade Ring	Cracked	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	Grade Ring	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						I/I						
	Grade Ring	Offset	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 2" (2.5-5cm)						Structural						
	Grade Ring	Corroded, pitted, spalled	Mod: 10-25% mat' loss, etching						Structural						
	Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: <10% mat' loss, etching						I/I						
	Chimney/Shelf	Cracked	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	Chamber	Corroded, pitted, spalled	Min: <10% mat' loss, etching						Structural						
	Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						I/I						
	HERBERT ST	Sidewalk	03/16/2012	Truck 1	1										
	Chamber	Corroded, pitted, spalled	Mod: 10-25% mat' loss, etching						Structural						
	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces						Structural						
	Channel	Corroded, pitted, spalled	Mod: 10-25% mat' loss, etching						Structural						
	Channel	Debris/deposition	Extreme: >5 gal bucket						Maintenance						
	Channel	Cracked	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	COMMONWEALTH AV	Light Highway/Rural Streets	03/13/2012	Truck 1	1										
	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						I/I						
	Chamber	Cracked	Mod: 10-25% mat' loss, etching						Structural						
	MT VERNON AV	Light Highway/Rural Streets	04/10/2012	Truck 1	1										
	Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling						Structural						
	Chamber	Corroded, pitted, spalled	Min: <10% mat' loss, <3/8" (1cm) etching						Structural						
	Chamber	Cracked	Min: 1/8" to 1/4" (3.5mm) width, pieces, missing						Structural						
	Chamber	Spalled	Mod: 10-25% mat' loss, etching						Structural						
	Chamber	Bricks displaced or missing Mortar missing	Mod: 5-20% of area												
	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width						I/I						
	Pipe Connection-1	Pipe cracked							Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	Mt Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002776SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets Offset	04/03/2012	04/03/2012	Truck 1	1	Structural	71	72	0	0	2
			Frame		Cracked / deteriorated, spalled, I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Structural							
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: 1/8" to 1/4" (3-6mm) width, pieces, missing	Structural	I/I							
			Frame Base Seal		Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, etching	Structural	I/I							
			Frame Base Seal		Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural	I/I							
			Chimney/Shft		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, etching	Structural	I/I							
			Chimney/Shft		Corroded, pitted, spalled Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural	I/I							
			Chimney/Shft		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, etching	Structural	I/I							
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, etching	Structural	I/I							
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, etching	Structural	I/I							
			Chamber		Light Highway Rural Streets	02/09/2012	Truck 1	1		49	50	0	0	2	
			CAMERON MILLS RD		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Frame Base Seal		Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Grade Ring		Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Chimney/Shft		Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Chamber		Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Chamber		Light Highway Rural Streets	02/14/2012	Truck 1	1		25	25	0	0	3	
			OLD DOMINION BV		Pipe cracked	Min: 3/16"-1/4" (5-8mm) width	Structural								
			Pipe Connection-2		Light Highway Rural Streets	02/14/2012	Truck 1	1		46	46	0	0	4	
			OLD DOMINION BV		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Frame Base Seal		Cracked / deteriorated I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Frame Base Seal		Cracked / deteriorated I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Chimney/Shft		Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Pipe Connection-1		Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width	Structural								
			OLD DOMINION BV		Light Highway Rural Streets	02/14/2012	Truck 1	1		59	60	0	0	3	
			Frame Base Seal		Cracked / deteriorated I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Structural								
			Frame Base Seal		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, <3/8" (1cm) etching	Structural	I/I							
			Frame Base Seal		Corroded, pitted, spalled Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	I/I							
			Chamber		Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mat: <10% mat'l loss, etching	Structural	I/I							
			Chamber		Light Highway Rural Streets	02/14/2012	Truck 1	1		5	5	0	0	2	
			OLD DOMINION BV		Cracked / deteriorated I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	I/I							
			Frame Base Seal		Light Highway Rural Streets	03/19/2012	Truck 1	1		67	68	0	0	4	
			RUSSELL RD		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping									
			Frame Base Seal												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002792SMH	X	RUSSELL RD	Frame Base Seal	Corroded, pitted, spalled	Mod. 10-25% mat'l loss, etching ~3/8" (1cm)									
			Chamber	Frame Base Seal	Cracked / deteriorated	Mod. 1/16"-3/8" (2-10mm) width, small pieces				Structural					
			Chamber	Frame Base Seal	II evidence	Min. <1/4gpm, staining, mineral deposits, flow weeping				II					
			Chamber	Frame Base Seal	Bricks displaced or missing	Min: <5% of area				Structural					
			Chamber	Frame Base Seal	Corroded, pitted, spalled	Min: <10% of area				Structural					
			Chamber	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Pipe Connection-3	Frame Base Seal	Pipe cracked	Mod. 1/8" to 3/16" (3-5mm) width				Structural					
FOUR MILE RUN	002792SMH	X	RUSSELL RD	Light Highway Rural Streets	Cracked / deteriorated	Mod. 1/16"-3/8" (2-10mm) width, small pieces	03/20/2012	Truck 1	1	Structural	69	70	0	0	3
			Grade Ring	Frame Base Seal	Corroded, pitted, spalled	Min: 10-25% mat'l loss, etching ~3/8" (1cm)				Structural					
			Grade Ring	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Grade Ring	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			Grade Ring	Frame Base Seal	Offset	Mod. 2" to 3" (5-7.5cm)				Structural					
			Grade Ring	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Grade Ring	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chimney/Shft	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			Chimney/Shft	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chimney/Shft	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Chimney/Shft	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chimney/Shft	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Chimney/Shft	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
FOUR MILE RUN	002793SMH	X	RUSSELL RD	Light Highway Rural Streets	Cracked / deteriorated	Mod. 1/16"-3/8" (2-10mm) width, small pieces	03/20/2012	Truck 1	1	Structural	54	55	-0	0	3
			Chamber	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Chamber	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chamber	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chamber	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Chamber	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			BEVERLEY DR	Frame	Cracked	Mod. 1/16" to 1/8" (2-3mm) width, small depth	03/20/2012	Truck 1	1	Structural	62	64	0	0	2
			Frame Base Seal	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Frame Base Seal	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural					
			Chimney/Shft	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					
			Chimney/Shft	Frame Base Seal	II evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				II					
			Chimney/Shft	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural					
			Chimney/Shft	Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002797SMH	X	310	BEVERLEY DR	Chamber Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Cracked Corroded, pitted, spalled	Structural Structural	V/I					2
FOUR MILE RUN	002805SMH	X	1151	MARTHA CUSTIS DR	Frame Frame Base Seal Frame Base Seal Chimney/Shft Chamber Chamber	02/15/2012	02/15/2012	Truck 1	1	Min: <10% matt loss, etching Min: <1/4gpm, staining, mineral deposits, depth	Structural	52	53	0	0
FOUR MILE RUN	002806SMH	X	1151	MARTHA CUSTIS DR	Frame Frame Base Seal Frame Base Seal Chimney/Shft Chamber Chamber	04/03/2012	04/03/2012	Truck 1	1	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, spalling	Structural Structural Structural Structural Structural Structural	56	57	0	0
FOUR MILE RUN	002806SMH	X	1151	MARTHA CUSTIS DR	Frame Frame Base Seal Frame Base Seal Chimney/Shft Chamber Chamber	04/03/2012	04/03/2012	Truck 1	1	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, spalling Min: <10% matt loss, etching	Structural Structural Structural Structural Structural Structural	66	67	0	0
FOUR MILE RUN	002806SMH	X	1151	MARTHA CUSTIS DR	Frame Frame Base Seal Frame Base Seal Chimney/Shft Chamber Chamber	04/03/2012	04/03/2012	Truck 1	1	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, depth Mod: 10-25% matt loss, etching ~ 3/8" (1cm) Structural Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% matt loss, etching	Structural Structural Structural Structural Structural Structural	66	67	0	0
FOUR MILE RUN	002806SMH	X	1151	MARTHA CUSTIS DR	Frame Frame Base Seal Frame Base Seal Chimney/Shft Chamber Chamber	04/03/2012	04/03/2012	Truck 1	1	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, spalling Min: <10% matt loss, etching	Structural Structural Structural Structural Structural	59	60	0	0

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chimney/Shafft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shafft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching									
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Pipe Connection-1	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			B GUNSTON RD	Pipe cracked	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
FOUR MILE RUN	002811SMH	X	3360	Parking Lot	02/13/2012	02/13/2012	Truck 1	1		42	43	0	0	3
			Chimney/Shafft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shafft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
FOUR MILE RUN	002813SMH	X	3360	B GUNSTON RD	Light Highway Rural Streets	02/13/2012	02/13/2012	Truck 1	2	Not found	0	0	0	0
FOUR MILE RUN	002814SMH	X	3360	B GUNSTON RD	Corroded, pitted, spalled	Min: <10% mat'l loss, -3/8" (1cm) etching		Structural						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, staining, mineral deposits, flow weeping			Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Frame Base Seal	Cracked	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shafft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chimney/Shafft	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			C GUNSTON RD	Light Highway Rural Streets Offset	Mod: 2" to 3" (5-7.5cm)	02/13/2012	02/13/2012	Truck 1	1	65	66	0	0	2
			Frame	Corroded, pitted, spalled	Min: <10% mat'l loss, -3/8" (1cm) etching			Structural						
			Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
			Frame Base Seal	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chimney/Shafft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chimney/Shafft	Cracked	Min: <10% mat'l loss, etching			Structural						
			Chimney/Shafft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
			Chamber	Cracked / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
			Chamber	Cracked	Mod: general smoothness, 1/8"-3/16" (3-5mm) mat'l loss			Structural						
			Chamber	Cracked / deteriorated	Extreme: separating into pieces			Structural						
			C GUNSTON RD	Light Highway Rural Streets . Surface wear	Fit in Frame	Min: light		Structural						
			Cover	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
			Cover	Cracked / broken / deteriorated	Min: <1/16" (2mm) width			Structural						
			Frame	Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
FOUR MILE RUN	002816SMH	X	3360							99	99	0	0	3

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002817SMH	X	3360	Frame	Corroded / pitted, spalled Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Min: <10% mat'l loss, etching		Structural						
	Chimney/Shaft				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chimney/Shaft				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber				Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
	Chamber				Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
	Pipe Connection-3		C GUNSTON RD		I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
FOUR MILE RUN	002818SMH	X	3360	Frame	Light Highway Rural Streets	02/13/2012	02/13/2012	Truck 1	1	49	50	0	0	0	2
	Frame Base Seal				Cracked / broken / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chimney/Shaft				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber				Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chamber				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
FOUR MILE RUN	002818SMH	X	3360	Frame	Light Highway Rural Streets	02/13/2012	02/13/2012	Truck 1	1	72	73	0	0	0	3
	Frame				Cracked / broken / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width			Structural						
	Frame				I/I evidence	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
	Frame Base Seal				Spalled	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural						
	Frame Base Seal				Cracked / deteriorated	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) Structural									
	Chimney/Shaft				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chimney/Shaft				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber				Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
	Chamber				Cracked	Mod: 1/8" to 1/4" (3-6mm) width, pieces, missing			Structural						
	Chamber				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber				Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
	Chamber				Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
FOUR MILE RUN	002819SMH	X	3800	Frame Base Seal	I/I evidence	02/15/2012	02/15/2012	Truck 1	1	55	50	20	0	0	6
	Frame Base Seal				Roots intrusion	Min: <1/4gpm, staining, mineral deposits, flow weeping ~3/8" (1cm) dia. runner.			Maintenance						
	Frame Base Seal				Cracked / deteriorated	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chimney/Shaft				Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chamber				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chamber				Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
FOUR MILE RUN	002820SMH	X	3800	Frame Base Seal	I/I evidence	02/16/2012	02/16/2012	Truck 1	1	53	50	25	0	0	3
	Chimney/Shaft				I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
	Chimney/Shaft				Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Chamber		In evidence										
Chamber					Cracked					Min: <1/4gpm, staining, mineral deposits, flow weeping					
Bench					Corroded, pitted, spalled					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
Bench					Cracked					Min: <10% mat! loss, etching	Structural				
Bench					Debris/deposition					Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
Channel					Debris/deposition					Mod: 1-3gal bucket	Maintenance				
MILAN DR					Yard-Back					Mod: 1-3gal bucket	Maintenance				
FOUR MILE RUN	002821SMH	X	3800	Frame Base Seal	Roots intrusion					Min: ~1/16" to 1/8" (2-3mm) dia., fingers, small mass	Maintenance				
Frame Base Seal					I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Chimney/Shft					I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Pipe Connection-1					Pipe cracked					Extreme: >1/4" (6mm) width, pieces, missing	Structural				
MILAN DR					Yard-Back					Mod: 1/16"-3/8"(2-10mm) width, small pieces	Structural				
FOUR MILE RUN	002822SMH	X	3800	Frame Base Seal	Cracked / deteriorated					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Frame Base Seal					I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Chamber					I/I evidence					Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural				
Chamber					Cracked					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Pipe Connection-2					I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
MILAN DR					Light Highway Rural					Mod: 1/16"-3/8"(2-10mm) width, small pieces	Structural				
FOUR MILE RUN	002823SMH	X	3800	Frame Base Seal	Streets					Min: <10% mat! loss, <3/8" (1cm) etching	Structural				
Frame Base Seal					Corroded, pitted, spalled					Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
Frame Base Seal					Cracked / deteriorated					Min: <10% mat! loss, etching	Structural				
Frame Base Seal					I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Chimney/Shft					Corroded, pitted, spalled					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Chimney/Shft					I/I evidence					Mod: 1/16" to 1/8" (2-3mm) width, pieces, missing	Structural				
Chimney/Shft					Cracked					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
W GLEE RD			842	Frame	Light Highway Rural					Mod: 1/16"-3/8"(2-10mm) width, small pieces	Structural				
FOUR MILE RUN	002822SMH	X	3800	Frame Base Seal	Streets					Min: <10% of area	Structural				
FOUR MILE RUN	002823SMH	X	3800	Frame Base Seal	Offset					Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
Frame Base Seal					I/I evidence					Min: <10% mat! loss, etching	Structural				
Frame Base Seal					Cracked / deteriorated					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Frame Base Seal					Corroded, pitted, spalled					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Chimney/Shft					I/I evidence					Min: <10% of area	Structural				
Chimney/Shft					Bricks displaced or missing					Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
Chimney/Shft					Cracked					Min: <10% mat! loss, etching	Structural				
Chimney/Shft					I/I evidence					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
Chimney/Shft					Corroded, pitted, spalled					Min: <10% of area	Structural				
Chamber					Mortar missing					Min: <10% of area	Structural				
Chamber					Mortar missing					Min: <10% mat! loss, etching	Structural				
Chamber					Corroded, pitted, spalled										

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002834SMH	X	720	A W GLEBE RD Cover	Chamber Channel	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Maj: <5% of area		Structural Maintenance						2
FOUR MILE RUN	002834SMH	X	907	W GLEBE RD	Bricks displaced or missing Debris/deposition	Extreme: >5 gal bucket		Truck 1	1						
FOUR MILE RUN	002834SMH	X	3516	HALCYON DR	Light Highway Rural Streets	02/20/2012	02/20/2012	Truck 1							
FOUR MILE RUN	002835SMH	X	907	W GLEBE RD	Corroded, pitted, spalled Cracked / deteriorated	Mod: generally etching, 1/8" to 3/16" (3-5mm) mat'l loss Maj: >1/8" (3mm) width		Structural							
FOUR MILE RUN	002835SMH	X	802	TENNESSEE AV	Cracked / deteriorated I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16"-3/8" (2-10mm) width, small pieces		Structural							
FOUR MILE RUN	002835SMH	X	802	TENNESSEE AV	Corroded, pitted, spalled Cracked	Mod: 10-25% mat'l loss, etching ~3/8" (1cm)		Structural							
FOUR MILE RUN	002837SMH	X	802	TENNESSEE AV	Erosion	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012 02/09/2012	Truck 1	1	0	0	0	0		2
FOUR MILE RUN	002838SMH	X	802	TENNESSEE AV	Light Highway Rural Streets	04/09/2012 04/09/2012	Truck 1	1	29	29	0	0	0		3
FOUR MILE RUN	002842SMH	X	802	Cover Frame	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	02/16/2012 02/16/2012	Truck 1	1						
FOUR MILE RUN	002842SMH	X	802	TENNESSEE AV	Corroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	02/09/2012 02/09/2012	Truck 1	1						
FOUR MILE RUN	002842SMH	X	802	TENNESSEE AV	Cracked / deteriorated I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching	02/09/2012 02/09/2012	Truck 1	1						
FOUR MILE RUN	002842SMH	X	802	TENNESSEE AV	Corroded, pitted, spalled Cracked / broken / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 3/16" (3-5mm) width	Structural								
FOUR MILE RUN	002842SMH	X	802	TENNESSEE AV	Spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm)	Structural								
FOUR MILE RUN	002842SMH	X	802	TENNESSEE AV	Corroded, pitted, spalled Cracked / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural								
FOUR MILE RUN	002843SMH	X	3850	CAMERON MILLS RD Frame	Bricks displaced or missing I/I evidence	Min: <5% of area		Structural							
FOUR MILE RUN	002843SMH	X	3850	CAMERON MILLS RD	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/09/2012 02/09/2012	Truck 1	1						
FOUR MILE RUN	002843SMH	X	3850	CAMERON MILLS RD	Light Highway Rural Streets	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth		Structural							4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
			Frame#		Cracked / broken / deteriorated	May 11/16 to 3/16 (3-5mm) width			Structural							
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
			Frame Base Seal		I/ evidence	Min: <1/4gpm, staining, mineral deposits,			I/I							
			Frame Base Seal		Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces			Structural							
			Chimney/Shft		Bricks displaced or missing	Min: <4% of area			Structural							
			Chimney/Shft		Mortar missing	Min: <10% of area			Structural							
			Chimney/Shft		Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural							
			Chimney/Shft		I/ evidence	Min: <1/4gpm, staining, mineral deposits,			I/I							
			Chamber		Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural							
			Chamber		Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural							
			FOUR MILE RUN	002844SMH X	OLD DOMINION BV	Light Highway Rural Streets	03/30/2012	Truck 1	1	Min: <1/4gpm, staining, mineral deposits,						
			FOUR MILE RUN	002845SMH X	TENNESSEE AV	Corroded, pitted, spalled	03/30/2012	Truck 1	1	flow weeping	15	15	0	0	4	
			FOUR MILE RUN	002846SMH X	C GUNSTON RD	Light Highway Rural Streets	02/09/2012	Truck 1	1	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth	15	15	0	0	3	
			FOUR MILE RUN	002855SMH X	3360	Cracked / deteriorated	02/09/2012	Truck 1	1	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural					
			Frame		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
			Chimney/Shft		Bricks displaced or missing	Min: <5% of area			Structural							
			Chimney/Shft		Mortar missing	Min: <10% of area			Structural							
			Chimney/Shft		Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural							
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
			Frame		Cracked / deteriorated	04/04/2012	Truck 1	1	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth	Structural						
			Frame Base Seal		Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching			Structural							
			Frame Base Seal		I/ evidence	Mod: 10-25% mat'l loss, etching			Structural							
			Frame Base Seal		Cracked	Min: <1/4gpm, staining, mineral deposits,			Structural							
			Frame Base Seal		I/ evidence	flow weeping			Structural							
			Chimney/Shft		Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural							
			Chamber		Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural							
			Frame		Cracked	Min: <1/4gpm, staining, mineral deposits,			Structural							
			Frame		I/ evidence	flow weeping			Structural							
			Frame Base Seal		Cracked / broken / deteriorated	Min: 1/8" to 3/16" (3-5mm) width			Structural							
			FOUR MILE RUN	002858SMH X	3360	Light Highway Rural Streets	04/04/2012	Truck 1	1	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth	Structural					
			Frame		I/ evidence	Min: <1/4gpm, staining, mineral deposits,			Structural							
			Frame Base Seal		Cracked / broken / deteriorated	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural							

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot. II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	002865SMH	X	3360	Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, >3/8" (1cm) etching			Structural						
	Chimney/Shft			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chimney/Shft			Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chimney/Shft			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
	Chamber			Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
	Chamber			Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chamber			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
	Chamber			Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
FOUR MILE RUN	002865SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	04/04/2012	Truck 1	1	65	66	0	0	0	2
	Frame			Frame Base Seal	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
	Chimney/Shft			Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
	Chamber			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, >3/8" (1cm) etching			Structural						
	Chamber			Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chamber			Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
	Chamber			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
	Chamber			Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chamber			Frame Base Seal	I/ I evidence	Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	002864SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets	04/04/2012	04/04/2012	Truck 1	1	65	66	0	0	0	3
	Frame			Frame Base Seal	Corroded, pitted, spalled	Min: etching spotty, 1/16" to 1/8" (2-3mm) depth			Structural						
	Chimney/Shft			Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
	Chimney/Shft			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, >3/8" (1cm) etching			Structural						
	Chimney/Shft			Frame Base Seal	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
	Chamber			Frame Base Seal	I/ I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
	Chamber			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching			Structural						
	Chamber			Frame Base Seal	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/ I						
	Chamber			Easement	I/ I evidence	Min: <10% mat'l loss, etching			Structural						
FOUR MILE RUN	002872SMH	X	3360	C GUNSTON RD	Light Highway Rural Streets Offset	03/13/2012	03/13/2012	Truck 1	1	28	29	0	0	0	2
	Chimney/Shft			Frame	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
	Chamber			Grade Ring	Corroded, pitted, spalled	Min: <10% mat'l loss, etching			Structural						
	Chamber			Grade Ring	I/ I evidence	04/04/2012	04/04/2012	Truck 1	1	83	83	35	0	0	2
	Chamber			Grade Ring	Offset	Min: 7/8" to 2" (5.5cm)			Structural						
	Chamber			Grade Ring	I/ I evidence	Mod: 1-3gpm, trickle flow dripping			I/ I						
	Chamber			Grade Ring	Offset	Extreme: > 4" (10cm)			Structural						

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
			Grade Ring	Corroded, pitted, spalled	Mod: 10-25% mat loss, etching			Structural						
			Grade Ring	Cracked	Maj: 1/4" to 3/8" (6-10mm) width, pieces, missing			Structural						
			Chimney/Shelf	Corroded, pitted, spalled	Mod: 10-25% mat loss, etching			Structural						
			Chimney/Shelf	I/I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Chimney/Shelf	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces			Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat loss, etching			Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Chamber	Debris/deposition	Maj: 3-gal bucket			Maintenance						
			FOUR MILE RUN	Light Highway Rural Streets	04/10/2012	04/10/2012	Truck 1	1		41	0	43	0	3
			FOUR MILE RUN	Dust/deposition	Mod: 1-3gal bucket			Maintenance						
			FOUR MILE RUN	Sidewalk	02/03/2012	02/03/2012	Truck 1	1		15	15	0	0	3
			FOUR MILE RUN	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			FOUR MILE RUN	Curb/Gutter	02/03/2012	02/03/2012	Truck 1	1		15	15	0	0	2
			FOUR MILE RUN	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			FOUR MILE RUN	Curb/Gutter	02/03/2012	02/03/2012	Truck 1	1		0	0	0	0	0
			FOUR MILE RUN	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			FOUR MILE RUN	Debris/deposition	Maj: <1 gal bucket			Maintenance						
			FOUR MILE RUN	Sidewalk	02/03/2012	02/03/2012	Truck 1	1		15	15	0	0	3
			FOUR MILE RUN	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			FOUR MILE RUN	Sidewalk	02/03/2012	02/03/2012	Truck 1	1		15	15	0	0	2
			FOUR MILE RUN	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			FOUR MILE RUN	Yard-Side	02/03/2012	02/03/2012	Truck 1	1		15	15	0	0	3
			FOUR MILE RUN	Cracked / deteriorated Cover	Extreme: separating into pieces			Structural						
			FOUR MILE RUN	Chamber	Corroded, pitted, spalled			Structural						
			FOUR MILE RUN	Chamber	Cracked			Structural						
			FOUR MILE RUN	Channel	Debris/deposition			Maintenance						
			FOUR MILE RUN	Sidewalk	02/03/2012	02/03/2012	Truck 1	1		0	0	0	0	0
			FOUR MILE RUN	Sidewalk	02/03/2012	02/03/2012	Truck 1	1		26	26	0	0	5
			FOUR MILE RUN	I/I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
			FOUR MILE RUN	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			FOUR MILE RUN	Sidewalk	02/03/2012	02/03/2012	Truck 1	1		35	35	0	0	3
			FOUR MILE RUN	I/I evidence	Min: <1/4gpm, staining, mineral deposits,			I/I						
			FOUR MILE RUN	flow weeping										

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	003750IN	X	1601	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/03/2012	Truck 1	1	Structural	23	15	5	0	-2	
FOUR MILE RUN	003754IN	X	4300	Chamber Channel	Cracked Debris/deposition	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1gal bucket	02/06/2012	02/03/2012	Truck 1	1	Structural Maintenance	45	38	10	0	-3
FOUR MILE RUN	003756IN	X	4300	FOXHAVEN LA Chamber Chamber Chamber Bench Channel	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% matt loss, etching	02/06/2012	02/06/2012	Truck 1	1	Structural Structural	26	26	0	0	-2
FOUR MILE RUN	003761IN	X	4301	FOXHAVEN LA Chamber Chamber Chamber	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	02/06/2012	Truck 1	1	Structural Maintenance	37	38	0	0	-3
FOUR MILE RUN	003763IN	X	4011	W BRADDOCK RD Chamber Chamber Chamber	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	01/24/2012	01/24/2012	Truck 1	1	Structural Structural	37	38	0	0	-2
FOUR MILE RUN	003882IN	X	2005	BRADDOCK CT Chamber Chamber	Cracked Debris/deposition	Min: <10% matt loss, etching	02/07/2012	02/07/2012	Truck 1	1	Structural Structural	42	43	0	0	-2
FOUR MILE RUN	003884IN	X	4400	W BRADDOCK RD Chamber Chamber	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/07/2012	02/07/2012	Truck 1	1	Structural Structural	44	45	0	0	-2
FOUR MILE RUN	004022SMH	X	2010	N BEAUREGARD ST	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	02/07/2012	02/07/2012	Truck 1	1	Structural	0	0	0	0	1
FOUR MILE RUN	004028SMH	X	1602	IVANHOE CT Chimney/Shft	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	01/13/2012	01/16/2012	Truck 1	1	Structural	0	0	0	0	-3
FOUR MILE RUN	003885IN	X	2010	BRADDOCK CT Chamber	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/03/2012	02/03/2012	Truck 1	1	Structural	42	43	0	0	-2

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004030SMH	X	4401 W BRADDOCK RD	Easement	Fit in Frame	02/01/2012	Truck 1	1	Structural	50	51	0	0	3
	Cover				Cracked			Mort. loose	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	Chimney/Shft				Corroded, pitted, spalled				Min: <10% matt loss, etching	Structural				
	Chimney/Shft				Corroded, pitted, spalled				Min: <10% matt loss, etching	Structural				
	Chamber				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Chamber				Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	MONTECELLO BV			Light Highway Rural Streets	02/15/2012	Truck 1	1			61	62	0	0	3
	Frame Base Seal				Corroded, pitted, spalled				Min: <10% matt loss, <3/8" (1cm) etching	Structural				
	Frame Base Seal				Cracked / deteriorated				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	Grade Ring				Corroded, pitted, spalled				Min: 10-25% matt loss, etching	Structural				
	Grade Ring				Cracked				Min: 1/4" to 3/8" (6-10mm) width, pieces, missing	Structural				
	Grade Ring				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Chamber				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Chamber				Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	MONTECELLO BV			Light Highway Rural Streets	02/15/2012	Truck 1	1			49	50	0	0	3
	Frame Base Seal				Cracked / deteriorated				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Frame Base Seal				I/ evidence				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	Chimney/Shft				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Chimney/Shft				Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	Chamber				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Chamber				Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	TENNESSEE			Yard-Back	02/15/2012	Truck 1	1			0	0	0	0	2
	OLD DOMINION BV			Light Highway Rural Streets	02/21/2012	Truck 1	1			0	0	0	0	3
	OLD DOMINION BV			Light Highway Rural Streets	02/21/2012	Truck 1	1			57	58	0	0	4
	Frame Base Seal				Corroded, pitted, spalled				Min: <10% matt loss, <3/8" (1cm) etching	Structural				
	Frame Base Seal				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Frame Base Seal				Cracked / deteriorated				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	Chimney/Shft				Corroded, pitted, spalled				Min: <10% matt loss, etching	Structural				
	Chimney/Shft				Cracked				Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural				
	Chamber				I/ evidence				Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	Chamber				Mortar missing				Min: <10% area	Structural				
	SANEORN PL			Corroded, pitted, spalled					Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I				
	ANCELL ST			Cracked					Min: <10% matt loss, etching	Structural				
	FOUR MILE RUN	X	142		02/22/2012	Truck 1	1			Not Found	0	0	0	0
	FOUR MILE RUN	X	34		02/22/2012	Truck 1	1			Not Found	0	0	0	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004040SMH	X	4622 KING ST	Light Highway Rural Streets	03/09/2012	03/09/2012	Truck 1				93	94	9	0	2
			Cover	Corroded, pitted, spalled	Maj. advanced etching, 3/16" to 3/8" (5-10mm) mat'l loss				Structural						
			Frame	Corroded, pitted, spalled	Mod. generally etching, 1/8" to 3/16" (3-5mm) depth				Structural						
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
			Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural						
			Chimney/Shft	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural						
			Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				Structural						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	Light Highway Rural Streets	03/01/2012	Truck 1	1				61	58	41	0	3
			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) Structural pieces				Structural						
			Frame Base Seal	I/I evidence	Mod: 1/16"-3/8" (2-10mm) width, small pieces				Structural						
			Chimney/Shft	Cracked	Mod: 1-3gpm, trickle, flow dripping				I/I						
			Chimney/Shft	Corroded, pitted, spalled	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chamber	I/I evidence	Min: <10% mat'l loss, etching				Structural						
			Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Bench	Debris/deposition	Min: <19gal bucket				Maintenance						
			Channel	Debris/deposition	Mod: 1-3gal bucket				Maintenance						
			Pipe Connection-2	Roots intrusion	Min: ~1/16" to 1/8" (2-3mm) dia., fingers, small mass	03/01/2012	Truck 1	1	Maintenance						
			JEFFERSON DAVIS HY	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
			Chimney/Shft	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				Structural						
			Chimney/Shft	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	Cracked	Min: <10% mat'l loss, etching				Structural						
			Channel	Debris/deposition	Mod: 1-3gal bucket				Maintenance						
			JEFFERSON DAVIS HY	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Frame Base Seal	Corroded, pitted, spalled	Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
			Chimney/Shft	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling				I/I						
			Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching				Structural						
			Chamber	Cracked	Min: <10% mat'l loss, etching				Structural						
			Channel	Debris/deposition	Mod: 1-3gal bucket				Maintenance						
			JEFFERSON DAVIS HY	Light Highway Rural Streets	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling			Structural						
			Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping				I/I						
			Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) Structural				Maintenance						
FOUR MILE RUN	004042SMH	X	3700	Light Highway Rural Streets	03/01/2012	Truck 1	1				58	57	15	0	3
FOUR MILE RUN	004043SMH	X	3700	Frame Base Seal	I/I evidence	Mod: 1-3gpm, trickle, flow dripping									
FOUR MILE RUN	004043SMH	X	3700	Frame Base Seal	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching ~3/8" (1cm) Structural									

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
				Frame Base Seal	Cracked / deteriorated Mod. 1/16" to 3/8" (2-16mm) width, small pieces				Structural						
				Chimney/Shft	Corroded, pitted, spalled Min: <10% mat'l loss, etching				Structural						
				Chamber	Corroded, pitted, spalled Min: <10% mat'l loss, etching				Structural						
				Chamber	Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, I/I flow weeping				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
FOUR MILE RUN	004044SMH	X	3200	COMMONWEALTH AV	Parking Lot	03/16/2012	03/16/2012	Truck 1	1		54	53	15	0	2
				Frame Base Seal	Corroded, pitted, spalled Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
				Chimney/Shft	Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
				Chimney/Shft	Corroded, pitted, spalled Min: <1/4gpm, staining, mineral deposits, I/I flow weeping				Structural						
				Chamber	Cracked Min: <10% mat'l loss, etching				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
FOUR MILE RUN	004046SMH	X	4390	KING ST	Sidewalk	03/27/2012	03/27/2012	Truck 1	1	Not found	0	0	0	0	0
				Frame Base Seal	Corroded, pitted, spalled Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
				Frame Base Seal	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
				Chimney/Shft	Cracked / deteriorated Mod. 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
				Chamber	Corroded, pitted, spalled Min: <1/4gpm, staining, mineral deposits, I/I flow weeping				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching				Structural						
				Channel	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
FOUR MILE RUN	004047SMH	X	4700	KING ST		03/29/2012	03/29/2012	Truck 1	1	Not found	0	0	0	0	3
				Frame Base Seal	Corroded, pitted, spalled Min: <10% mat'l loss, <3/8" (1cm) etching				Structural						
				Frame Base Seal	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
				Chimney/Shft	Cracked / deteriorated Mod. 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
				Chamber	Corroded, pitted, spalled Min: <1/4gpm, staining, mineral deposits, I/I flow weeping				Structural						
				Chamber	I/I evidence Debris/deposition Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching				Structural						
				Channel	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
FOUR MILE RUN	004049SMH	X	4798	KING ST		03/29/2012	03/29/2012	Truck 1	1	Not found	0	0	0	0	3
				W GLEBE RD	Parking Lot	04/09/2012	04/09/2012	Truck 1	1		10	10	0	0	3
				Frame Base Seal	I/I evidence Debris/deposition Mod: 1-3gal bucket				Maintenance						
				SEMINARY RD FOR AV	Yard-Back	04/11/2012	04/11/2012	Truck 1	1	Not found	0	0	0	0	0
				Chamber	Cracked Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: 7/8" to 2" (2-5.5cm)				Structural						
				W BRADDOCK RD	Sidewalk	04/11/2012	04/11/2012	Truck 1	1		15	15	0	0	4
				Frame	Offset										
				Chamber	I/I evidence Debris/deposition Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, I/I flow weeping				Structural						
				Chamber	Cracked										
FOUR MILE RUN	004050SMH	X	4550												
FOUR MILE RUN	004051SMH	X	4501	SEMINARY RD											
FOUR MILE RUN	004052SMH	X	232												
FOUR MILE RUN	004053SMH	X	4798												
FOUR MILE RUN	004054SMH	X	4550												

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004061SMH	X	2200	IVOR LA Chamber	Corroded, pitted, spalled Parking lot	Min: <10% mat'l loss, etching 04/12/2012	Truck 1	1	Structural	46	46	0	0	12	
FOUR MILE RUN	004108IN	X	4448	Frame Base Seal Frame Base Seal Chamber Chamber Chamber W BRAZZOCK RD	Cracked / deteriorated I/I evidence Corroded, pitted, spalled I/I evidence Cracked Curb/Gutter	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/4" (3-6mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Mod: 1/16" to 1/4" (3-6mm) width, pieces, missing Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) dia., fingers, small mass Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1-3gal bucket	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	44	45	0	0	3	
FOUR MILE RUN	004111IN	X	4550	W BRAZZOCK RD	Corroded, pitted, spalled Cracked Curb/Gutter	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% mat'l loss, etching Mod: 1/16" to 1/4" (3-6mm) width, pieces, missing Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) dia., fingers, small mass Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1-3gal bucket	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	56	56	0	0	3	
FOUR MILE RUN	004118IN	X	4401	W BRAZZOCK RD	Corroded, pitted, spalled Cracked Curb/Gutter	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) dia., fingers, small mass Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1-3gal bucket	Structural Structural Structural Structural Structural Structural	I/I I/I I/I I/I I/I I/I	Structural Structural Structural Structural Structural Structural	26	26	0	0	2	
FOUR MILE RUN	004119IN	X	4401	W BRAZZOCK RD	Roots intrusion Corroded, pitted, spalled Cracked Curb/Gutter	Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) dia., fingers, small mass Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1-3gal bucket	Maintenance Structural Structural Structural	I/I I/I I/I I/I I/I I/I	Maintenance Structural Structural	42	26	30	0	3	
FOUR MILE RUN	004122IN	X	4550	KENMORE AV	Corroded, pitted, spalled Cracked Curb/Gutter	Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, etching Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, etching Mod: 1/16"-3/4" (1-2cm) width, chipping, etching	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	50	50	0	0	3	
FOUR MILE RUN	004152IN	X	4550	KENMORE AV	Corroded, pitted, spalled Cracked Curb/Gutter	Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, etching Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, etching Mod: 1/16"-3/4" (1-2cm) width, chipping, etching	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	50	50	0	0	2	
FOUR MILE RUN	004192IN	X	4550	Frame Base Seal	Cracked / deteriorated Corroded, pitted, spalled Cracked Curb/Gutter	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping Mod: 1/16"-3/4" (1-2cm) width, chipping, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces Min: <1/4gpm, staining, mineral deposits, flow weeping	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I I/I	Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural Structural	72	64	50	0	3	

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004218IN	X	4660	KENNMORE AV	Channel	Debris/deposition	Extreme >5 gal bucket	1	Maintenance	50	50	0	0	3
FOUR MILE RUN	004218IN	X	4660	Chamber	Sidewalk	03/28/2012	03/28/2012	Truck 1	I/I					
FOUR MILE RUN	004218IN	X	4660	Chamber	Cracked	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	1	Structural					
FOUR MILE RUN	004218IN	X	4660	Chamber	Corroded, pitted, spalled	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Mod: 10-25% mat! loss, etching	Structural						
FOUR MILE RUN	004218IN	X	4660	W BRADDOCK RD	Sidewalk	04/11/2012	04/11/2012	Truck 1	I/I					
FOUR MILE RUN	004219IN	X	4550	Chamber	Corroded, pitted, spalled	Min: <10% mat! loss, etching	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
FOUR MILE RUN	004219IN	X	4550	Chamber	Cracked	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural					
FOUR MILE RUN	004221IN	X	4550	W BRADDOCK RD	Debris/deposition	02/06/2012	02/06/2012	Truck 1	Maintenance					
FOUR MILE RUN	004221IN	X	4550	Chamber	Parking Lot	02/06/2012	02/06/2012	Truck 1	I/I					
FOUR MILE RUN	004222IN	X	4500	W BRADDOCK RD	Cracked	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
FOUR MILE RUN	004222IN	X	4500	KIRKLAND PL.	Cracked	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural					
FOUR MILE RUN	004227IN	X	4550	W BRADDOCK RD	Curb/Gutter	02/08/2012	02/08/2012	Truck 1	I/I					
FOUR MILE RUN	004227IN	X	4550	Chamber	Cracked	I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural						
FOUR MILE RUN	004228IN	X	4401	W BRADDOCK RD	Easement	02/06/2012	02/06/2012	Truck 1	I/I					
FOUR MILE RUN	004228IN	X	4401	Frame	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
FOUR MILE RUN	004603IN	X	4575	Frame Base Seal	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural						
FOUR MILE RUN	004603IN	X	4575	Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural						
FOUR MILE RUN	004610IN	X	4342	SEMINARY RD	Cracked, pitted, spalled Curb/Gutter	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Mod: 10-25% mat! loss, etching	I/I	Structural					
FOUR MILE RUN	004610IN	X	4342	LOYOLA AV	Cracked	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural					
FOUR MILE RUN	004613IN	X	1612	STONEBRIDGE RD	Cracked, pitted, spalled Curb/Gutter	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Mod: 1-3gpm, trickle, flow dripping	I/I	Structural					
FOUR MILE RUN	004613IN	X	1612	Chamber	Corroded, pitted, spalled Cracked	Min: <10% mat! loss, etching	Min: <1/4gpm, staining, mineral deposits, flow weeping	I/I	Structural					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	004615IN	X	4326	LOYOLA AV	Chamber	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/03/2012	Truck 1	1	/I	26	25	0	0	2
FOUR MILE RUN	004620IN	X	4324	LOYOLA AV	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/03/2012	Truck 1	1	/I	35	35	0	0
FOUR MILE RUN	004634IN	X	1600	SEMINARY RD	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/04/2012	Truck 1	1	Structural				4
FOUR MILE RUN	004642IN	X	4404	IVANHOE CT	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/03/2012	Truck 1	1	Structural				1
FOUR MILE RUN	004645IN	X	1600	IVANHOE CT	Chamber	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	04/02/2012	Truck 1	1	Structural				3
FOUR MILE RUN	004646IN	X	2200	IVOR LA	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/03/2012	Truck 1	1	Structural				3
FOUR MILE RUN	004650IN	X	4615	SEMINARY RD	Chamber	Corroded, pitted, spalled	Mod: 10-25% mat'l loss, etching	02/03/2012	Truck 1	1	Structural				2
FOUR MILE RUN	004651IN	X	4555	STONERIDGE RD	Easement	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/06/2012	Truck 1	1	Maintenance				4
FOUR MILE RUN	004657IN	X	1612	STONERIDGE RD	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/06/2012	Truck 1	1	Structural				2
FOUR MILE RUN	004658IN	X	1616	Cover	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/02/2012	Truck 1	1	Structural				2
FOUR MILE RUN	006308IN	X	317	E RAYMOND AV	Chamber	Cracked / deteriorated	Extreme: separating into pieces	02/02/2012	Truck 1	1	Structural				2
FOUR MILE RUN	006426IN	X	3581	JEFFERSON DAVIS HY	Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/05/2012	Truck 1	1	Structural				2
FOUR MILE RUN	006427IN	X	3425	JEFFERSON DAVIS HY	Chamber	Corroded, pitted, spalled	Min: <10% mat'l loss, etching	04/05/2012	Truck 1	1	Structural				2

Basin	MH	SCREAM Insp	Building Address	Location	Date Spalling	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	006432IN	X	3681	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/05/2012	Truck 1	I	37	38	0	0	2	
FOUR MILE RUN	006438IN	X	3825	JEFFERSON DAVIS HY Chamber	Cracked	Corroded, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	04/05/2012	Truck 1	1	26	26	0	0	
FOUR MILE RUN	006441IN	X	328	JEFFERSON DAVIS HY Chamber	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/05/2012	Truck 1	I/I	26	26	0	0	3	
FOUR MILE RUN	006451IN	X	106	ASHBY ST E REED AV	Cracked	Min: <1/4gpm, staining, mineral deposits, flow weeping	04/05/2012	Truck 1	I/I	68	69	0	0	2	
FOUR MILE RUN	006457IN	X	2809	MT VERNON AV ANCELL ST	Cracked, pitted, spalled I/I evidence	Extreme: >1/4" (6mm) width, pieces, missing	03/22/2012	Truck 1	I	63	64	0	0	3	
FOUR MILE RUN	006789IN	X	1	ANCELL ST	Cracked, pitted, spalled I/I evidence	Mod: 10-25% mat'l loss, etching	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/22/2012	Truck 1	I/I	Not Opened	0	0	0	
FOUR MILE RUN	006791IN	X	1	ANCELL ST	Cracked, pitted, spalled I/I evidence	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/27/2012	Truck 1	I	0	0	0	0	3	
FOUR MILE RUN	006792IN	X	3	Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	02/27/2012	Truck 1	I	54	55	0	0	.3
FOUR MILE RUN	006793IN	X	1	Frame Base Seal	Corroded, pitted, spalled	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	03/06/2012	Truck 1	I/I					
FOUR MILE RUN	006794IN	X	1	Chamber	Cracked	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Min: <10% mat'l loss, etching	02/22/2012	Truck 1	I					
FOUR MILE RUN	006806IN	X	110	HUME AV	Corroded, pitted, spalled I/I evidence	Mod: 10-25% mat'l loss, etching ~ 3/8" (1cm)	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/27/2012	Truck 1	I	54	55	0	0	3
FOUR MILE RUN	006807IN	X	110	Frame	Cracked, pitted, spalled	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Min: <10% mat'l loss, etching	02/27/2012	Truck 1	I/I	77	77	0	0	2
FOUR MILE RUN	006808IN	X	110	Frame Base Seal	Corroded, pitted, spalled	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Min: <1/4gpm, staining, mineral deposits, flow weeping	02/27/2012	Truck 1	I					
FOUR MILE RUN	006809IN	X	110	Frame Base Seal	Cracked / deteriorated	Mod: 1/16"-3/8" (2-10mm) width, small pieces	Min: <10% mat'l loss, etching	02/27/2012	Truck 1	I/I					
FOUR MILE RUN	006810IN	X	110	Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, etching	Min: 25-50% mat'l loss, 3/8"-3/4" (1-2cm)	02/27/2012	Truck 1	I					

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
					Mortar missing	Mod: 10-25% of area			Structural						
FOUR MILE RUN	006819IN	X	504	MONTICELLO BV	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			I/I						
					Corroded, pitted, spalled Sidewalk	Mod: 25-50% mat'l loss, etching	02/15/2012	Q215/2012	Truck 1	1	53	49	15	0	2
FOUR MILE RUN	006892IN	X	3900	JEFFERSON DAVIS HY	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	03/26/2012	Q326/2012	Truck 1	1					
FOUR MILE RUN	006894IN	X	3951	JEFFERSON DAVIS HY	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Cracked	Mod: 10-25% mat'l loss, etching	03/26/2012	Q326/2012	Truck 1	1	62	60	15	0	2
FOUR MILE RUN	006895IN	X	3925	JEFFERSON DAVIS HY	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Cracked	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	03/02/2012	Q302/2012	Truck 1	1					
FOUR MILE RUN	006905IN	X	3800	JEFFERSON DAVIS HY	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Cracked	Mod: <10% mat'l loss, etching	03/02/2012	Q302/2012	Truck 1	1	28	29	0	0	1
FOUR MILE RUN	006906IN	X	3800	JEFFERSON DAVIS HY	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Cracked	Mod: <10% mat'l loss, etching	03/02/2012	Q302/2012	Truck 1	1	37	38	0	0	1
FOUR MILE RUN	006907IN	X	3750	JEFFERSON DAVIS HY	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Cracked	Mod: <10% mat'l loss, etching	03/02/2012	Q302/2012	Truck 1	1	26	26	0	0	1
FOUR MILE RUN	007006IN	X	3114	RUSSELL RD	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Corroded, pitted, spalled Sidewalk	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	03/20/2012	Q320/2012	Truck 1	1	48	49	0	0	1
FOUR MILE RUN	007012IN	X	312	BEVERLEY DR	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping			Structural						
					Corroded, pitted, spalled Curb/Gutter	Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	02/15/2012	Q215/2012	Truck 1	1	26	26	0	0	2

Basin	MH	SCREAM Insp	Building Address	Location	Date Spalling	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	007079IN	X	2	E REED AV Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping	Truck 1	1	Structural	61	61	0	0	2
FOUR MILE RUN	007082IN	X	3700	JEFFERSON DAVIS HY Chamber	Cracked	Major: 1/8" to 1/4" (3-5mm) width, pieces, missing	Truck 1	1	Structural					
FOUR MILE RUN	007082IN	X	3700	JEFFERSON DAVIS HY Chamber	Corroded, pitted, spalled Mortar missing	Mod: 10-25% matl loss, etching			Structural					
FOUR MILE RUN	007086IN	X	3750	JEFFERSON DAVIS HY Frame Base Seal	I/I evidence	Min: <10% of area flow weeping	Truck 1	1	I/I	55	56	0	0	3
FOUR MILE RUN	007086IN	X	3750	JEFFERSON DAVIS HY Frame Base Seal	Cracked / deteriorated	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural					
FOUR MILE RUN	007086IN	X	3750	JEFFERSON DAVIS HY Chamber	Corroded, pitted, spalled	Min: <10% matl loss, <3/8" (1cm) etching	Truck 1	1	Structural					
FOUR MILE RUN	007086IN	X	3750	JEFFERSON DAVIS HY Chamber	Corroded, pitted, spalled I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	Structural					
FOUR MILE RUN	007086IN	X	3750	JEFFERSON DAVIS HY Pipe Connection-3	Pipe cracked	Min: <10% matl loss, etching	Truck 1	1	Structural					
FOUR MILE RUN	007089IN	X	3800	JEFFERSON DAVIS HY Chamber	I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/I	57	57	0	0	3
FOUR MILE RUN	007089IN	X	3700	COMMONWEALTH AV Cover	Cracked / deteriorated	Mod: 10-25% matl loss, etching ~ 3/8" (1cm) depth	Truck 1	1	Structural					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Frame	I/I evidence	Mod: 1/16" to 3/8" (2-10mm) width, small pieces	Truck 1	1	Structural					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Frame Base Seal	Corroded, pitted, spalled	Min: <1/4gpm, staining, mineral deposits, flow weeping	Truck 1	1	I/I					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Chimney/Shaff	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	Structural					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Chamber	I/I evidence	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	I/I					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Chamber	Corroded, pitted, spalled Debris/deposition	Min: <10% matl loss, etching	Truck 1	1	Structural					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Channel	Driveway	Mod: 1-3gal bucket			Maintenance					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Chimney/Shaff	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	Structural					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Chamber	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Truck 1	1	Structural					
FOUR MILE RUN	007090IN	X	3700	COMMONWEALTH AV Chamber	Corroded, pitted, spalled	Min: <10% matl loss, etching	Truck 1	1	Structural					

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	997092IN	X	3700	COMMONWEALTH AV Chamber	I/I evidence	Mfr. <1/4gpm, staining, mineral deposits, flow weeping <u>03/01/2012</u>	Truck 1	1	Structural	60	44	35	,0	,2
FOUR MILE RUN	007093IN	X	3700	Chimney/Shaff Chamber Chamber Chamber Channel	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	I/I	Structural						
FOUR MILE RUN	007107IN	X	.51	COMMONWEALTH AV	Corroded, pitted, spalled Debris/position	Min: <10% mat'l loss, etching Maj: 3-5gal bucket	Maintenance	1	Structural	44	45	0	0	3
FOUR MILE RUN	007110IN	X	100	W REED AV	Sidewalk	<u>03/01/2012</u>	Truck 1	1	Moderately etched, staining, mineral deposits, flow weeping <u>02/28/2012</u>	44	45	0	0	2
FOUR MILE RUN	007114IN	X	100	DALE ST	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural							
FOUR MILE RUN	007115IN	X	101	DALE ST	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping <u>02/28/2012</u>	Structural							
FOUR MILE RUN	007123IN	X	3625	EDISON ST	Curb/Gutter	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	1	Moderately etched, staining, mineral deposits, flow weeping <u>02/28/2012</u>	44	45	0	0	3
FOUR MILE RUN	007149IN	X	3603	RUSSELL RD	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	1	Moderately etched, staining, mineral deposits, flow weeping <u>02/28/2012</u>	66	65	15	0	4
FOUR MILE RUN	007170IN	X	3700	JEFFERSON DAVIS HY	Pipe Connection-1	Pipe cracked	Mod: generally etching, 1/8" to 3/16" (3- 5mm) depth Maj: 1/8" to 1/4" (3-6mm) width, pieces, massing	Structural						
FOUR MILE RUN	007170IN	X	3700	Frame Base Seal Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural							
FOUR MILE RUN	007170IN	X	3700	Easement	Cracked / deteriorated	Min: <10% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, chipping, spalling	Structural	1	No Access	0	0	0	0	3
FOUR MILE RUN	007170IN	X	3700	Frame Base Seal Chamber Chamber	Corroded, pitted, spalled Cracked	Min: <10% mat'l loss, <3/8" (1cm) etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	1	No Access	0	0	0	0	2
FOUR MILE RUN	007170IN	X	3700			Corroded, pitted, spalled	Min: <10% mat'l loss, etching			54	55	0	0	4

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	007329IN	X	3125	Pipe Connection-4 MT VERNON AV Chamber	Pipe cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: ~1/16" (2mm) width					42	43	0	0	3
FOUR MILE RUN	007336IN	X	3125	Chimney/Shft Chamber Chamber Chamber Pipe Connection-2 MT VERNON AV Chimney/Shft Chamber Chamber Chamber Chamber Chamber Chamber	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: ~1/16" (2mm) width	Truck 1	1	Structural						
FOUR MILE RUN	007337IN	X	3125	MT VERNON AV Chamber Chamber Chamber Chamber Chamber Chamber Chamber	Cracked I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: <10% mat'l loss, etching Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1-3gal bucket	Truck 1	1	Structural						
FOUR MILE RUN	007340IN	X	3125	MT VERNON AV Chamber Chamber Chamber Chamber B GUNSTON RD	Corroded, pitted, spalled I/I evidence	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Truck 1	1	Structural						
FOUR MILE RUN	007402IN	X	3380	Chimney/Shft MILAN DR Chamber	Cracked I/I evidence	Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Truck 1	1	Maintenance						
FOUR MILE RUN	007421IN	X	3800	FLORENCE DR Chimney/Shft A W GLEBE RD	Corroded, pitted, spalled Cracked Curb/Gutter	Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Truck 1	1	Structural						
FOUR MILE RUN	007443IN	X	3889	COURTLAND CL Chimney/Shft Chimney/Shft	Corroded, pitted, spalled Cracked I/I evidence	Min: <10% mat'l loss, etching Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1/4gpm, staining, mineral deposits, flow weeping. Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Truck 1	1	Structural						
FOUR MILE RUN	008405IN	X									50	51	0	0	2

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct I score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	008416IN	X	511	FOUR MILE RD	Chimney/Shft Chamber Chamber Chamber Channel	I/I evidence@ Cracked Coroded, pitted, spalled I/I evidence	Min: <1/4gpm, staining, mineral deposits, Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <10% mat'l loss, etching	Structural Structural I/I					.0	1	
FOUR MILE RUN	008417IN	X	4001	M T VERNON AV	Chamber Chamber Chamber Channel	Cracked Debris/deposition	Min: <10% mat'l loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Maj: 3-gal bucket	Structural Structural Maintenance	Truck 1	1	53	29	.35	0	
FOUR MILE RUN	008418IN	X	4007	M T VERNON AV	Chamber Chamber Chamber Chamber	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Maj: 3-gal bucket	Structural Structural Maintenance	Truck 1	1	43	38	.15	0	
FOUR MILE RUN	008419IN	X	4109	M T VERNON AV	Channel	Cracked Debris/deposition	Mod: 10-25% mat'l loss, etching Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural Structural	Truck 1	1	61	54	.35	0	
FOUR MILE RUN	008428IN	X	3869	COURTLAND CL	Chamber Chamber Chamber Chamber	Cracked Easement	Min: <10% of area	Maintenace			0	0	0	3	
FOUR MILE RUN	008433IN	X	511	FOUR MILE RD	Chamber Chamber Chamber Channel	Cracked Debris/deposition	Min: <1/4gpm, staining, mineral deposits, flow weeping Maj: 3-gal bucket	Structural Structural Maintenance	Truck 1	1	57	45	.35	0	
FOUR MILE RUN	008444IN	X	470	W GLEBE RD	Chamber Chamber Chamber Channel	Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Maj: 3-gal bucket	Structural Maintenance	Truck 1	1	50	45	.15	0	
FOUR MILE RUN	008445IN	X	470	W GLEBE RD	Chamber Chamber Chamber Channel	Cracked I/I evidence	Min: <1/4gpm, staining, mineral deposits, flow weeping Maj: 3-gal bucket	Structural Maintenance	Truck 1	1	48	.45	.5	0	

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	008450IN	X	470	W GIEBE RD	Corroded, pitted, spalled Debris/deposition	Min: <10% mat! loss, etching		Structural Maintenance	I/I	46	38	25	0	1
FOUR MILE RUN	008461IN	X	511	FOUR MILE RD	Yard-Front	02/21/2012	Truck 1	1	Min: <1/4gpm; staining, mineral deposits, flow weeping					
FOUR MILE RUN	008473IN	X	3911	EDISON ST	Cracked	Min: 1/16" to 1/8" (2-3mm) width, chipping, spalling		Structural	I/I					
FOUR MILE RUN	008508IN	X	3625	EDISON ST	Corroded, pitted, spalled Debris/deposition	Mod: 1-3gal bucket		Maintenance	I/I					
FOUR MILE RUN	008509IN	X	3620	EDISON ST	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural	I/I					
FOUR MILE RUN	008510IN	X	3620	TENNESSEE AV	Corroded, pitted, spalled Curb/Gutter	02/20/2012	Truck 1	1	Min: <10% mat! loss, etching					
FOUR MILE RUN	008604IN	X	201	LANDOVER ST	Corroded, pitted, spalled I/I evidence	02/20/2012	Truck 1	1	Min: <1/4gpm; staining, mineral deposits, flow weeping					
FOUR MILE RUN	008607IN	X	3315	CHAMBER	Cracked	Mod: 1/16" to 1/8" (2-3mm) width, small pieces		Structural	I/I					
FOUR MILE RUN	008611IN	X	251	BURGESS AV	Mortar missing	02/22/2012	Truck 1	1	Min: <10% of area					
FOUR MILE RUN	008723IN	X	3603	MT VERNON AV	Corroded, pitted, spalled Curb/Gutter	02/22/2012	Truck 1	1	Min: <1/4gpm, staining, mineral deposits, flow weeping					
FOUR MILE RUN	008723IN	X	3603	MT VERNON AV	Cracked	Min: <10% mat! loss, etching		Structural	I/I					
FOUR MILE RUN	008723IN	X	3603	MT VERNON AV	Easement	02/28/2012	Truck 1	1	Mod: 1/16" to 1/8" (2-3mm) width, small pieces				Debris	0

Basin	MH	SCREAM Insp	Building	Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes
FOUR MILE RUN	008727IN	X	3606	MT VERNON AV	Parking Lot	02/28/2012	02/28/2012	Truck 1	Structural	Sealed Lid	0	0	0	0	3
FOUR MILE RUN	008772IN	X	3360	B GUNSTON RD	Corroded, pitted, spalled Sidewalk	04/03/2012	04/03/2012	Truck 1	1	Structural	0	0	0	0	0
FOUR MILE RUN	008808IN	X	414	TENNESSEE AV	Sidewalk	03/30/2012	03/30/2012	Truck 1	1	Structural	50	50	0	0	3
FOUR MILE RUN	008812IN	X	3360	C GUNSTON RD	Corroded, pitted, spalled Cracked	04/17/2012	04/17/2012	Truck 1	1	Structural	0	0	0	0	3
FOUR MILE RUN	008813IN	X	3360	C GUNSTON RD	I/I evidence Pipe cracked	04/17/2012	04/17/2012	Truck 1	1	Structural	60	45	45	0	2
FOUR MILE RUN	008815IN	X	3360	C GUNSTON RD	I/I evidence Chamber	04/17/2012	04/17/2012	Truck 1	1	Structural	0	0	0	0	2
FOUR MILE RUN	008832IN	X	3516	HALCYON DR	Chamber Chamber Bench Channel	04/17/2012	04/17/2012	Truck 1	1	Maintenance Debris/deposition	71	57	72	0	2
FOUR MILE RUN	008903IN	X	1616	STONEBRIDGE RD	Chamber Chamber Chamber Cover	04/17/2012	04/17/2012	Truck 1	1	Maintenance Roots intrusion	49	50	0	0	3
FOUR MILE RUN	009004IN	X	1602	CHAPEL HILL DR	Cracked I/I evidence	02/03/2012	02/03/2012	Truck 1	1	Maintenance Roots intrusion	37	38	0	0	2
FOUR MILE RUN	009015IN	X	19	ANCELL ST	Corroded, pitted, spalled Alley	03/05/2012	03/05/2012	Truck 1	1	Maintenance Roots intrusion	0	0	0	0	0
FOUR MILE RUN	009015IN	X		Chamber	Min: <10% mat'l loss, etching	Not Found	36	29	5	0	0	0	0	.2	

Basin	MH	SCREAM Insp	Building Address	Location	Date	Alternate Link	Crew	Status	Why Not Inspected	Overall MH Score	MH Struct II score	MH Maint Score	MH Pot II Field Flow (gpm)	# Connecting Pipes	
FOUR MILE RUN	009016IN	X	27 ANCELL ST	Cracked Debris/deposition	Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Min: <1 gal bucket	03/06/2012 03/06/2012	Truck 1	1	Maintenance	0	0	0	0	2	
FOUR MILE RUN	009017IN	X	35 ANCELL ST	Alley	Alley	03/06/2012	Truck 1	1	I/I evidence	0	0	0	0	2	
FOUR MILE RUN	009022IN	X	4700 KING ST	Sidewalk	03/29/2012 03/29/2012	Truck 1	1	Corroded, pitted, spalled Cracked Mod: 1/16" to 1/8" (2-3mm) width, mineral deposits, flow weeping Mod: 10-25% matt loss, etching	Structural	50	50	0	0	2	
FOUR MILE RUN	009023IN	X	4700 KING ST	Chamber Chamber Chamber Chamber	I/I evidence Mod: 1/16" to 1/8" (2-3mm) width, small pieces	03/29/2012 03/29/2012	Truck 1	1	Mod: 1/16" to 1/8" (2-3mm) width, small pieces Mod: 10-25% matt loss, etching	Structural	50	50	0	0	2
FOUR MILE RUN	009024IN	X	4798 KING ST	Easement	I/I evidence	03/29/2012 03/29/2012	Truck 1	1	Corroded, pitted, spalled I/I evidence Mod: 1/16" to 1/8" (2-3mm) width, mineral deposits, flow weeping Mod: 10-25% matt loss, etching	Structural	50	50	0	0	3
FOUR MILE RUN	009031IN	X	4480 KING ST	Curb/Gutter	I/I evidence	04/11/2012 04/11/2012	Truck 1	1	Corroded, pitted, spalled Cracked Mod: 1/16" to 1/8" (2-3mm) width, mineral deposits, flow weeping Mod: 10-25% matt loss, etching	Structural	42	38	5	0	3
FOUR MILE RUN	009035IN	X	4550 W BRADDOCK RD	Light Highway Rural Streets	I/I evidence	04/12/2012 04/12/2012	Truck 1	1	Corroded, pitted, spalled I/I evidence Mod: 1/16" to 1/8" (2-3mm) width, mineral deposits, flow weeping Mod: 10-25% matt loss, etching	Structural	35	35	0	0	2
FOUR MILE RUN	009036IN	X	4550 W BRADDOCK RD	Easement	I/I evidence	04/12/2012 04/12/2012	Truck 1	1	Cracked Mod: 1/16" to 1/8" (2-3mm) width, small pieces	Structural	43	44	0	0	2
FOUR MILE RUN	009037IN	X	4550 KENMORE AV	Debris/deposition	I/I evidence	04/12/2012 04/12/2012	Truck 1	1	<10% matt loss, etching Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/16" to 1/8" (2-3mm) width, chipping, spalling Mod: <10% matt loss	Maintenance	35	35	0	0	2
FOUR MILE RUN	009039IN	X	2200 IVOR LA	Chamber Chamber Chamber Chamber	I/I evidence	04/12/2012 04/12/2012	Truck 1	1	Corroded, pitted, spalled Sidewalk Mod: 1/16" to 1/8" (2-3mm) width, mineral deposits, flow weeping Mod: 10-25% matt loss, etching	Structural	44	45	0	0	2
FOUR MILE RUN	009039IN	X	2200 IVOR LA	Chamber Chamber Chamber	I/I evidence	04/12/2012 04/12/2012	Truck 1	1	Cracked I/I evidence Corroded, pitted, spaled Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <1/4gpm, staining, mineral deposits, flow weeping Min: <10% matt loss, etching	Structural	37	38	0	0	2

Appendix C – Summary of Structures Not Inspected

Facility ID	Why Not Inspected
000175SMH	Not Inspected - Sealed Lid
002267SMH	Not Inspected - Sealed Lid
000177SMH	Not Inspected - Sealed Lid
003706IN	Not Inspected - Sealed Lid
008772IN	Not Inspected - Sealed Lid
000054ND	Not Inspected - Not found
000056ND	Not Inspected - Not found
000131ND	Not Inspected - Not found
000297CB	Not Inspected - Not found
000373SMH	Not Inspected - Not found
000476ND	Not Inspected - Not found
001187ND	Not Inspected - Not found
001257ND	Not Inspected - Not found
001355ND	Not Inspected - Not found
001360ND	Not Inspected - Not found
001371ND	Not Inspected - Not found
001405ND	Not Inspected - Not found
001406ND	Not Inspected - Not found
001418ND	Not Inspected - Not found
001854SMH	Not Inspected - Not found
002074SMH	Not Inspected - Not found
002075SMH	Not Inspected - Not found
002813SMH	Not Inspected - Not found
004038SMH	Not Inspected - Not found
004039SMH	Not Inspected - Not found
004046SMH	Not Inspected - Not found
004049SMH	Not Inspected - Not found
004051SMH	Not Inspected - Not found
009004IN	Not Inspected - Not found
002097SMH	Not Inspected - No Access
002100SMH	Not Inspected - No Access
006747IN	Not Inspected - No Access
000330IN	Not Inspected - No Access
002156SMH	Not Inspected - No Access
007115IN	Not Inspected - No Access
007123IN	Not Inspected - No Access
008508IN	Not Inspected - No Access
008509IN	Not Inspected - No Access
008510IN	Not Inspected - No Access
008723IN	Not Inspected - Debris
002832SMH	Not Inspected - D.N.E

Appendix D - Summary of Observed Pipe Defects

SCREAM™ Lamping - Summary of Observed Defects

Alexandria - Four Mile Run

Pipe	SCREAM Total Score			USMH Bldg		MH Street		Observed Infiltration (Count)		Inventory Information		Maintenance Debris Roots (Length)		Structural Crack Longitudinal (Length)		Obstacle Intruding (Count)		Open Joint	
	Dimension Change (Count)	General Remark (Count)	Debris (Length)	Roots (Length)	Broken, Pieces (Count)	Collapse (Count)	Crack Circumferential (Count)	Crack Longitudinal (Length)	Cracks Multiple (Length)	Obstacle Protruding (Count)	Open (Count)	Open Joint	Dimension Change (Count)	General Remark (Count)	Debris (Length)	Roots (Length)	Broken, Pieces (Count)	Collapse (Count)	
002061SMH-	13	2832	MT VERNON AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
001210ND-	13	2930	MT VERNON AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
002061SMH-	13	2826	MT VERNON AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
001210ND	13	2311	MT VERNON AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
001997SMH-	13	920	OVERLOOK DR	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
001998SMH-	13	2623	FOSTER AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
007411IN-	13	2936	MT VERNON AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
002816SMH-	13	3917	ELBERT AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000130ND-	13	3800	MILAN DR	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000260SMH-	13	4301	BRADDOCK RD	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
002710SMH-	13	4301	BRADDOCK RD	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
002079SMH-	13	2212	FORT WARD PL	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
002822SMH-	13	4903	28TH ST	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
002821SMH-	13	5190	DAWES AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000438IN-	13	2280	BEAUREGARD ST	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000431IN-	13	5100	FILLMORE AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000432IN	13	4007	MT VERNON AV	1	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000404IN-	20	5100	FILLMORE AV	2	0	0	0	0	0	0	0	0	0	0	0	0	0	0	0
000164SMH-																			
000099SMH-																			
000102SMH-																			
000401SMH-																			
000400SMH-																			
001101IN																			
000362SMH-																			
000389SMH-																			
000931IN-																			
000084IO																			
002081SMH-																			
002079SMH-																			
000928IN-																			
000931IN																			

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when scored. Note that this occurs across merged inspections. See the inspection for more information.

Pipe	SCREAM Total Score	USMH Bldg	MH Street	Observed		Inventory Information		Maintenance		Structural		Obstacle Intruding		Open Joint (Count)	
				Infiltration (Count)	Infiltration (Count)	Dimension Change (Count)	General Remark (Count)	Debris (Length)	Roots (Length)	Broken, Pieces (Count)	Collapse (Count)	Crack, Circumferential (Count)	Crack, Longitudinal (Length)	Cracks Multiple (Length)	
000921IN-	20	2280	BEAUREGARD ST	2	0	0	0	0	0	0	0	0	0	0	0
000362SMH-	000165SMH-	20	2206	FORT WARD PL	2	0	0	0	0	0	0	0	0	0	0
000404IN-	000165SMH-	20	2208	FORT WARD PL	2	0	0	0	0	0	0	0	0	0	0
000461IN-	000165SMH-	20	3319	OLD DOMINION BV	0	0	0	0	0	0	0	0	4	0	0
006918IN-	002231SMH-	25	3603	RUSSELL RD	0	0	0	0	0	0	0	0	4	0	0
002745SMH-	002207SMH-	25	3609	RUSSELL RD	0	0	0	0	0	0	0	0	4	0	0
002856ND-	002742SMH-	30	201	TENNESSEE AV	0	0	0	0	0	0	0	0	0	0	1
008604IN-	008607IN	30	4903	28TH ST	0	0	1	0	0	0	0	0	0	0	1
002006ND-	000099SMH-	32	4	REED AV	0	0	0	0	8	0	0	0	0	0	0
001806SMH-	004041SMH-	32	3800	KING ST	0	0	0	4	0	0	0	0	0	0	0
000122SMH-	000126SMH-	33	3214	LANDOVER ST	0	0	0	0	0	0	0	1	0	0	0
002180SMH-	002181SMH-	40	10	REED AV	0	0	0	0	0	0	0	0	8	0	0
007082IN-	007086IN	40	4	REED AV	0	0	0	0	0	0	0	0	0	4	0
007170IN-	007082IN	40	2901	RUSSELL RD	0	0	0	0	0	0	0	0	4	0	0
002634SMH-	001948SMH-	40	328	HUME AV	0	0	0	0	0	0	0	0	4	0	0
001869SMH-	001813SMH-	40	106	REED AV	0	0	0	0	0	0	0	0	4	0	0
000368IO-	002652SMH-	40	507	MONTICELLO BV	0	0	0	0	0	0	0	0	4	0	0
004033SMH-	002112SMH-	40	505	MONTICELLO BV	0	0	0	0	0	0	0	0	4	0	0
002237SMH-	002235SMH	40	710	CHALFONTE DR	0	0	0	0	0	0	0	0	4	0	0
000315SMH-	000316SMH-	40	4899	BRADDOCK RD	0	0	0	0	0	0	0	0	4	0	0
000164SMH-	000025IO	40	2212	FORT WARD PL	0	0	0	0	0	0	0	0	8	0	0
002836ND-	000390SMH	40	4822	KING ST	0	0	1	0	0	0	0	0	4	0	0

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when score that occurs across merged inspections. See the inspection for more information.

Pipe	SCREAM Total Score	USM/H Bldg	MH Street	Observed Infiltration		Inventory Information		Maintenance		Structural		Obstacle Intruding	Obstacle Protruding (Count)	Open Joint (Count)	
				Infiltration (Count)	Dimension Change (Count)	General Remark (Count)	Debris (Length)	Roots (Length)	Broken pieces (Count)	Collapse (Count)	Crack Circumferential (Count)	Crack Longitudinal (Length)			
000370SMH-000371SMH	40	4651	KING ST	0	0	0	0	0	0	0	0	0	4	0	0
000183SMH-000187SMH	40	3900	KING ST	0	0	0	0	0	0	0	0	0	4	0	0
000393IN-000176SMH	40	2419	MARLBORO DR	0	0	0	0	0	0	0	0	0	4	0	0
008812IN-008815IN	40	2800	SHIRLINGTON RD	1	0	0	4	0	0	0	0	0	0	0	0
000110SMH-000111SMH	40	4300	KING ST	0	0	0	0	0	0	0	0	0	4	0	0
000246IN-000257IN	40	3101	PARK CENTER DR	0	0	0	0	0	0	0	0	0	4	0	0
009037IN-009036IN	40	4550	KENMORE AV	0	0	0	0	0	0	0	0	0	4	0	0
007003IN-002791SMH	40	3110	RUSSELL RD	0	0	0	0	0	0	0	0	0	4	0	0
000248CB-002683SMH	40	2819	RUSSELL RD	0	0	0	0	0	0	0	0	0	4	0	0
000121SMH-000122SMH	40	2425	MENOKIN DR	0	0	0	0	0	0	0	0	0	4	0	0
006291IN-001869SMH	40	328	HUNIE AV	0	0	0	0	0	0	0	0	0	4	0	0
001240ND-002123IN-	40	2904	OLD DOMINION BV	0	0	0	0	0	0	0	0	0	4	0	0
002129SMH-002233CB-	40	2804	OLD DOMINION BV	0	0	0	0	0	0	0	0	0	4	0	0
0027787SMH-006455IN-	40	3200	OLD DOMINION BV	0	0	0	0	0	0	0	0	0	4	0	0
000097CB-001793SMH-	40	107	REED AV	0	0	0	0	0	0	0	0	0	4	0	0
001792SMH-000130SMH-	40	60	REED AV	0	0	0	0	0	0	0	0	0	4	0	0
000133SMH-000305CB-	40	3901	KING ST	0	0	0	0	0	0	0	0	0	4	0	0
0022861ND-008666IN-	40	3205	MT VERNON AV	0	0	0	0	0	0	0	0	0	4	0	0
002731SMH-001166ND-	40	2901	RUSSELL RD	0	0	0	0	0	0	0	0	0	4	0	0
002684SMH-00249CB-	40	2901	RUSSELL RD	0	0	0	0	0	0	0	0	0	4	0	0
002684SMH-000129SMH	40	3846	KING ST	0	0	0	0	0	0	0	0	0	4	0	0
000131SMH															

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when scored. Note that this occurs across merged inspections. See the inspection for more information.

Pipe	SCREAM Total Score	USMH Bldg	NH Street	Observed Infiltration (Count)	Inventory		Maintenance		Structural		Obstacle Intruding (Count)	Open Joint (Count)	
					Dimension Change (Count)	General Remark (Count)	Debris (Length)	Roots (Length)	Broken pieces	Collapse (Count)	Crack Circumferential (Count)		
002858SMH-	40	1819	QUAKER LA	0	0	0	0	0	0	0	0	4	0
0017404ND	40	1066	GLEBE RD	0	0	0	0	0	0	0	0	4	0
007386IN-	40	414	TENNESSEE AV	0	0	0	0	0	0	0	0	4	0
002809SMH-	40	3800	MILAN DR	0	0	0	0	0	0	0	0	4	0
008807IN-	40	2800	OLD DOMINION BV	0	0	0	0	0	0	0	0	4	0
002110SMH-	40	3214	OLD DOMINION BV	0	0	0	0	0	0	0	0	4	0
000192CB-	40	705	CHALFONTE DR	0	0	0	0	0	0	0	0	4	0
002235SMH-	40	3105	OLD DOMINION BV	0	0	0	0	0	0	0	0	4	0
000191CB-	40	100	DALE ST	0	0	0	0	0	0	0	0	4	0
002235SMH-	40	309	MONTICELLO BV	0	0	0	0	0	0	0	0	4	0
000225CB-	40	2311	COMMONWEALTH AV	0	0	0	0	0	0	0	0	4	0
002102SMH-	40	21	HERBERT ST	0	0	0	0	0	0	0	0	4	0
000168CB-	40	329	CLIFFORD AV	0	0	0	0	0	0	0	0	4	0
002008SMH-	40	1	ANCELL ST	0	0	0	0	0	0	0	0	4	0
007330IN-	40	07329IN		0	0	0	0	0	0	0	0	4	0
006294IN-	40	3100	COMMONWEALTH AV	0	0	0	0	0	0	0	0	4	0
001813SMH-	40	2800	SHIRLINGTON RD	1	0	4	0	0	0	0	0	4	0
006791IN-	40	45	HUME AV	0	0	0	0	0	0	0	0	4	0
002759SMH-	40	201	RANDOLPH AV	0	0	0	0	0	0	0	0	4	0
008815IN-	45	204	RANDOLPH AV	0	0	0	0	0	0	0	0	4	0
001106ND	45	3101	HAMPTON DR	0	1	0	0	0	0	0	0	1	0
001868SMH-	50	5100	FILLMORE AV	0	0	0	0	1	0	0	0	0	0
000261CB-	53	2425	MENOKIN DR	0	0	0	1	0	0	0	0	0	0
002046SMH-	53	0001059IN		0	0	0	0	0	0	0	0	1	0
000011IO	53	000892IN		0	0	0	0	1	0	0	0	0	0
000127SMH-	53	000126SMH-		0	0	0	0	0	0	0	0	0	0

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when score that this occurs across merged inspections. See the inspection for more information.

Pipe	SCREAM Total Score	USM/H Bldg	MH Street	Observed		Inventory Information		Maintenance		Structural					
				Infiltration	Infiltration (Count)	Dimension Change (Count)	General Remark (Count)	Debris	Roots	Broken pieces	Collapse	Crack	Crack Longitudinal (Length)	Obstacle Intruding	Open Joint (Count)
000923IN-000362SMH-	53	2280	BEAUREGARD ST	0	0	0	0	0	0	1	0	0	0	0	0
000154SMH-	53	2249	EARLY ST	0	0	0	0	0	0	1	0	0	0	0	0
000153SMH-			GLEE RD	0	0	0	0	0	0	1	0	0	0	0	0
002069ND-	53	232													
0004050SMH-															
000123SMH-	54	3800	KING ST	1	0	0	0	0	4	0	0	0	0	4	0
000122SMH-															
002069SMH-	59	3002	MT VERNON AV	1	0	0	0	0	0	1	0	0	0	0	0
000260SMH-															
002713SMH-	62	66	KENNEDY ST	0	0	0	0	0	1	0	0	0	0	4	0
002845SMH-	73	950	GLEE RD	0	0	0	0	0	0	0	0	0	0	1	0
002314SMH-															
008449IN-008444IN-	73	458	GLEE RD	0	0	0	0	0	0	0	0	0	0	1	0
001481SMH-	100	4560	SEMINARY RD	0	0	0	0	0	0	1	0	0	0	0	0
001486SMH-															
000071ND-	100	2500	VAN DORN ST	0	0	1	4	0	0	0	0	0	0	0	0
Total				30	1	59	4	24	7	1	1	12	216	2	3

Defects are grouped together by Defect Code, continuous defect lengths are added or point defects are counted when scored. Note that this occurs across merged inspections. See the inspection for more information.

